



CONDITION REPORT

Report No: 2016274450

DATE
20/02/2024

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	20/02/2024		M57 Pretoria Road - 1619
Inspection Date	20/02/2024		Kempton Park - GT

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	MFC AUCTION HOUSE
Manufacturer	RENAULT	Registration Number	JD79RVGP
Model	CLIO	Register Number	
VIN	VF15RSV0A61730901	Date Of First Licensing	
Engine Number		Last COR	
Doors	5	License Expiry Date	30/09/2023
Color	WHITE	Power / Displacement	
Year Model		Paint Finish	TWO COAT UNI
Km Reading	123,269 KM	Fuel	PETROL
Cab / Body Type	HATCHBACK	Transmission	MANUAL

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

Damage	Repair Way
Engine Wiring Defective	Repair
Under bonnet insulation cover Damaged	Replace
Windscreen Wiper Damaged	Replace
Headlight Left Damaged	Replace
Headlight Right Damaged	Replace
Seat Front Left Damaged	Repair
Seat Front Right Damaged	Repair
Seat Rear Damaged	Repair
Seat Belt Front Left Defective	Replace
Hood Lining Dirty	Repair
Door Lock Front Left Malfunction	Replace
Clutch Pedal Rubber Missing	Replace
Number Plate Front Dented	Replace
Front Bumper Damaged	Repair
Grill Paintwork • Scratched	Repair
Bonnet Dented	Repair
B • Pillar Right Paintwork • Scratched	Repair
C • Pillar Left Paintwork • Scratched	Repair
Front Fender Left Paintwork • Scratched	Repair
Front Fender Right Paintwork • Scratched	Repair
Rear Fender Left Paintwork • Scratched	Repair
Rear Fender Right Residual Traces of Repair	Repair
Door Front Left Paintwork • Scratched	Repair
Door Front Right Paintwork • Scratched	Repair
Door Rear Left Paintwork • Scratched	Repair
Door Rear Right Residual Traces of Repair	Repair
Boot Lid / Hatch door Paintwork • Scratched	Repair
Rear bumper Damaged	Repair
Inner Boot Floor Pan and Spare Wheel Well Damaged	Repair

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: VF15RSV0A61730901

1 / 18



CONDITION REPORT

Report No: 2016274450

 DATE
20/02/2024

Damage	Repair Way
Sill Panel Left Paintwork • Scratched	Repair
Sill Panel Right Paintwork • Scratched	Repair
Rocker Panel Left Damaged	Repair
Roof Dented	Repair
Windscreen Cracked	Replace
Stabilizer Mounting Front Left Defective	Replace
Stabilizer Mounting Front Right Defective	Replace
Rear Axle Damaged	Repair
Mounting Rubber(s) Rear Axle Left Cracked	Replace
Mounting Rubber(s) Rear Axle Right Cracked	Replace
Rim Front Right Dented	Repair
Rim Rear Left Dented	Repair
Rim Rear Right Dented	Repair
Rim Spare Wheel Dented	Repair
Chassis Damaged	Repair
Belly plates Damaged	Replace
Engine	Engine bay dirty. Brake fluid level ok.
Engine	Signs of rodent in engine bay.
Engine management light illuminated dashboard	Repair
Interior	Vehicle interior dirty.
Interior	Some interior panels scratched.
Body and Exterior	Dents and scratches on some body panels
Body and Exterior	Stone chips and spray work on some body panels
Body and Exterior	Some body panels misaligned
Tyres and Rims	Alloy rims scratched
Axle and suspension	Abnormal noise coming from front and rear suspensi
Body and Exterior	Front left inner fender liner damaged
Engine	Aircon condenser dented
Undercarriage	Vehicle undercarriage dirty.
Undercarriage	Exhaust heat shields damaged
Undercarriage	Bottom of engine and gearbox fully covered
Body and Exterior	Boot does not open.
Body and Exterior	Signs of impact damage to front of vehicle

Brakes

Brake Test Results

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s ²]
Front	2.73	2.9	-	
Rear	2.69	3.11	-	
Emergency / Parking	1.67	1.89	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	205/55 R16	91V	Firestone	Touring	V	3422	5 mm
Front Right	205/55 R16	91V	Firestone	Touring	V	3422	3 mm
Rear Left	205/55 R16	91V	Firestone	Touring	V	3422	3 mm
Rear Right	205/55 R16	91V	Firestone	Touring	V	3422	5 mm
Spare	185/65 R15	88T	Barium	Brillantis	V	3618	5 mm

* Tyre Legend: V=Virgin, R=Recap



CONDITION REPORT

Vehicle No: 2016274450

2 / 18

DATE

20/02/2024

Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

No	System	Code	Description	Status
1	INJECTION	DTC013511	UPSTREAM OXYGEN SENSOR HEATING CIRCUIT SHORT CIRCU	

Inspection Conditions

No Test Drive

Battery Flat

Engine number – not possible to verify engine number (not visible without dismantling)

Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Sibusiso Mokase

This document was created electronically and is valid without signature.


General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.




CONDITION REPORT

Report No: 2016274450

VIN: VF15RSV0A61730901

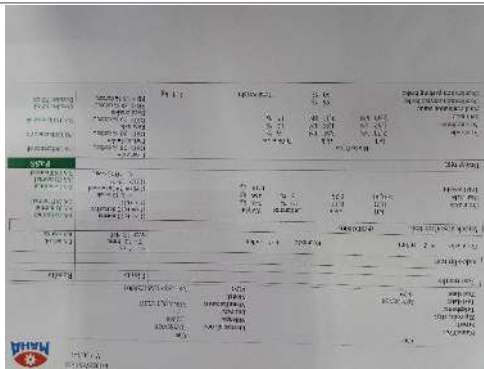DATE
3
20/02/2024

Brake and shock absorber report

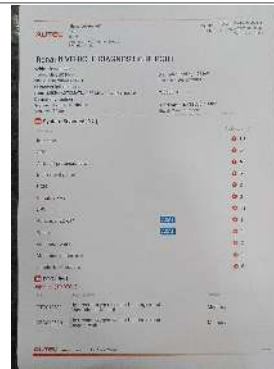

Diagnostic report page 1



Diagnostic report page 2



Diagnostic report page 3



Diagnostic report page 4



Diagnostic report page 5

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016274450

VIN: VF15RSVQ66073980
DATE: 20/02/2024
4 / 18

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016274450

DATE
20/02/2024

VIN: VF15RSV0A61730901

5 / 18



FRONT RIGHT CORNER



REAR LEFT CORNER



INTERIOR (FRONT DRIVER DOOR)



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER



90 DEGREE FRONT



CONDITION REPORT

Report No: 2016274450

DATE
20/02/2024

VIN: VF15RSV0A61730901
6 / 18

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016274450

DATE
20/02/2024

90 DEGREE RIGHT



90 DEGREE REAR

VIN: VF15RSMJA61730901
7 / 18

90 DEGREE LEFT



LF TYRE TREAD



LR TYRE TREAD



RR TYRE TREAD

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016274450

DATE
20/02/2024

VIN: VF15RSV0A61730901
8 / 18

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016274450

DATE
20/02/2024





CONDITION REPORT

Report No: 2016274450

DATE
20/02/2024

VIN: VF15RSV0A61730901
10 / 18

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016274450

DATE
20/02/2024

Rear chassis



Aircon condenser

A61730901
11 / 18

Manual Transmission



Oil cap and dipstick



Headlight Left



Headlight Right



CONDITION REPORT

Report No: 2016274450

DATE
20/02/2024

VIN: VF15RSV0A61730901

12 / 18

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016274450

DATE
20/02/2024

Under bonnet insulation cover



Water level

VIN: VF15RSV0A61730901
13 / 18

Engine Wiring



Seat Belt Front Left



Hood Lining



Seat Front Right



CONDITION REPORT

Report No: 2016274450

DATE
20/02/2024

VIN: VF15RSV0A61730901
14 / 18

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016274450

DATE
20/02/2024

B • Pillar Right



Sill Panel Right



Sill Panel Right



Seat Rear



C • Pillar Left



Sill Panel Left



CONDITION REPORT

Report No: 2016274450

DATE
20/02/2024

VIN: VF15RSV0A61730901
16 / 18

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016274450

DATE
20/02/2024

Sill Panel Left



Seat Front Left

VIN: VF15RSV0A61730901

17 / 18



Windscreen Wiper



Front Bumper



Front Bumper



Bonnet



CONDITION REPORT

Report No: 2016274450

DATE
20/02/2024

VIN: VF15RSV0A61730901
18 / 18

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016274450

DATE
20/02/2024

Grill



Windscreen



Rear bumper



Rear bumper



Boot Lid / Hatch door



Roof



CONDITION REPORT

Report No: 2016274450

DATE
20/02/2024

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016274450

DATE
20/02/2024

Number Plate Front



Front Fender Right



Door Front Right



Door Rear Right



Rear Fender Right



Rear Fender Left



CONDITION REPORT

Report No: 2016274450

DATE
20/02/2024

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016274450

DATE
20/02/2024

Door Rear Left



Rocker Panel Left



Door Lock Front Left



Door Front Left



Rocker Panel Left



Front Fender Left



CONDITION REPORT

Report No: 2016274450

DATE
20/02/2024

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016274450

DATE
20/02/2024

Rim Front Right



Stabilizer Mounting Front Right



Stabilizer Mounting Front Left



Belly plates



Belly plates



Chassis

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016274450

DATE
20/02/2024

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016274450

DATE
20/02/2024

Chassis



Rocker Panel Left



Rim Spare Wheel



Rim Rear Left



Rim Rear Right



Inner Boot Floor Pan and Spare Wheel Well



CONDITION REPORT

Report No: 2016274450

DATE
20/02/2024

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016274450

DATE
20/02/2024


Inner Boot Floor Pan and Spare Wheel Well



Rear bumper



Mounting Rubber(s) Rear Axle Right

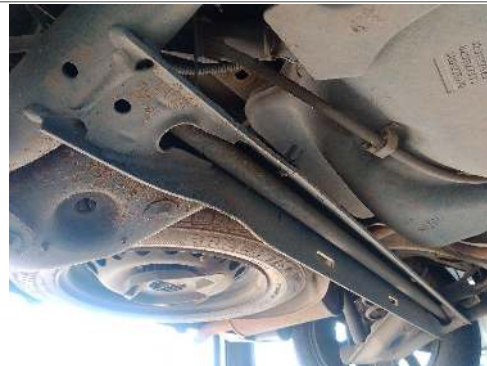

Rear Axle



Mounting Rubber(s) Rear Axle Left



Clutch Pedal Rubber

**CONDITION REPORT****Report No: 2016274450****DATE**
20/02/2024

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za