

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	26/03/2024		M57 Pretoria Road - 1619
Inspection Date	26/03/2024		Kempton Park - GT

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	MFC AUCTION HOUSE
Manufacturer	PEUGEOT	Registration Number	DUPLOOYGP
Model	3008	Register Number	
VIN	VF3M45GYVKS429372	Date Of First Licensing	
Engine Number		Last COR	
Doors	5	License Expiry Date	31/10/2023
Color	SILVER	Power / Displacement	
Year Model		Paint Finish	TWO COAT UNI
Km Reading	92,926 KM	Fuel	PETROL
Cab / Body Type	HATCHBACK	Transmission	AUTOMATIC

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

Damage	Repair Way
Center Console / Cubbyhole + Lid Defective	Repair
Seat Front Right Damaged	Repair
Seat Rear Dirty	Repair
Side Mirror Right Damaged	Repair
Front Bumper Paintwork • Scratched	Repair
Bonnet Paintwork • Chipmarks	Repair
Front Fender Right Paintwork • Scratched	Repair
Rear Fender Right Paintwork • Scratched	Repair
Door Front Left Paintwork • Scratched	Repair
Door Front Right Dented	Repair
Door Rear Right Paintwork • Scratched	Repair
Rear bumper Paintwork • Scratched	Repair
Parking Brake Performance Malfunction	Repair
Tyre Front Left Defective	Replace
Tyre Front Right Damaged	Replace
Tyre Rear Left Damaged	Replace
Belly plates Defective	Repair
Vehicle electronics malfunctioning	Repair
Engine bay dirty	Clean
Undercarriage dirty	Clean

Brakes

Brake Test Results

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s ²]
Front	3.11	2.88	-	
Rear	2.41	2.74	-	
Emergency / Parking	1.79	2.04	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	225/55 R18	98V	Michelin	Primacy	V	3719	1 mm
Front Right	225/55 R18	98V	Michelin	Primacy	V	3719	0 mm
Rear Left	225/55 R18	98V	Michelin	Primacy	V	3719	0 mm
Rear Right	225/55 R18	98V	Michelin	Primacy	V	3719	1 mm
Spare	225/55 R18	98V	Michelin	Primacy	V	3619	7 mm

* Tyre Legend: V=Virgin, R=Recap

Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

No	System	Code	Description	Status
1	BUILT-IN SYSTEMS INTERFACE(BSI)---BSI2010_EV	U1F39:87	NO COMMUNICATION WITH RAIN/LIGHT SENSOR	

Inspection Conditions

No Test Drive

Battery Flat

Engine number – not possible to verify engine number (not visible without dismantling)

Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS.SPRAY WORK DONE ON VARIOUS BODY PANELS. SOME BODY PANELS MISALIGNED.VEHICLE INTERIOR DIRTY AND SOME PANELS SCRATCHED

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE
ENGINE AND GEARBOX COVERE
D

Technician

Sibusiso Mokase

This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.



REAR LEFT CORNER



FRONT RIGHT CORNER



90 DEGREE FRONT



90 DEGREE REAR



90 DEGREE RIGHT



90 DEGREE LEFT



ODOMETER



DASHBOARD (W/ ENGINE RUNNING)



INTERIOR (FRONT DRIVER DOOR)



Automatic transmission



LF TYRE TREAD



LR TYRE TREAD



RR TYRE TREAD



RF TYRE TREAD



Spare wheel and Accessories



Oil cap and dipstick



Front chassis




Rear chassis



ENGINE 1




VIN PLATE OR STICKER

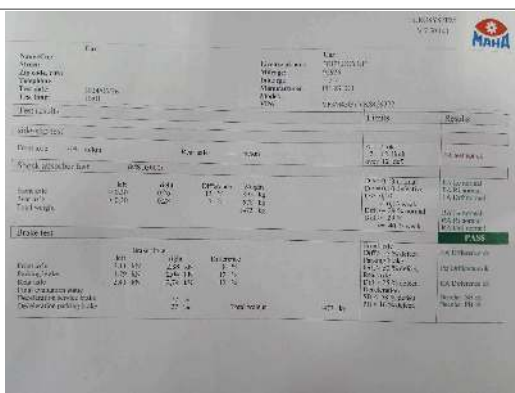


BRAKE AND SHOCK REPORT



LICENSE DISC

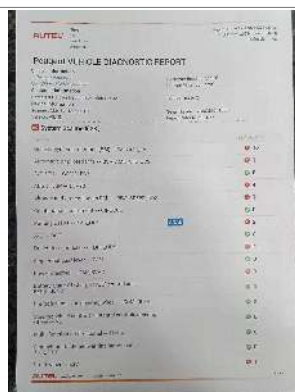


DIAGNOSTIC REPORT PAGE 1

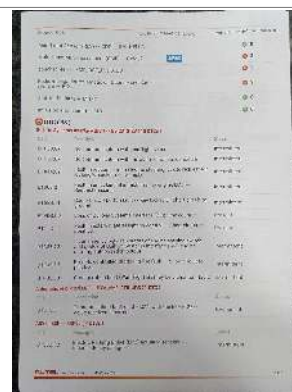

DIAGNOSTIC REPORT PAGE 2



DIAGNOSTIC REPORT PAGE 3

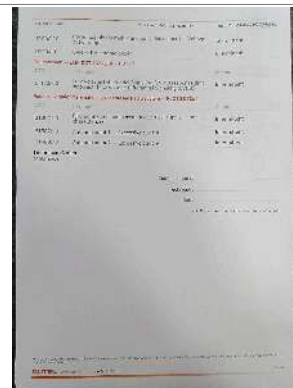

DIAGNOSTIC REPORT PAGE 4



Seat Front Right



Seat Rear



Door Front Right



Front Fender Right



Side Mirror Right



Door Rear Right



Rear Fender Right



Rear bumper



Rear bumper



Door Front Left



Seat Rear



Front Bumper



Front Bumper



Bonnet



Center Console / Cubbyhole + Lid



Tyre Front Left



Tyre Front Right



Belly plates



Tyre Rear Left



Water level



Parking Brake Performance



CONDITION REPORT

Report No: 2016318268

DATE
26/03/2024

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za