

MFC Auction House  
M57 Pretoria Rd, Glenmarais, KEMPTON PARK  
Gauteng

DEKRA MFC  
M57 Pretoria Rd - 1619  
KEMPTON PARK - GT  
08610 33572



## Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	15/05/2025		M57 Pretoria Road - 1619
Inspection Date	15/05/2025		Kempton Park - GT

## Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	
Manufacturer	OPEL	Registration Number	KLT002MP
Model	CORSA 1.0 TURBO ESSENTIA 5-DR [2017-2019]	Register Number	
VIN	W0L0XEP68H4243982	Date Of First Licensing	
Engine Number		Last COR	
Doors	5	License Expiry Date	28/02/2025
Color	WHITE	Power / Displacement	
Year Model	2017	Paint Finish	TWO COAT UNI
Km Reading	145,090 KM	Fuel	PETROL
Cab / Body Type	HATCHBACK	Transmission	MANUAL

## Vehicle Options & Accessories

### Items

## VEHICLE INSPECTION

Damage	Repair Way
Engine Oil Leak	Repair
Air Conditioner Insufficient	Replace
Door Handle Front Right Damaged	Replace
Parcel Tray Damaged	Repair
Carpet Front Damaged	Repair
Side Mirror Right Paintwork • Scratched	Repair
Bonnet Paintwork • Chipmarks	Repair
Front Fender Left Residual Traces of Repair	Repair
Front Fender Right Paintwork • Scratched	Repair
Rear Fender Left Paintwork • Scratched	Repair
Rear Fender Right Paintwork • Scratched	Repair
Door Front Left Paintwork • Scratched	Repair
Door Front Right Paintwork • Scratched	Repair
Door Rear Left Paintwork • Scratched	Repair
Door Rear Right Paintwork • Scratched	Repair
Boot Lid / Hatch door Paintwork • Scratched	Repair
Rear bumper Paintwork • Scratched	Repair
Inner Boot Floor Pan and Spare Wheel Well Dented	Repair
Windscreen Chipped	Repair

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za

VIN: W0L0XEP68H4243982

Damage	Repair Way
Tyre Rear Left Worn	Replace
Tyre Rear Right Damaged	Replace
Sub Frame Dented	Repair
Engine to silencer pipe Damaged	Repair
Gearbox Oil Leak	Repair
Jack Missing	Replace
Wheel Spanner Missing	Replace
Triangle Missing	Replace
Engine	Cylinder head cover cracked.
Body and Exterior	Dents and scratches on some body panels
Interior	Vehicle interior dirty and some panels scratched
Tyres and rims	Front and rear hubcaps scratched.
Body and Exterior	Stone chips and spray work on some body panels
Body and Exterior	Residual traces of repair on some body panels
Tyres and rims	Front and rear tyre sizes different
Tyres and rims	Spare wheel missing

## Brakes

### Brake Test Results

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s <sup>2</sup> ]
Front	2.95	2.8	-	
Rear	2.2	2.43	-	
Emergency / Parking	1.37	1.36	-	

## Tyres and Rims

### Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	185/65 R15	92H	Sumitomo	HTR H5	V	1921	2 mm
Front Right	185/65 R15	92H	Sumitomo	HTR T5	V	1921	3 mm
Rear Left	185/65 R15	88H	Continental	ContiEco	V	1017	0 mm
Rear Right	185/65 R15	92H	Dunlop	Sp-Sport	V	3717	0 mm

\* Tyre Legend: V=Virgin, R=Recap

## Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

No	System	Code	Description	Status
1	ELECTRONIC BRAKE CONTROL MODULE	C0800:03	CONTROL MODULE POWER CIRCUIT-LOW VOLTAGE	

## Inspection Conditions

No Test Drive  
Battery Flat  
Engine number – not possible to verify engine number (not visible without dismantling)  
Inspection conditions for the vehicle inspection were sufficient

## Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS.

### Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

### Technician

Sibusiso Mokase


This document was created electronically and is valid without signature.

General Remarks:

The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

[illegible]

Brake and shock absorber report



Republika Srbija  
 Ministarstvo obrazovanja i nauke  
 Beograd, 11000  
 Tel: +381 (0)11 264 1234  
 Fax: +381 (0)11 264 1235  
 E-mail: [info@mon.gov.rs](mailto:info@mon.gov.rs)

Broj: 100/2023-1  
 Beograd, 15. Oktobra 2023. godine  
 18. Oktobra 2023. godine

## IZJAVA O ODRZIVOSTI INOVACIJA

**Ime i prezime:** Dimitrije Stokich  
**Adresa:** Bulevar Oslobođenja 111, Beograd  
**Telefon:** +381 (0)11 123 4567  
**E-mail:** d.stokich@gmail.com  
**Broj dokumenta:** 100/2023-1  
**Datum:** 15. Oktobra 2023.

**Ime i prezime:** Dimitrije Stokich  
**Adresa:** Bulevar Oslobođenja 111, Beograd  
**Telefon:** +381 (0)11 123 4567  
**E-mail:** d.stokich@gmail.com  
**Broj dokumenta:** 100/2023-1  
**Datum:** 15. Oktobra 2023.

**Ime i prezime:** Dimitrije Stokich  
**Adresa:** Bulevar Oslobođenja 111, Beograd  
**Telefon:** +381 (0)11 123 4567  
**E-mail:** d.stokich@gmail.com  
**Broj dokumenta:** 100/2023-1  
**Datum:** 15. Oktobra 2023.

Diagnostic report page 1

[illegible]

Diagnostic report page 2

[illegible]

Diagnostic report page 3

[illegible]

Diagnostic report page 4

[illegible]

Diagnostic report page 5



Diagnostic report page 6



FRONT RIGHT CORNER



REAR LEFT CORNER



INTERIOR (FRONT DRIVER DOOR)



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER





Manual Transmission



90 DEGREE FRONT



90 DEGREE RIGHT



90 DEGREE REAR



90 DEGREE LEFT



LF TYRE TREAD



LR TYRE TREAD




RR TYRE TREAD



RF TYRE TREAD



LICENSE DISC

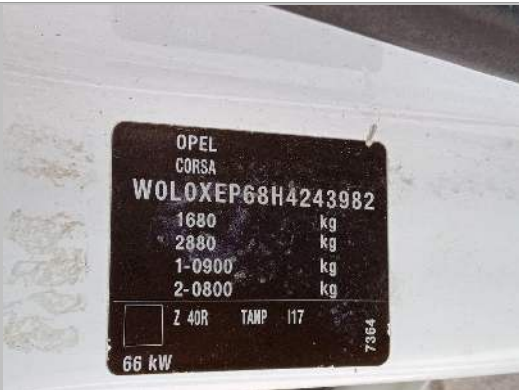

VIN PLATE OR STICKER



ENGINE 1





Front chassis



Rear chassis



Oil cap and dipstick



Carpet Front



Windscreen



Door Handle Front Right





Water level



Engine



Door Front Right



Door Rear Right



Rear Fender Right



Side Mirror Right



Front Fender Right



Bonnet



Front Fender Left



Rear Fender Left



Door Rear Left



Door Front Left



Rear bumper



Rear bumper



Boot Lid / Hatch door



Inner Boot Floor Pan and Spare Wheel Well



Parcel Tray



Air Conditioner





Tyre Rear Right



Gearbox



Sub Frame



Engine to silencer pipe



Tyre Rear Right



Tyre Rear Left