



CONDITION REPORT

Report No: 2016204298

DATE
18/12/2023

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	18/12/2023		M57 Pretoria Road - 1619
Inspection Date	18/12/2023		Kempton Park - GT

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	MFC
Manufacturer	AUDI	Registration Number	CG54GDGP
Model	A5	Register Number	
VIN	WAUZZZ8T7CA039079	Date Of First Licensing	
Engine Number		Last COR	
Doors	4	License Expiry Date	31/03/2020
Color	SILVER	Power / Displacement	
Year Model		Paint Finish	TWO COAT UNI
Km Reading	164,270 KM	Fuel	PETROL
Cab / Body Type	SEDAN	Transmission	AUTOMATIC

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

Damage	Repair Way
Engine Oil Leak	Repair
Engine Wiring Defective	Repair
Bonnet stay and shocks Damaged	Replace
Headlight Left Defective	Repair
Headlight Right Defective	Repair
Hood Lining Dirty	Repair
Door Sealing Rubber Front Right Damaged	Replace
Side Mirror Left Paintwork • Scratched	Repair
Front Bumper Paintwork • Scratched	Repair
Grill Paintwork • Flaking	Repair
Bonnet Residual Traces of Repair	Repair
Front Fender Right Paintwork • Scratched	Repair
Rear Fender Right Residual Traces of Repair	Repair
Door Front Left Paintwork • Scratched	Repair
Door Front Right Residual Traces of Repair	Repair
Door Rear Left Paintwork • Scratched	Repair
Door Rear Right Residual Traces of Repair	Repair
Boot Lid / Hatch door Paintwork • Scratched	Repair
Rear bumper Paintwork • Scratched	Repair
Rocker Panel Left Dented	Repair
Rocker Panel Right Dented	Repair
Windscreen Damaged	Replace
Back Window Defective	Repair
Shock Absorber Front Left Sweat	Replace
Shock Absorber Front Right Sweat	Replace
Control Arm Bush(es) Front Axle Left Cracked	Replace
Control Arm Bush(es) Front Axle Right Cracked	Replace
Tyre Rear Left Damaged	Replace
Cross Member Rear Left Dented	Repair

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WAUZZZ8T7CA039079

1 / 17



CONDITION REPORT

Report No: 2016204298

 DATE
18/12/2023

Damage

Cross Member Rear Right Dented
 Belly plates Damaged
 Gearbox Oil Leak
 Differential Oil Sweat
 CV Joint(s) Rear Left (inner/outer) Defective
 CV Joint(s) Rear Right (inner/outer) Defective
 Engine Performance Idling / Hunting
 Jack Missing
 Wheel Spanner Missing
 Warning lights illuminated on dashboard

Repair Way

Repair
 Repair
 Repair
 Repair
 Repair
 Repair
 Repair
 Replace
 Replace
 Repair

Brakes

Brake Test Results

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s ²]
Front	-	-	-	
Rear	-	-	-	
Emergency / Parking	-	-	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	245/40 R18	93Y	Continental	ContiSport	V	1719	3 mm
Front Right	245/40 R18	97Y	Ceat	Sport drive	V	3852	6 mm
Rear Left	245/40 R18	97Y	Pirelli	Cinturato	V	2717	0 mm
Rear Right	245/40Z R18	97Y	Radar	Dimax	V	4719	5 mm
Spare	T125/70 R19	100M	Hankook	Temporary	V	0112	4 mm

* Tyre Legend: V=Virgin, R=Recap

Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

No	System	Code	Description	Status
1	01-ENGINE CONTROL MODULE 1	U041700	INVALID DATA RECEIVED FROM PARK BRAKE CONTROL UNIT	

Inspection Conditions

No Test Drive
 Battery Flat
 Engine number – not possible to verify engine number (not visible without dismantling)
 Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS.
 Engine Compartment: Engine bay dirty. Brake fluid level ok. Oil level could not be checked due to electronics malfunctioning. Oil leak on engine splash plate. Bottom of engine and gearbox covered cannot pin direction of oil leak. Engine fan is constantly On. Signs of water leak on front right side of engine.
 Electrical Components and Instruments: Electronic parking brake faulty. Vehicle electronics malfunctioning. Front left and right headlight washers not working.
 Interior: Vehicle interior dirty and some interior panels scratched.
 Body • Exterior: Dents and scratches on some body panels. Spray work on some body panels. Some body panels misaligned. Stone chips on some body panels. Residual traces of repair on some body panels.
 Brakes: Abnormal noise coming from of vehicle when applying brakes.
 Axle and Suspension: Abnormal noise coming from front and rear suspension.
 Tyres and Rims: Alloy rims scratched. Spare wheel lock down pin and bracket loose.
 Undercarriage: Vehicle undercarriage dirty. Right side subframe bolt not tightened. Signs of surface rust on undercarriage. Excessive oil leak on bottom of engine.
 Road Test: Gearbox faulty

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

DEKRA Automotive (PTY) Ltd.
 97 Willem Cruywagen Ave
 Klerksoord, Pretoria, 0200
 Phone: 012 542 4867
 www.dekraauto.co.za



CONDITION REPORT

VIN: WAUZZZ887G1600098
Report No: 2016204298

2 / 17
DATE
18/12/2023

Technician

Sibusiso Mokase

This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

Shock absorber report

Diagnostic report page 1Diagnostic report page 2Diagnostic report page 3Diagnostic report page 4Diagnostic report page 5




CONDITION REPORT

Report No: 2016204298

DATE
VIN: WAUZZZ8T7C0090023
16/12/2023
4 / 17

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

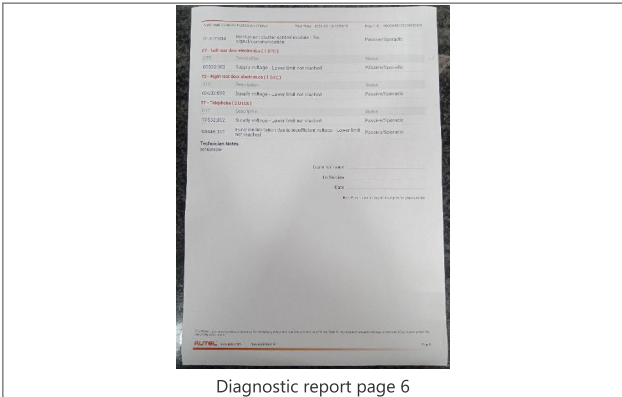



CONDITION REPORT

Report No: 2016204298

DATE
18/12/2023

VIN: WAUZZZ8T7CA039079
6 / 17

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016204298

DATE
18/12/2023

VIN: WAUZZZ8T7CA039079

7 / 17



90 DEGREE FRONT




90 DEGREE RIGHT




90 DEGREE REAR



90 DEGREE LEFT

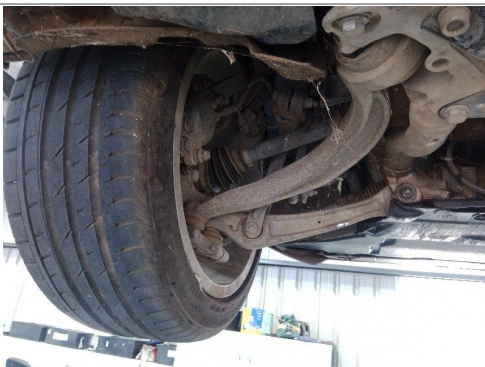

LF TYRE TREAD

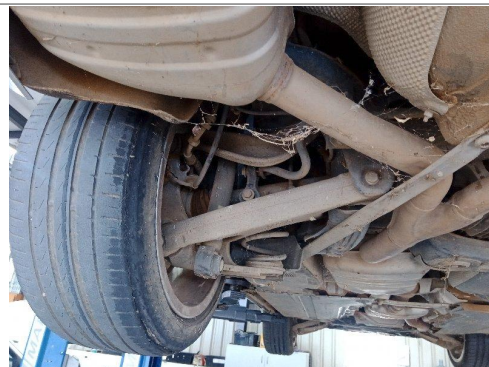

LR TYRE TREAD

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016204298

DATE
18/12/2023


VIN: WAUZZZ8T7CA039079
8 / 17

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016204298

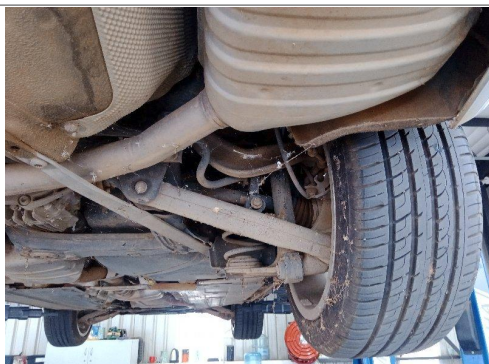DATE
18/12/2023

RR TYRE TREAD




RF TYRE TREAD

VIN: WAUZZZ8T7CA039079
9 / 17

Spare wheel



LICENSE DISC

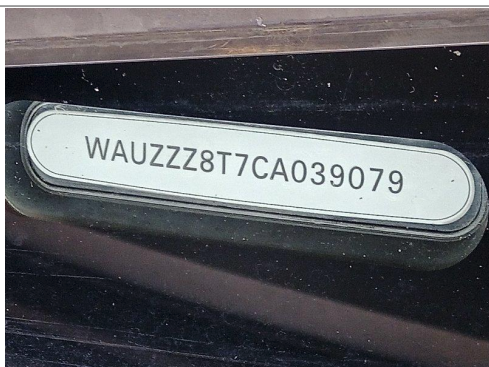

VIN PLATE OR STICKER



ENGINE 1



CONDITION REPORT

Report No: 2016204298

DATE
18/12/2023

VIN: WAUZZZ8T7CA039079
10 / 17

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016204298

DATE
18/12/2023

Front chassis



Rear chassis



Triangle



Automatic Transmission



Oil cap



Front Fender Right



CONDITION REPORT

Report No: 2016204298

DATE
18/12/2023

VIN: WAUZZZ8T7CA039079
12 / 17

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT


Report No: 2016204298

DATE
18/12/2023

Door Front Right



Door Rear Right

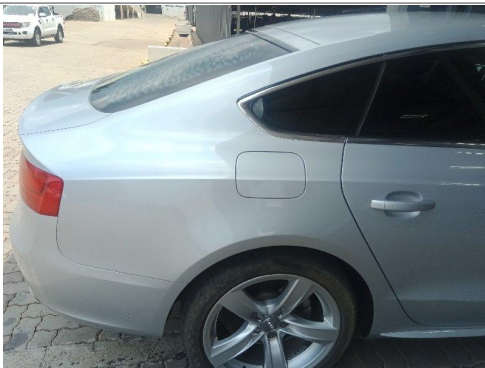

Rear Fender Right



Rear bumper



Rear bumper



Boot Lid / Hatch door



CONDITION REPORT

Report No: 2016204298

DATE
18/12/2023

VIN: WAUZZZ8T7CA039079

14 / 17

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016204298

DATE
18/12/2023

Back Window



VIN: WAUZZZ8T7CA039079

15 / 17

Door Front Left



Door Rear Left



Side Mirror Left



Windscreen



Front Bumper



CONDITION REPORT

Report No: 2016204298

DATE
18/12/2023

VIN: WAUZZZ8T7CA039079
16 / 17

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016204298

DATE
18/12/2023

Front Bumper



Bonnet




Grill



Headlight Left



Headlight Right

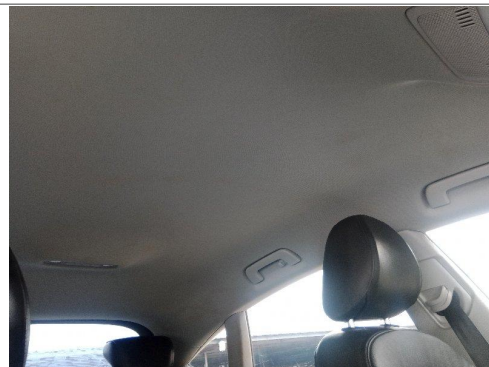

Hood Lining



CONDITION REPORT

Report No: 2016204298

DATE
18/12/2023

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT


Report No: 2016204298

DATE
18/12/2023

Door Sealing Rubber Front Right



Engine

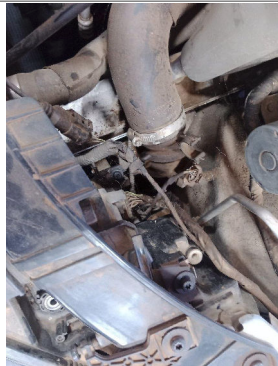

Engine Wiring



Engine



Water level



Bonnet stay and shocks



CONDITION REPORT

Report No: 2016204298

DATE
18/12/2023

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016204298

DATE
18/12/2023

Rocker Panel Right



Tyre Rear Left



Rocker Panel Left



Control Arm Bush(es) Front Axle Left



Shock Absorber Front Left



Shock Absorber Front Right



CONDITION REPORT

Report No: 2016204298

DATE
18/12/2023

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT


Report No: 2016204298

DATE
18/12/2023

Control Arm Bush(es) Front Axle Right



Engine

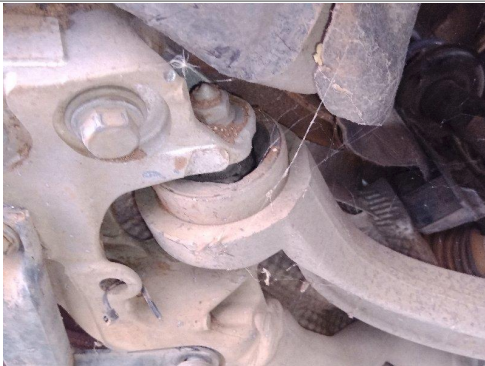

Control Arm Bush(es) Front Axle Right



Control Arm Bush(es) Front Axle Left



Belly plates



Gearbox



CONDITION REPORT

Report No: 2016204298

DATE
18/12/2023

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016204298

DATE
18/12/2023


Differential




CV Joint(s) Rear Left (inner/outer)



CV Joint(s) Rear Right (inner/outer)

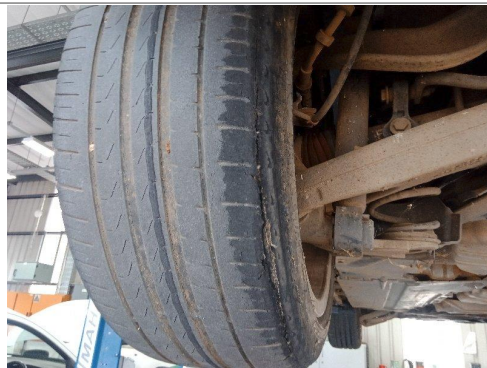

Tyre Rear Left

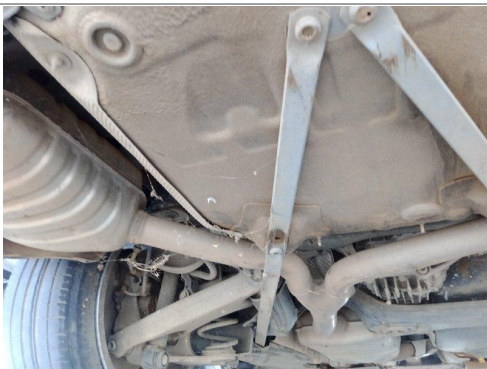

Cross Member Rear Left



Cross Member Rear Right



CONDITION REPORT

Report No: 2016204298

DATE
18/12/2023

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

**CONDITION REPORT**

Report No: 2016204298

DATE
18/12/2023

Gearbox



Engine



CONDITION REPORT

Report No: 2016204298

DATE
18/12/2023

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za