

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	28/12/2023		M57 Pretoria Road - 1619
Inspection Date	28/12/2023		Kempton Park - GT

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	MFC
Manufacturer	AUDI	Registration Number	FB8838L
Model	A4	Register Number	
VIN	WAUZZZF46JA231053	Date Of First Licensing	
Engine Number		Last COR	
Doors	4	License Expiry Date	28/12/2023
Color	WHITE	Power / Displacement	
Year Model		Paint Finish	TWO COAT UNI
Km Reading	116,320 KM	Fuel	PETROL
Cab / Body Type	SEDAN	Transmission	AUTOMATIC

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

	Damage	Repair Way
	Oil level Insufficient	Replace
	Switch Electrical Window Winder rear right Damaged	Replace
	Side Mirror Left Paintwork • Discoloured	Repair
	Front Bumper Paintwork • Scratched	Repair
	Bonnet Paintwork • Discoloured	Repair
	Bonnet slam plate (Shock tower/ Inner tray) Residual	Repair
	Traces of Repair	
	Front Fender Left Paintwork • Scratched	Repair
	Front Fender Right Dented	Repair
	Rear Fender Left Paintwork • Scratched	Repair
	Rear Fender Right Residual Traces of Repair	Repair
	Door Front Left Paintwork • Scratched	Repair
	Door Front Right Dented	Repair
	Door Rear Left Paintwork • Scratched	Repair
	Door Rear Right Paintwork • Scratched	Repair
	Rear bumper Paintwork • Scratched	Repair
	Inner Boot Floor Pan and Spare Wheel Well Corrosion	Repair
	Rocker Panel Left Paintwork • Scratched	Repair
	Windscreen Chipped	Repair
	Caliper 1. Axle left Leak	Repair
	Caliper 1. Axle right Leak	Repair
	Brake disc 1. Axle left Defective	Replace
	Brake disc 1. Axle right Defective	Replace
	Brake Piping Defective	Repair
	Parking Brake Performance Left / Right Difference out of legal range	Repair
	Control Arm Bush(es) Front Axle Left Cracked	Replace
	Control Arm Bush(es) Front Axle Right Cracked	Replace
	Tyre Front Left Defective	Replace

Damage	Repair Way
Tyre Front Right Worn	Replace
Bolt(s) / Nut(s) Front Wheel Left Missing	Replace
Belly plates Damaged	Replace
Brakes Malfunction	Repair
Jack Missing	Replace
Wheel Spanner Missing	Replace
Tyre pressure warning light illuminated on dashboa	Repair

Brakes

Brake Test Results

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s ²]
Front	2.78	3.71	-	
Rear	1.76	1.88	-	
Emergency / Parking	0.18	1.63	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	225/50 R17	98V	Duran	M636	V	4119	0 mm
Front Right	225/50 R17	98V	Duran	M636	V	4119	0 mm
Rear Left	225/50 R17	98V	Duran	M636	V	2819	3 mm
Rear Right	225/50 R17	98V	Duran	M636	V	4119	3 mm
Spare	T125/70 R19	100M	Continental	Temporary	V	4121	4 mm

* Tyre Legend: V=Virgin, R=Recap

Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

No	System	Code	Description	Status
1	01-ENGINE CONTROL MODULE 1	P308800	STARTER RELAY ELECTRICAL FAULT IN CIRCUIT	

Inspection Conditions

No Test Drive
Battery Flat
Engine number – not possible to verify engine number (not visible without dismantling)
Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO AGE AND MILEAGE OF VEHICLE NORMAL WEAR AND TEAR ON INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS.SHOCK ABSORBER TEST COULD NOT BE PERFORMED.VEHICLE LICENSE DISC MISSING.
Engine Compartment: Engine bay dirty. Brake fluid level ok. Oil level checked electronically.
Lights: Right sunvisor light not working.
Interior: Vehicle interior dirty and some interior panels scratched. Driver seat adjuster handle damaged,seat does not move forward and backwards.
Body • Exterior: Minor dents and scratches on some body panels. Spray work on some body panels. Some body panels misaligned. Stone chips on some body panels. Residual traces of repair on some body panels.
Brakes: Front left brake piping incorrectly fitted. Front left and right brake calipers leaking.
Axle and Suspension: Abnormal noise coming from front and rear suspension.
Tyres and Rims: Alloy rims scratched.
Undercarriage: Vehicle undercarriage dirty. Bottom of engine and gearbox fully covered.
Road Test: Vehicle unsafe to drive due to brakes faulty.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Sibusiso Mokase


This document was created electronically and is valid without signature.

General Remarks:

The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.



Automatic transmission

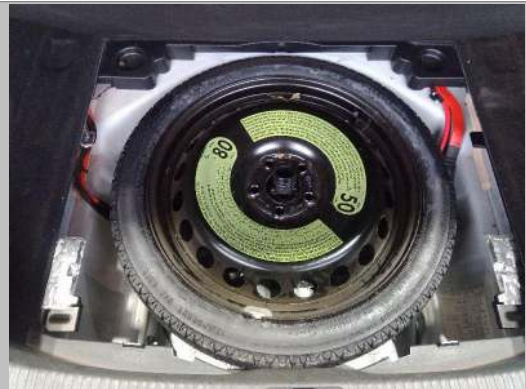


Spare wheel



Triangle




Brake test report

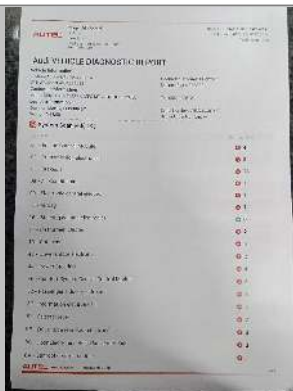

Diagnostic report page 1




Diagnostic report page 3

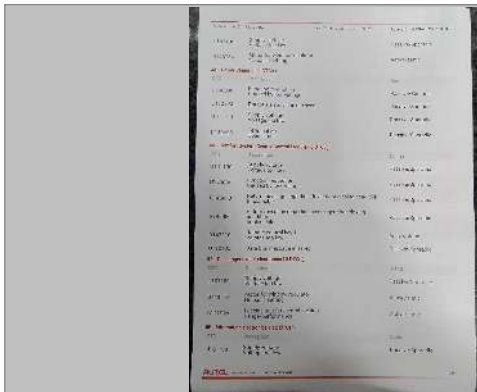

Diagnostic report page 4



Diagnostic report page 5

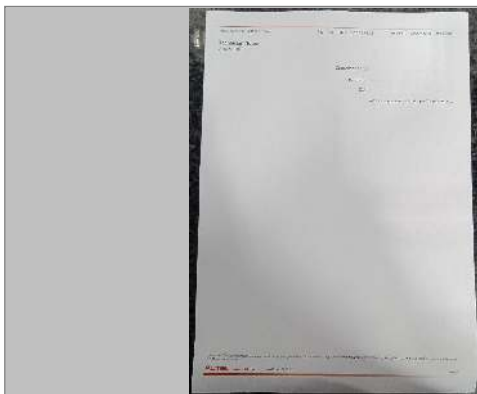

Diagnostic report page 6



Oil cap



Front chassis



Rear chassis

VIN: WAUZZZF46JA231053

7 / 14



FRONT RIGHT CORNER



REAR LEFT CORNER



INTERIOR (FRONT DRIVER DOOR)



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER



90 DEGREE FRONT

VIN: WAUZZZF46JA231053

8 / 14



90 DEGREE RIGHT



90 DEGREE REAR



90 DEGREE LEFT



LF TYRE TREAD



LR TYRE TREAD



RR TYRE TREAD


VIN: WAUZZZF46JA231053
10 / 14



RF TYRE TREAD



LICENSE DISC

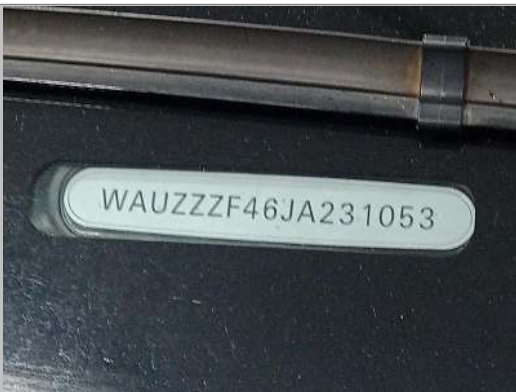

VIN PLATE OR STICKER



ENGINE 1



Switch Electrical Window Winder rear right



Side Mirror Left

VIN: WAUZZZF46JA231053

12 / 14



Front Bumper



Front Bumper



Bonnet



Front Fender Right



Windscreen



Oil level

VIN: WAUZZZF46JA231053

14 / 14




Inner Boot Floor Pan and Spare Wheel Well



Rear bumper



Rear bumper

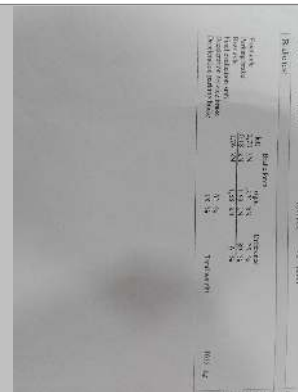

Parking Brake Performance



Water level



Brake disc 1. Axle right



Door Front Right



Door Rear Right



Rear Fender Right



Rear Fender Left



Rocker Panel Left



Door Rear Left



Door Front Left



Front Fender Left



Bolt(s) / Nut(s) Front Wheel Left



Brake disc 1. Axle left



Tyre Front Left



Tyre Front Left



Tyre Front Right



Control Arm Bush(es) Front Axle Left



Control Arm Bush(es) Front Axle Right



Brake Piping



Caliper 1. Axle right



Caliper 1. Axle left



Belly plates



Belly plates



Belly plates



Bonnet slam plate (Shock tower/ Inner tray)



Bonnet slam plate (Shock tower/ Inner tray)



CONDITION REPORT

Report No: 2016213189

DATE
28/12/2023

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za