

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	28/12/2023		M57 Pretoria Road - 1619
Inspection Date	28/12/2023		Kempton Park - GT

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	MFC
Manufacturer	BMW	Registration Number	DD54JNGP
Model	120D	Register Number	
VIN	WBA1C32030J816721	Date Of First Licensing	
Engine Number		Last COR	
Doors	5	License Expiry Date	31/01/2024
Color	WHITE	Power / Displacement	
Year Model		Paint Finish	TWO COAT UNI
Km Reading	240,348 KM	Fuel	DIESEL
Cab / Body Type	HATCHBACK	Transmission	AUTOMATIC

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

	Damage	Repair Way
	Under bonnet insulation cover Damaged	Repair
	Center Console / Cubbyhole + Lid Defective	Repair
	Tail Light Left Damaged	Replace
	Fog Light Front Right Damaged	Replace
	Headlight Right Scratched	Repair
	Seat Rear Defective	Repair
	Door Sealing Rubber Rear Right Torn / Cut	Repair
	Side Mirror Left Residual Traces of Repair	Repair
	Front Bumper Damaged	Repair
	Bonnet Paintwork • Scratched	Repair
	B • Pillar Left Paintwork • Scratched	Repair
	C • Pillar Left Dented	Repair
	C • Pillar Right Dented	Repair
	Front Fender Left Paintwork • Scratched	Repair
	Front Fender Right Paintwork • Scratched	Repair
	Rear Fender Left Paintwork • Scratched	Repair
	Rear Fender Right Paintwork • Scratched	Repair
	Rear Fender Left / Inner Tray Damaged	Repair
	Door Front Left Paintwork • Scratched	Repair
	Door Front Right Paintwork • Scratched	Repair
	Door Rear Left Paintwork • Scratched	Repair
	Door Rear Right Dented	Repair
	Boot Lid / Hatch door Paintwork • Scratched	Repair
	Rear bumper Paintwork • Scratched	Repair
	Windscreen Chipped	Replace
	Brake disc 1. Axle right Defective	Replace
	Service Brake Performance Rear Axle Insufficient	Repair
	Shock Absorber Front Left Leak	Replace
	Shock Absorber Front Right Sweat	Replace

Damage	Repair Way
Stabilizer Mounting Front Left Damaged	Replace
Control Arm Bush(es) Front Axle Left Cracked	Replace
Control Arm Bush(es) Front Axle Right Cracked	Replace
Tyre Front Right Torn / Cut	Replace
Tyre Rear Left Torn / Cut	Replace
Engine to silencer pipe Damaged	Repair
Belly plates Defective	Repair
Differential Defective	Repair
Jack Missing	Replace
Wheel Spanner Missing	Replace
Tyre pressure warning light illuminated on dashboa	Repair

Brakes

Brake Test Results

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s ²]
Front	3.15	3.45	-	
Rear	2.98	3.02	-	
Emergency / Parking	0	0	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	225/40Z R18	92Y	Pirelli	Pzero	V	1513	1 mm
Front Right	225/40Z R18	92Y	Dunlop	Sportmax	V	0419	4 mm
Rear Left	225/40Z R18	92Y	Hankook	Ventus	V	3121	3 mm
Rear Right	225/40 R18	92W	Fronway	Eurus	V	1723	5 mm

* Tyre Legend: V=Virgin, R=Recap

Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

No	System	Code	Description	Status
1	DDE(ENGINE-DIESEL ELECTRONICS)	274900	DDE MAIN RELAY: REPLAY SWITCHES OFF TOO EARLY OR U	

Inspection Conditions

No Test Drive
Battery Flat
Engine number – not possible to verify engine number (not visible without dismantling)
Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO AGE AND MILEAGE OF VEHICLE NORMAL WEAR AND TEAR ON INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS.SHOCK ABSORBER TEST COULD NOT BE PERFORMED.
Engine Compartment: Engine bay dirty. Brake fluid level ok. Oil level checked electronically.
Electrical Components and Instruments: Vehicle display screen damaged. Some vehicle electronics malfunctioning. Automatic gear selection indicator lights malfunctioning.
Interior: Vehicle interior dirty and some interior panels scratched. Rear right seat belt buckle missing.
Body • Exterior: Minor dents and scratches on some body panels. Spray work on some body panels. Some body panels misaligned. Stone chips on some body panels.
Axle and Suspension: Abnormal noise coming from front and rear suspension.
Tyres and Rims: Alloy rims scratched. Front left tyre has reached legal limit. Vehicle has no spare wheel.
Undercarriage: Vehicle undercarriage dirty. Bottom of engine and gearbox fully covered.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

Sibusiso Mokase

This document was created electronically and is valid without signature.

General Remarks:

The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.




Oil cap



Automatic Transmission



Brake test report

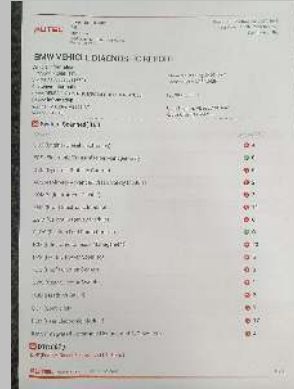







Diagnostic report page 1



Diagnostic report page 2



Diagnostic report page 3

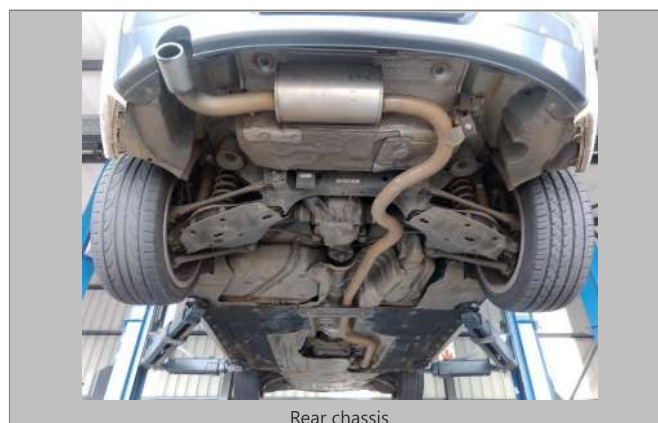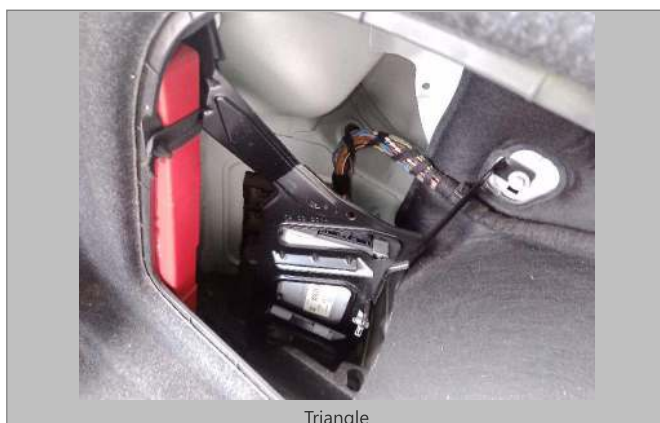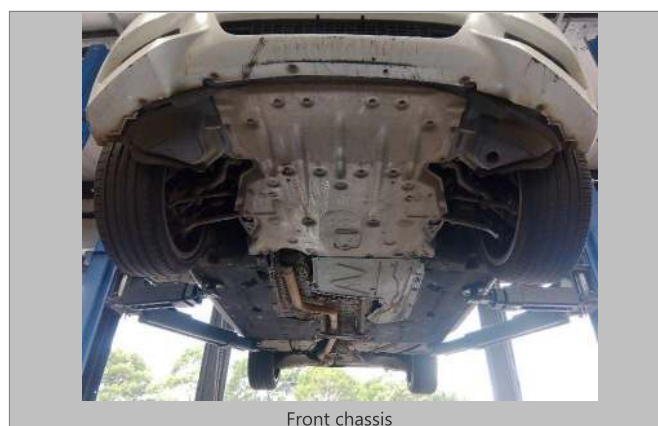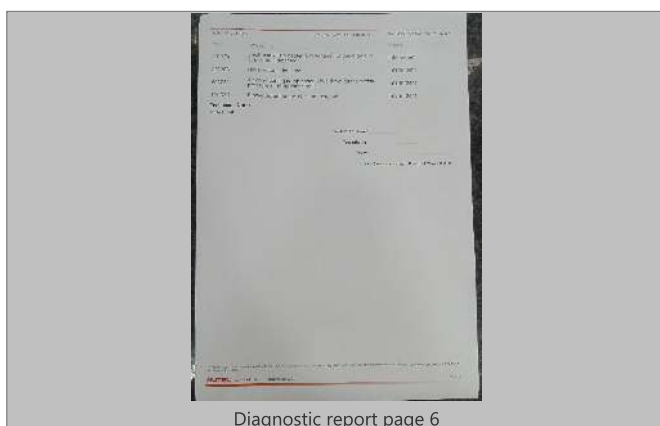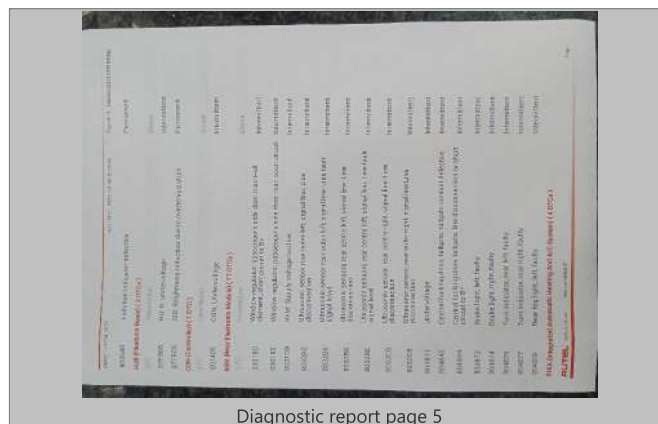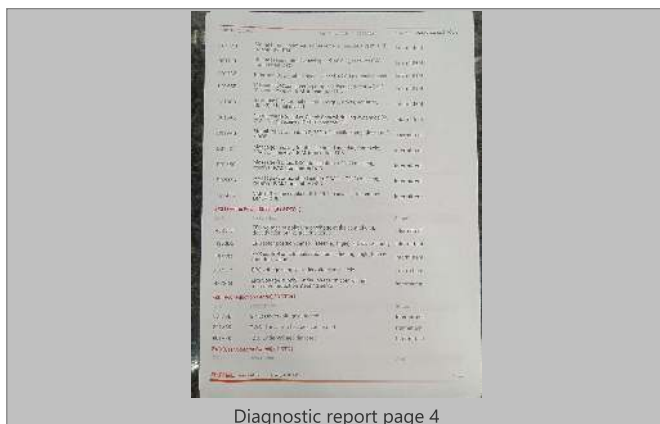

VIN: WBA1C32030J816721

7 / 15



FRONT RIGHT CORNER



REAR LEFT CORNER



INTERIOR (FRONT DRIVER DOOR)



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER



90 DEGREE FRONT

VIN: WBA1C32030J816721

8 / 15



90 DEGREE RIGHT



90 DEGREE REAR



90 DEGREE LEFT



LF TYRE TREAD



RR TYRE TREAD



LR TYRE TREAD

VIN: WBA1C32030J816721

10 / 15



RF TYRE TREAD



LICENSE DISC



VIN PLATE OR STICKER



ENGINE 1



Water level



Center Console / Cubbyhole + Lid

VIN: WBA1C32030J816721

12 / 15



Door Front Right



Door Rear Right

13 / 15



Rear Fender Right



Seat Rear



Door Sealing Rubber Rear Right



C • Pillar Right

VIN: WBA1C32030J816721

14 / 15



Rear bumper



Rear bumper



Boot Lid / Hatch door



Tail Light Left



Rear Fender Left



Door Rear Left



C • Pillar Left



Door Front Left



B • Pillar Left



Side Mirror Left



Front Fender Left



Front Bumper



Front Bumper




Bonnet



Headlight Right



Front Fender Right

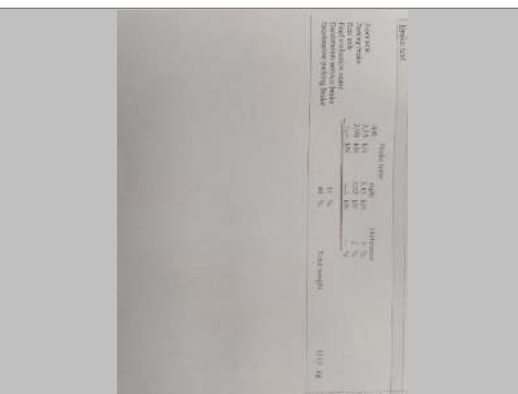

Service Brake Performance Rear Axle



Fog Light Front Right



Brake disc 1. Axle right



Tyre Front Right



Shock Absorber Front Right



Tyre Rear Left



Shock Absorber Front Left



Control Arm Bush(es) Front Axle Right



Control Arm Bush(es) Front Axle Left




Belly plates



Belly plates



Engine to silencer pipe

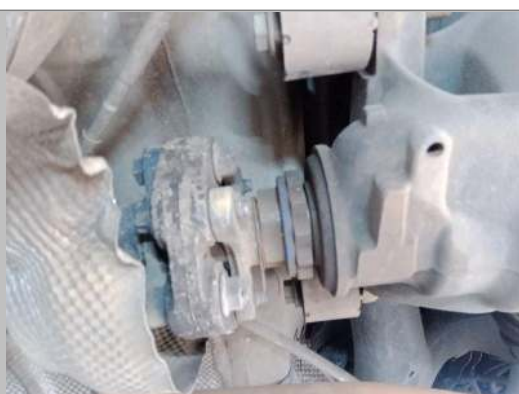

Differential




Belly plates



Rear Fender Left / Inner Tray



Belly plates

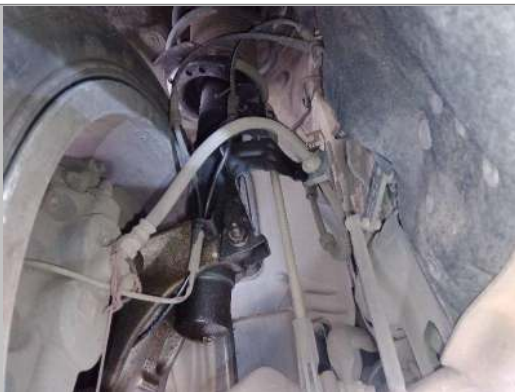

Stabilizer Mounting Front Left



Windscreen



Under bonnet insulation cover



Oil level



CONDITION REPORT

Report No: 2016213160

DATE
28/12/2023

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za