



CONDITION REPORT



Report No:
2016967753
DATE
04/08/2025

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	04/08/2025		M57 Pretoria Road - 1619
Inspection Date	04/08/2025		Kempton Park - GT

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	
Manufacturer	BMW	Registration Number	MC95KYGP
Model	320I STEPTRONIC 5F32 [2019-2022]	Register Number	
VIN	WBA5F320X0FH47072	Date Of First Licensing	
Engine Number		Last COR	
Doors	4	License Expiry Date	
Color	WHITE	Power / Displacement	
Year Model	2019	Paint Finish	TWO COAT UNI
Km Reading	158,187 KM	Fuel	PETROL
Cab / Body Type	SEDAN	Transmission	AUTOMATIC

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za


VIN: WBA5F320X0FH47072



CONDITION REPORT



Report No:
2016967753
DATE
04/08/2025

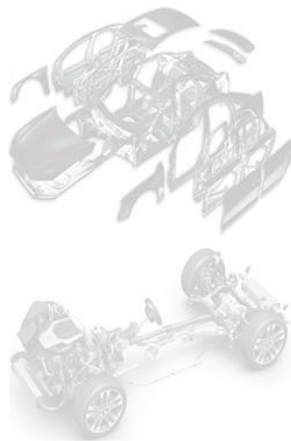

Damage

Repair Way

Hoses Defective	Replace
Seat Front Right Torn / Cut	Repair
Door Sealing Rubber Front Right Damaged	Replace
Front Bumper Paintwork • Scratched	Repair
Bonnet Paintwork • Chipmarks	Repair
B • Pillar Right Paintwork • Chipmarks	Repair
Front Fender Right Paintwork • Chipmarks	Repair
Rear Fender Left Dented	Smart Repair
Rear Fender Right Paintwork • Scratched	Repair
Door Front Left Residual Traces of Repair	Repair
Door Front Right Dented	Repair
Door Rear Left Paintwork • Chipmarks	Repair
Door Rear Right Paintwork • Chipmarks	Repair
Rear bumper Paintwork • Scratched	Repair
Rocker Panel Left Paintwork • Flaking	Repair
Windscreen Chipped	Repair
Shock Absorber Front Left Defective	Replace
Tyre Front Left Worn	Replace
Tyre Front Right Damaged	Replace
Tyre Rear Left Damaged	Replace
Tyre Rear Right Damaged	Replace
Belly plates Damaged	Replace
Jack Missing	Replace
Wheel Spanner Missing	Replace
Tyres and rims	Spare wheel missing
Warning lights illuminated on dashboard	Repair
Body and Exterior	Stone chips and spray work on some body panels

Brakes

Brake Test Results

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s ²]
Front	3.39	2.84	-	
Rear	2.05	2.11	-	
Emergency / Parking	2.26	2.15	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	225/40 R18	92Y	Continental	Contisport	V	1019	0 mm
Front Right	225/40Z R18	92Y	Hankook	Ventus	V	3221	0 mm
Rear Left	225/45RF18	91Y	Kumho	Ecsta	V	4319	0 mm
Rear Right	255/40 R18	95Y	Continental	Contisport	V	2921	0 mm

* Tyre Legend: V=Virgin, R=Recap

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WBA5F320X0FH47072



CONDITION REPORT



Report No:
2016967753
DATE
04/08/2025

Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

No	System	Code	Description	Status
1	DME(ENGINE-DIGITAL MOTOR ELECTRONICS)	130716	VANOS SOLENOID VALVE, EXHAUST: CAMSHAFT JAMMED	

Inspection Conditions

No Test Drive
Battery Flat
Engine number – not possible to verify engine number (not visible without dismantling)
Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ON THE BODY, INTERIOR, EXTERIOR, AND MECHANICAL PARTS. THE BOTTOM OF THE ENGINE AND GEARBOX WERE MOSTLY COVERED.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Sibusiso Mokase

This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WBA5F320X0FH47072



CONDITION REPORT



Report No:
2016967753
DATE
04/08/2025



FRONT RIGHT CORNER



REAR LEFT CORNER



90 DEGREE FRONT



90 DEGREE RIGHT



90 DEGREE LEFT



90 DEGREE REAR

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WBA5F320X0FH47072



CONDITION REPORT



Report No:
2016967753
DATE
04/08/2025



INTERIOR (FRONT DRIVER DOOR)



DASHBOARD (W/ ENGINE RUNNING)




ODOMETER



AUTOMATIC GEAR LEVER



LF TYRE TREAD

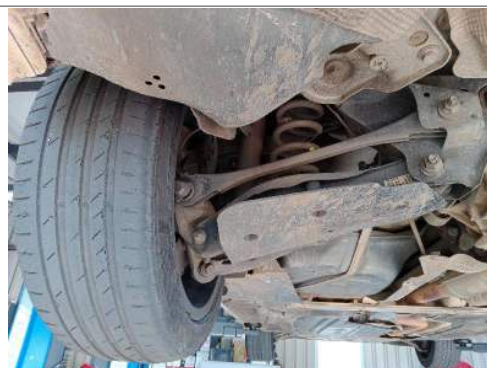

LR TYRE TREAD

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WBA5F320X0FH47072



CONDITION REPORT



Report No:
2016967753
DATE
04/08/2025



RR TYRE TREAD



RF TYRE TREAD



CHASSIS 1



CHASSIS 2



ENGINE 1



OIL CAP

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WBA5F320X0FH47072



CONDITION REPORT



Report No:
2016967753
DATE
04/08/2025




EMERGENCY TRIANGLE




LICENSE DISC




VIN PLATE OR STICKER

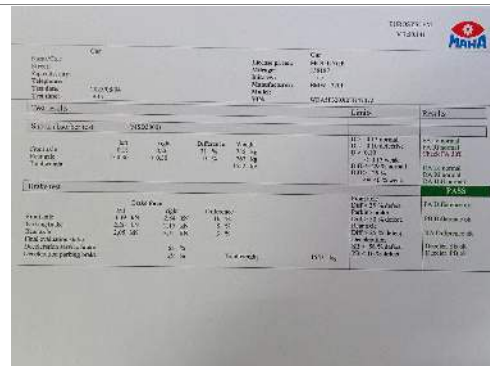

BRAKE AND SHOCK TEST REPORT

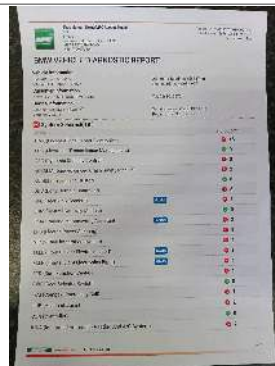

DIAGNOSTIC TEST REPORT PAGE 1

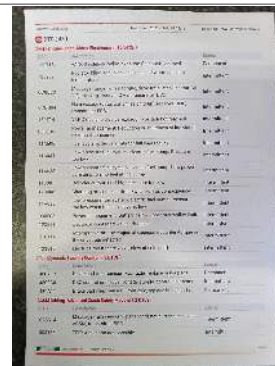

DIAGNOSTIC TEST REPORT PAGE 2

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za


VIN: WBA5F320X0FH47072




CONDITION REPORT



Report No:
2016967753
DATE
04/08/2025

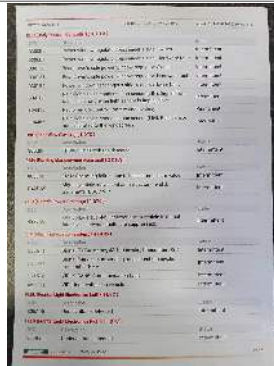

DIAGNOSTIC TEST REPORT PAGE 3

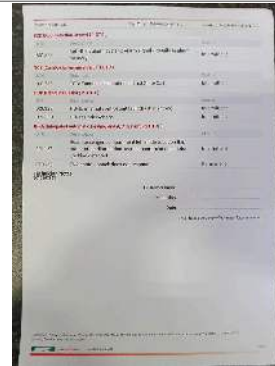

DIAGNOSTIC TEST REPORT PAGE 4



Door Sealing Rubber Front Right



Seat Front Right



B • Pillar Right



Rear bumper

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WBA5F320X0FH47072



CONDITION REPORT



Report No:
2016967753
DATE
04/08/2025



Rear bumper



Rear Fender Left



Door Rear Left



Door Front Left



Windscreen



Front Bumper

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WBA5F320X0FH47072



CONDITION REPORT



Report No:
2016967753
DATE
04/08/2025



Front Bumper



Bonnet



Front Fender Right



Door Front Right



Door Rear Right



Rear Fender Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WBA5F320X0FH47072



CONDITION REPORT



Report No:
2016967753
DATE
04/08/2025



Oil level



Tyre Rear Left




Rocker Panel Left



Belly plates



Belly plates

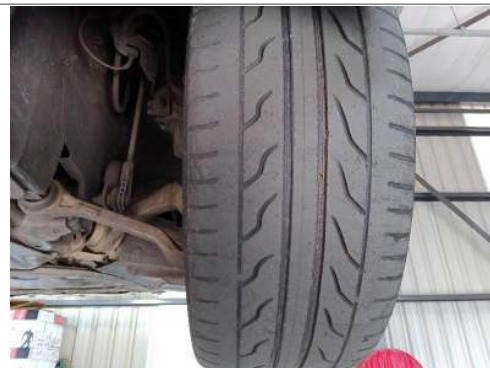

Tyre Front Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WBA5F320X0FH47072



CONDITION REPORT



Report No:
2016967753
DATE
04/08/2025




Tyre Front Left




Shock Absorber Front Left



Hoses

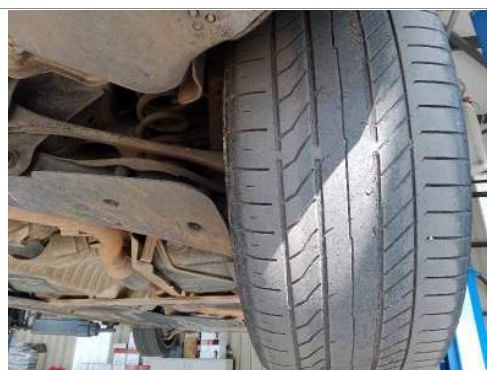

Tyre Rear Right

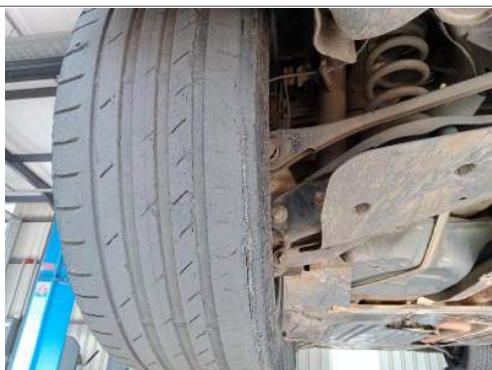

Tyre Rear Left



Water level

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WBA5F320X0FH47072