



CONDITION REPORT

Report No: 2016355407

DATE
25/04/2024

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	25/04/2024		M57 Pretoria Road - 1619
Inspection Date	25/04/2024		Kempton Park - GT

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	MFC AUCTION HOUSE
Manufacturer	BMW	Registration Number	BR61CYGP
Model	X6	Register Number	
VIN	WBAFH02000LY67619	Date Of First Licensing	
Engine Number		Last COR	
Doors	5	License Expiry Date	31/08/2020
Color	WHITE	Power / Displacement	
Year Model		Paint Finish	TWO COAT UNI
Km Reading	153,415 KM	Fuel	DIESEL
Cab / Body Type	STATION WAGON	Transmission	AUTOMATIC

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

Damage	Repair Way
Head Light Switch Damaged	Replace
Indicator Switch Damaged	Replace
Center Console / Cubbyhole + Lid Defective	Repair
Switch Electrical Window Winder front left Damaged	Replace
Switch Electrical Window Winder front right Damaged	Replace
Switch Electrical Window Winder rear left Damaged	Replace
Switch Electrical Window Winder rear right Damaged	Replace
Dim and Bright Indicator Light Damaged	Replace
Hazard Lights Damaged	Replace
Headlight Left Defective	Repair
Headlight Right Defective	Repair
Sun Roof Switch Malfunction	Replace
Seat Front Left Defective	Repair
Seat Front Right Damaged	Repair
Seat Rear Dirty	Repair
Hood Lining Dirty	Repair
Door Panel Front Right Defective	Repair
Door Handle Front Left Defective	Repair
Door Sealing Rubber Front Right Damaged	Repair
Steering Wheel Trim Defective	Repair
Side Mirror Left Paintwork • Scratched	Repair
Front Bumper Residual Traces of Repair	Repair
Bonnet Paintwork • Scratched	Repair
Front Fender Left Residual Traces of Repair	Repair
Front Fender Right Residual Traces of Repair	Repair
Rear Fender Left Residual Traces of Repair	Repair
Rear Fender Right Paintwork • Scratched	Repair
Door Front Left Residual Traces of Repair	Repair
Door Front Right Dented	Repair

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WBAFH02000LY67619

1 / 17



CONDITION REPORT

Report No: 2016355407

DATE
25/04/2024

Damage	Repair Way
Door Rear Left Paintwork • Scratched	Repair
Door Rear Right Dented	Repair
Rear bumper Paintwork • Scratched	Repair
Inner Boot Floor Pan and Spare Wheel Well Paintwork • Scratched	Repair
Control Arm Bush(es) Front Axle Left Cracked	Replace
Tyre Front Left Defective	Repair
Rim Front Left Scratched	Repair
Rim Front Right Scratched	Repair
Rim Rear Left Scratched	Repair
Engine to silencer pipe Defective	Repair
Belly plates Defective	Repair
Gearbox Mountings Cracked	Replace
Gearbox Oil Sweat	Repair
Differential Oil Sweat	Repair
Electrical instruments and components	F/R electrical window switch mechanism damaged
Electrical instruments and components	Vehicle electronics malfunctioning
Interior	Vehicle interior dirty and some panels scratched
Brakes	Front left brake wear sensor damaged
Undercarriage	Bottom of engine and gearbox fully covered
Undercarriage	Oil sweat on engine splash plate
Undercarriage	Vehicle undercarriage dirty
Undercarriage	Front right jacking point bracket missing
Body and Exterior	Dents and scratches on some body panels
Body and Exterior	Stone chips and spray work on some body panels
Body and Exterior	Residual traces of repair on some body panels
Body and Exterior	Some body panels misaligned
Undercarriage	Signs of surface rust on undercarriage
Tyres and rims	Front and rear tyre sizes different
Interior	Rain sensor cover defective

Brakes

Brake Test Results

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s ²]
Front	-	-	-	
Rear	-	-	-	
Emergency / Parking	-	-	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	255/45Z R20	105W	Landsail	LS588	V	0919	6 mm
Front Right	255/45 R20	105W	Landsail	LS588	V	0919	6 mm
Rear Left	315/35Z R20	110Y	Habilead	Practicalmax	V	3017	4 mm
Rear Right	315/35Z R20	110Y	Habilead	Practicalmax	V	1918	4 mm
Spare	T155/90 R18	113M	Dunlop	Temporary	V	2711	3 mm

* Tyre Legend: V=Virgin, R=Recap



CONDITION REPORT

VIN: WBAK022006Y53619

Report No: 2016355407

2 / 17

DATE

25/04/2024

Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

No	System	Code	Description	Status
1	DDE(ENGINE-DIESEL ELECTRONICS)	004C3C	NO MESSAGE(SETPOINT TORQUE OF DRIVE-OFF ASSISTANT)	

Inspection Conditions

No Test Drive

Battery Flat

Engine number – not possible to verify engine number (not visible without dismantling)

Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Sibusiso Mokase

This document was created electronically and is valid without signature.


General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.




CONDITION REPORT

Report No: 2016355407

VIN: WBAFH02000LY67619

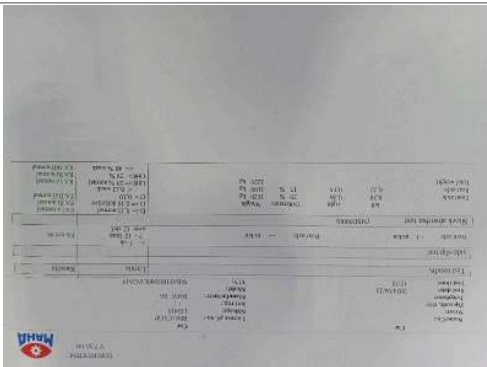DATE
25/04/2024


Brake and shock absorber repor

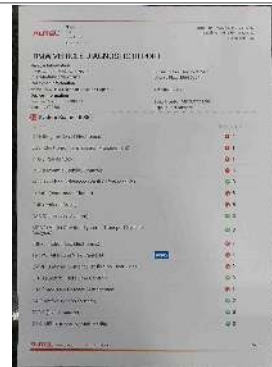

Diagnostic report page 1




Diagnostic report page 2

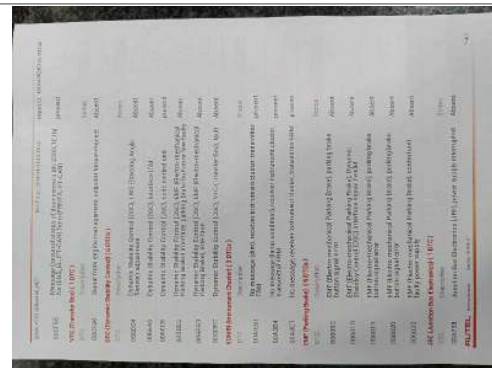

Diagnostic report page 3



Diagnostic report page 4

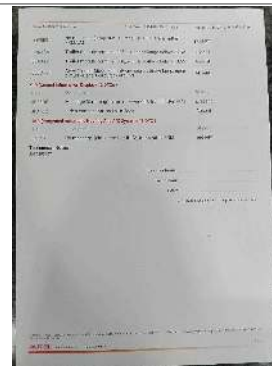

Diagnostic report page 5



CONDITION REPORT

Report No: 2016355407

VIN: WBAFH022000472024
DATE: 25/04/2024
4 / 17

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016355407

DATE
25/04/2024

VIN: WBAFH02000LY67619

5 / 17



FRONT RIGHT CORNER



REAR LEFT CORNER



INTERIOR (FRONT DRIVER DOOR)



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER



Automatic transmission



CONDITION REPORT

Report No: 2016355407

DATE
25/04/2024

VIN: WBAFH02000LY67619
6 / 17

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016355407

DATE
25/04/2024

90 DEGREE FRONT



90 DEGREE RIGHT

VIN: WBAFH02000LY67619
7 / 17


90 DEGREE REAR



90 DEGREE LEFT



LF TYRE TREAD

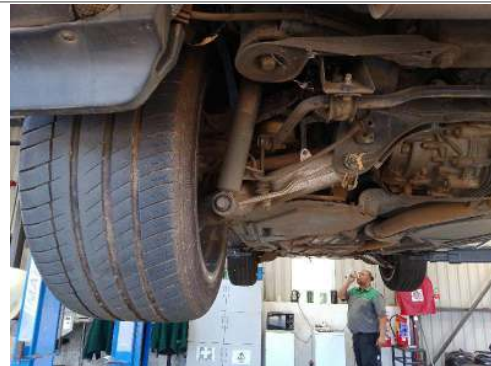

LR TYRE TREAD



CONDITION REPORT

Report No: 2016355407

DATE
25/04/2024

VIN: WBAFH02000LY67619

8 / 17

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016355407

DATE
25/04/2024



RR TYRE TREAD



Front left brake wear sensor



Spare wheel and Accessories



RF TYRE TREAD



LICENSE DISC



VIN PLATE OR STICKER

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016355407

DATE
25/04/2024

VIN: WBAFH02000LY67619
10 / 17

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016355407

DATE
25/04/2024

ENGINE 1



Front chassis

VIN: WBAFH02000LY67619

11 / 17



Rear chassis



Rain sensor cover



Oil cap and dipstick



Front right electrical window

**CONDITION REPORT****Report No: 2016355407****DATE**
25/04/2024

VIN: WBAFH02000LY67619

12 / 17

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016355407

DATE
25/04/2024

Water level



Sun Roof Switch



Center Console / Cubbyhole + Lid



Steering Wheel Trim



Switch Electrical Window Winder rear right



Switch Electrical Window Winder rear left



CONDITION REPORT

Report No: 2016355407

DATE
25/04/2024

VIN: WBAFH02000LY67619
14 / 17

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016355407

DATE
25/04/2024

Switch Electrical Window Winder front right



Switch Electrical Window Winder front left

VIN: WBAFH02000LY67619

15 / 17



Hood Lining



Oil level



Door Panel Front Right



Seat Front Right

**CONDITION REPORT****Report No: 2016355407****DATE**
25/04/2024

VIN: WBAFH02000LY67619

16 / 17



CONDITION REPORT

Report No: 2016355407

DATE
25/04/2024

Door Sealing Rubber Front Right



Door Rear Right

VIN: WBAFH02000LY67619

17 / 17



Door Front Right



Rear Fender Right



Rear bumper



Rear bumper

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

**CONDITION REPORT**

Report No: 2016355407

DATE
25/04/2024

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016355407

DATE
25/04/2024

Inner Boot Floor Pan and Spare Wheel Well



Rear Fender Left



Door Rear Left



Door Front Left



Seat Rear



Seat Front Left



CONDITION REPORT

Report No: 2016355407

DATE
25/04/2024

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016355407

DATE
25/04/2024

Door Handle Front Left



Switch Electrical Window Winder front left



Side Mirror Left



Front Fender Left



Front Bumper



Front Bumper



CONDITION REPORT

Report No: 2016355407

DATE
25/04/2024

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016355407

DATE
25/04/2024

Bonnet



Headlight Right



Headlight Left



Front Fender Right



Hazard Lights



Indicator Switch



CONDITION REPORT

Report No: 2016355407

DATE
25/04/2024

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016355407

DATE
25/04/2024

Head Light Switch



Dim and Bright Indicator Light



Rim Front Right



Rim Rear Left



Rim Front Left



Tyre Front Left

**CONDITION REPORT**

Report No: 2016355407

DATE
25/04/2024

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016355407

DATE
25/04/2024

Gearbox



Gearbox Mountings



Belly plates



Differential



Engine to silencer pipe



Control Arm Bush(es) Front Axle Left

**CONDITION REPORT****Report No: 2016355407****DATE**
25/04/2024

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za