

MFC Auction House  
M57 Pretoria Rd, Glenmarais, KEMPTON PARK  
Gauteng

DEKRA MFC  
M57 Pretoria Rd - 1619  
KEMPTON PARK - GT  
08610 33572



## Assignment

|                 |                   |                     |                          |
|-----------------|-------------------|---------------------|--------------------------|
| Client          | MFC Auction House | Inspection Location | MFC                      |
| Requested Date  | 19/04/2024        |                     | M57 Pretoria Road - 1619 |
| Inspection Date | 19/04/2024        |                     | Kempton Park - GT        |

## Vehicle Data

|                 |                   |                         |                   |
|-----------------|-------------------|-------------------------|-------------------|
| Vehicle Type    | PASSENGER VEHICLE | Registered Owner        | MFC AUCTION HOUSE |
| Manufacturer    | BMW               | Registration Number     | CY238235          |
| Model           | 335I              | Register Number         |                   |
| VIN             | WBAPM76060NH81435 | Date Of First Licensing |                   |
| Engine Number   |                   | Last COR                |                   |
| Doors           | 4                 | License Expiry Date     | 30/11/2023        |
| Color           | GREY              | Power / Displacement    |                   |
| Year Model      |                   | Paint Finish            | TWO COAT METALLIC |
| Km Reading      | 198,021 KM        | Fuel                    | PETROL            |
| Cab / Body Type | SEDAN             | Transmission            | AUTOMATIC         |

## Vehicle Options & Accessories

### Items

## VEHICLE INSPECTION

| Damage                                                               | Repair Way                                         |
|----------------------------------------------------------------------|----------------------------------------------------|
| Engine Oil Leak                                                      | Repair                                             |
| Water level Insufficient                                             | Repair                                             |
| Air cleaner Defective                                                | Repair                                             |
| Steering Wheel Trim Worn                                             | Repair                                             |
| Front Bumper Damaged                                                 | Repair                                             |
| Bonnet Damaged                                                       | Repair                                             |
| Front Fender Left Damaged                                            | Repair                                             |
| Front Fender Right Damaged                                           | Repair                                             |
| Door Front Right Damaged                                             | Repair                                             |
| Door Rear Left Damaged                                               | Repair                                             |
| Door Rear Right Damaged                                              | Repair                                             |
| Rear bumper Damaged                                                  | Repair                                             |
| Parking Brake Performance Left / Right Difference out of legal range | Repair                                             |
| Engine to silencer pipe Welded                                       | Repair                                             |
| Silencer Defective                                                   | Repair                                             |
| Catalytic converter Missing                                          | Replace                                            |
| Gearbox Oil Leak                                                     | Repair                                             |
| Body and exterior                                                    | Minor dents and scratches and stone chips to vehic |
| Body and exterior                                                    | Signs of repair work done to somebody panels.      |
| Body and exterior                                                    | Poor alignment to somebody panels.                 |
| Engine                                                               | Aftermarket performance done to vehicle.           |
| Undercarriage.                                                       | Non-standard exhaust fitted to vehicle             |

## Brakes

### Brake Test Results

|                     | Left               | Right              |                  |                                  |
|---------------------|--------------------|--------------------|------------------|----------------------------------|
|                     | Braking Force [KN] | Braking Force [KN] | Axle Weight [KG] | Deceleration [m/s <sup>2</sup> ] |
| Front               | 3.22               | 3.43               | -                |                                  |
| Rear                | 2.62               | 3.0                | -                |                                  |
| Emergency / Parking | 1.55               | 2.39               | -                |                                  |

## Tyres and Rims

### Tyre Specification & Measurement

|             | Size      | Load/Speed Index | Manufacture | Model  | Type* | Production Date | Tread Depth (mm) |
|-------------|-----------|------------------|-------------|--------|-------|-----------------|------------------|
| Front Left  | 225/40R18 | 92W              | Autogrip    | Radial | V     | 3820            | 3 mm             |
| Front Right | 225/40R18 | 88Y              | Goodyear    | Eagle  | V     | 3721            | 3 mm             |
| Rear Left   | 255/35R18 | 90Y              | Goodyear    | Eagle  | V     | 1020            | 3 mm             |
| Rear Right  | 255/35R18 | 90Y              | Goodyear    | Eagle  | V     | 1121            | 3 mm             |

\* Tyre Legend: V=Virgin, R=Recap

## Diagnostic

During the diagnostic no active error messages were detected. (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

## Inspection Conditions

No Test Drive  
Battery Flat  
Engine number – not possible to verify engine number (not visible without dismantling)  
Inspection conditions for the vehicle inspection were sufficient

## Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

## Technician

Werner Laubscher

This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.



Oil cap.




Automatic.




Undercarriage front.



Undercarriage rear.

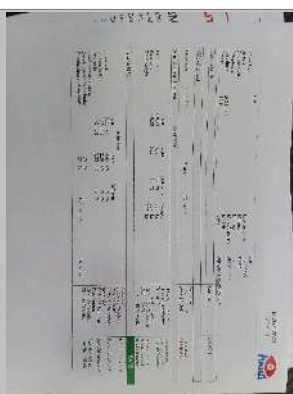


Brake test.

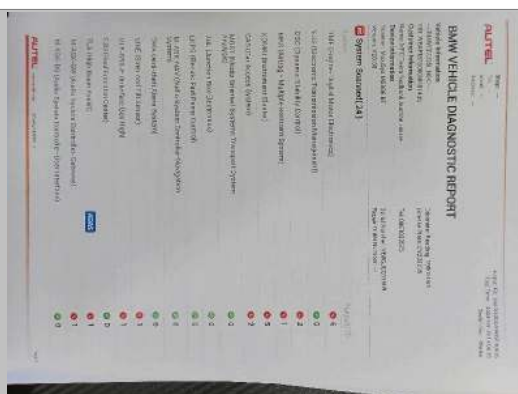


Diagnostics.




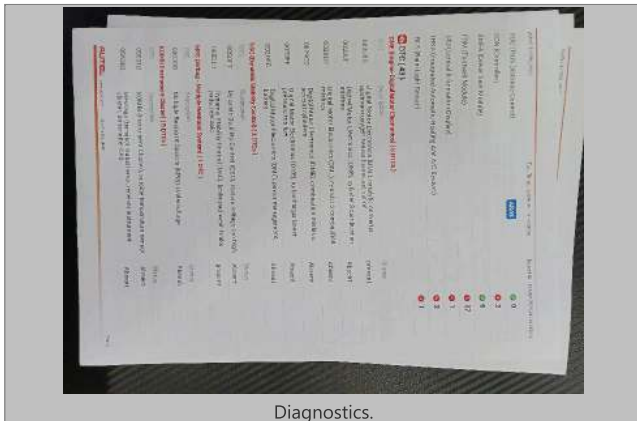


Diagnostics.

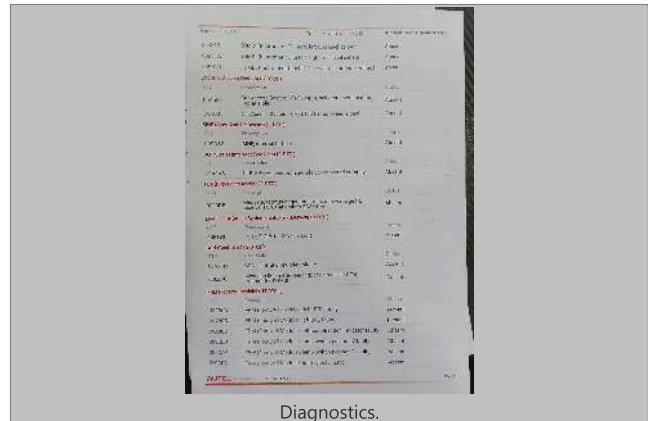

Diagnostics.

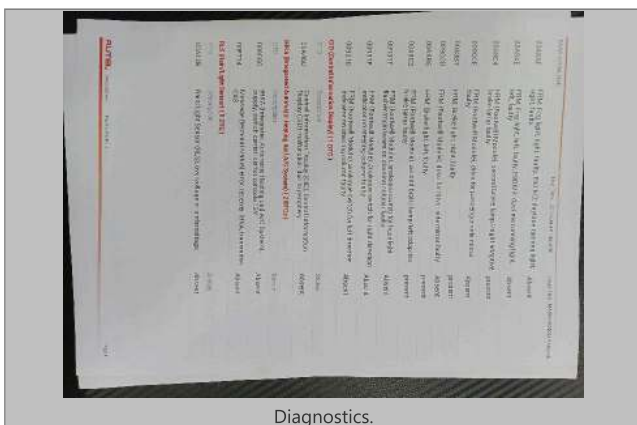

Diagnostics.

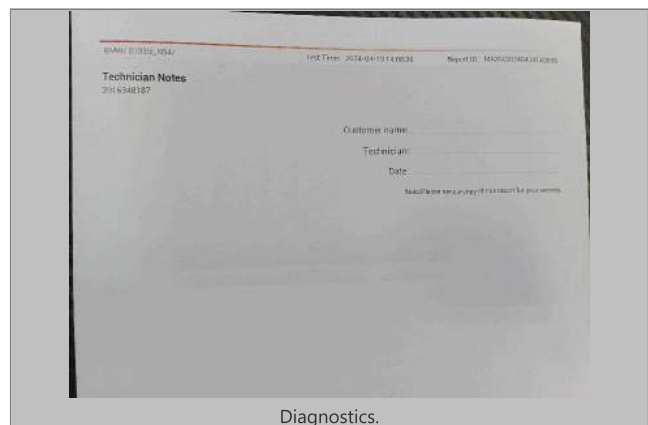

Diagnostics.



FRONT RIGHT CORNER



REAR LEFT CORNER





INTERIOR (FRONT DRIVER DOOR)



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER



90 DEGREE FRONT



90 DEGREE RIGHT




90 DEGREE REAR





90 DEGREE LEFT

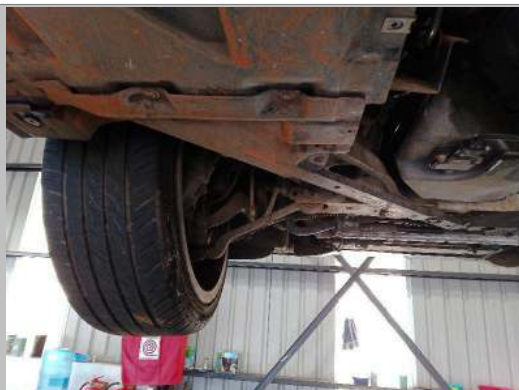

LF TYRE TREAD



LR TYRE TREAD



RR TYRE TREAD



RF TYRE TREAD



LICENSE DISC





VIN PLATE OR STICKER



ENGINE 1



Air cleaner



Water level



Front Bumper



Front Bumper





Bonnet



Front Fender Left



Door Rear Left



Rear bumper



Rear bumper



Door Rear Right





Door Front Right



Front Fender Right




Engine



Gearbox



Engine to silencer pipe

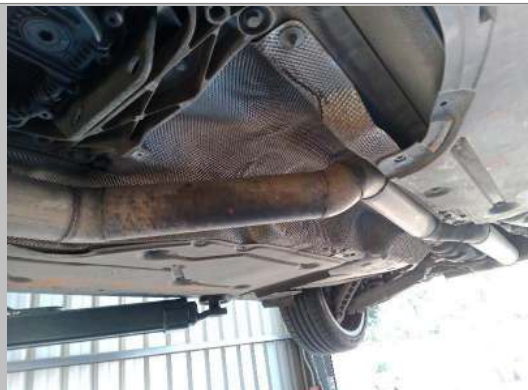

Engine to silencer pipe





Engine to silencer pipe



Engine to silencer pipe



Catalytic converter



Silencer



Steering Wheel Trim



## CONDITION REPORT

Report No: 2016348187

DATE  
19/04/2024

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
[www.dekraauto.co.za](http://www.dekraauto.co.za)