



CONDITION REPORT

Report No: 2016608489

DATE
12/11/2024

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	12/11/2024		M57 Pretoria Road - 1619
Inspection Date	12/11/2024		Kempton Park - GT

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	
Manufacturer	BMW	Registration Number	BW86WFGP
Model	X5 XDRIVE40D DSL AT [2010-2014]	Register Number	
VIN	WBAZW62070L799888	Date Of First Licensing	
Engine Number		Last COR	
Doors	5	License Expiry Date	30/11/2024
Color	WHITE	Power / Displacement	
Year Model	2012	Paint Finish	TWO COAT METALLIC
Km Reading	340,666 KM	Fuel	DIESEL
Cab / Body Type	SUV	Transmission	AUTOMATIC

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

Damage	Repair Way
Engine Oil Leak	Repair
Bonnet stay and shocks Damaged	Replace
Seat Front Right Damaged	Repair
Side Mirror Right Damaged	Repair
Front Bumper Damaged	Repair
Bonnet Damaged	Repair
Rear Fender Right Damaged	Repair
Door Front Left Damaged	Repair
Door Rear Left Damaged	Repair
Rear bumper Damaged	Repair
Air Suspension Rear Left Damaged	Replace
Air Suspension Rear Right Damaged	Replace
Shock Absorber Front Left Worn	Replace
Control Arm Bush(es) Front Axle Left Worn	Replace
Control Arm Bush(es) Front Axle Right Worn	Replace
Tyre Front Left Worn	Replace
Tyre Rear Left Worn	Replace
Tyre Rear Right Worn	Replace
Gearbox Oil Leak	Repair
Prop Shaft Damaged	Repair
Differential Oil Leak	Repair
Steering Noisy	Repair
Brakes Insufficient	Repair
Road Stability Insufficient	Repair
brakes	electronic handbrake switch damaged

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WBAZW62070L799888

1 / 13



CONDITION REPORT

Report No: 2016608489

DATE
12/11/2024

Brakes

Brake Test Results

No Brake Test on a brake test machine has been performed.

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s ²]
Front	-	-	-	
Rear	-	-	-	
Emergency / Parking	-	-	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	275/40R20	106W	Bridgestone	Radial	V	1421	0 mm
Front Right	275/40R20	106W	Bridgestone	Radial	V	0821	2 mm
Rear Left	315/35R20	110W	Bridgestone	Radial	V	4716	0 mm
Rear Right	315/35R20	110W	Bridgestone	Radial	V	4716	0 mm

* Tyre Legend: V=Virgin, R=Recap

Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

No	System	Code	Description	Status
1	DDE(ENGINE DIESEL ELECTRONICS)	0049A6	LIN PASS COMMUNICATION FAULT	

Inspection Conditions

No Test Drive

Battery Flat

Engine number – not possible to verify engine number (not visible without dismantling)

Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS. LEFT AND RIGHT RIDE HEIGHT INCORRECT. 79 DTC'S AT TIME OF TESTING DTC REPORT. VEHICLE ELECTRONICS MALFUNCTIONING. Body • Exterior: Minor dents and scratches and stone chips. Poor alignment to somebody panels. Signs of repair work done to somebody panels.

Axle and Suspension: excessive noise from front and rear suspension.

Road Test: front prop shop missing from x drive system. vehicle suspension not working correctly vehicle unsafe to drive.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Werner Laubscher

This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT


VIN: WBAZW629701790888

Report No: 2016608489

2 / 13

DATE


12/11/2024

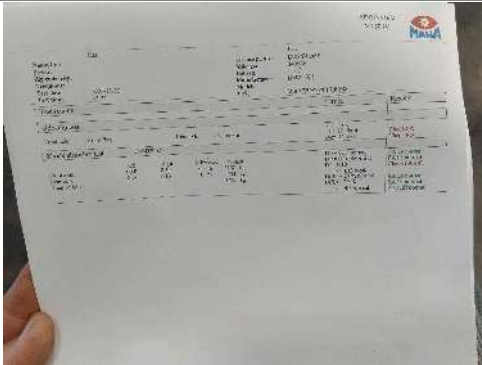


Shock test




diagnostics.

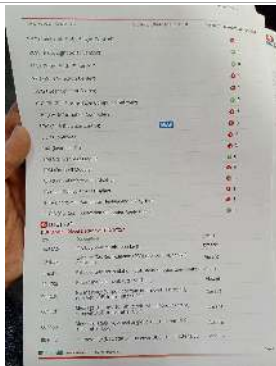


diagnostics.

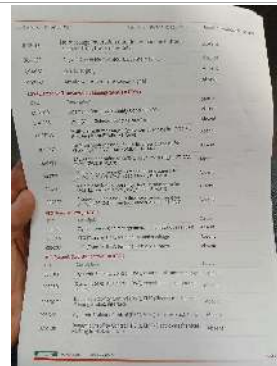

diagnostics.

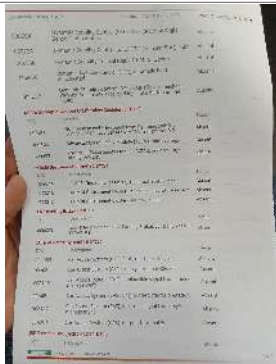

diagnostics.

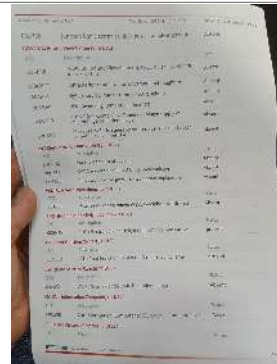

diagnostics.



CONDITION REPORT

Report No: 2016608489
VIN: WBAZW62070L799888
DATE
3/7/13
12/11/2024


DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za




CONDITION REPORT

Report No: 2016608489

DATE
VIN: WBAZW62Q70L799888
12/11/2024
4/13

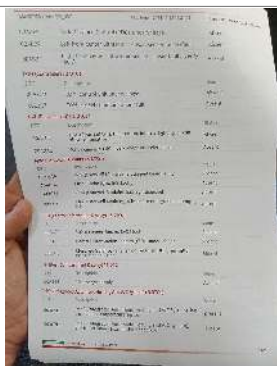

diagnostics.

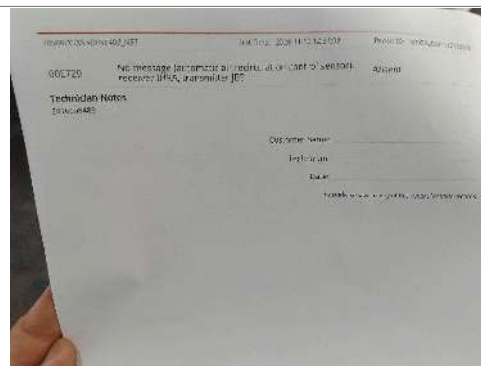

diagnostics.



FRONT RIGHT CORNER



REAR LEFT CORNER



INTERIOR (FRONT DRIVER DOOR)



DASHBOARD (W/ ENGINE RUNNING)



CONDITION REPORT

Report No: 2016608489

DATE
12/11/2024

VIN: WBAZW62070L799888

5 / 13

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016608489

DATE
12/11/2024

VIN: WBAZW62070L799888

6 / 13



ODOMETER



automatic.



90 DEGREE FRONT



90 DEGREE RIGHT



90 DEGREE REAR



90 DEGREE LEFT



CONDITION REPORT

Report No: 2016608489

DATE
12/11/2024

VIN: WBAZW62070L799888

7 / 13

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016608489

DATE
12/11/2024



LF TYRE TREAD



LR TYRE TREAD



RR TYRE TREAD



RF TYRE TREAD



LICENSE DISC



VIN PLATE OR STICKER

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016608489

DATE
12/11/2024

VIN: WBAZW62070L799888
9 / 13

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016608489

DATE
12/11/2024

ENGINE 1



undercarriage front.

VIN: WBAZW62070L799888

10 / 13



undercarriage rear.



electronic brake switch damage



oil cap.



Water level



CONDITION REPORT

Report No: 2016608489

DATE
12/11/2024

VIN: WBAZW62070L799888
11 / 13

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016608489

DATE
12/11/2024

Bonnet stay and shocks



Front Bumper



Front Bumper



Bonnet



Door Front Left



Door Rear Left



CONDITION REPORT

Report No: 2016608489

DATE
12/11/2024

VIN: WBAZW62070L799888
13 / 13

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016608489

DATE
12/11/2024

Rear bumper



Rear bumper



Rear Fender Right



Seat Front Right



Side Mirror Right



Tyre Rear Left

**CONDITION REPORT**

Report No: 2016608489

DATE
12/11/2024

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016608489

DATE
12/11/2024

Tyre Rear Right



Tyre Front Left



Prop Shaft



Gearbox



Engine



Shock Absorber Front Left



CONDITION REPORT

Report No: 2016608489

DATE
12/11/2024

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016608489

DATE
12/11/2024

Control Arm Bush(es) Front Axle Left



Control Arm Bush(es) Front Axle Left



Control Arm Bush(es) Front Axle Right



Control Arm Bush(es) Front Axle Right



Air Suspension Rear Left



Air Suspension Rear Right

**CONDITION REPORT**

Report No: 2016608489

DATE
12/11/2024

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

**CONDITION REPORT**

Report No: 2016608489

DATE
12/11/2024

Differential

**CONDITION REPORT****Report No: 2016608489****DATE**
12/11/2024

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za