



CONDITION REPORT

Report No: 2016871497

DATE
09/05/2025

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	09/05/2025		M57 Pretoria Road - 1619
Inspection Date	09/05/2025		Kempton Park - GT


Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	MFC AUCTION HOUSE
Manufacturer	MERCEDES-BENZ	Registration Number	HT29KVG
Model	C250 CDI BLUEEFFICIENCY DSL 7-SP AT (2011-2014)	Register Number	
VIN	WDD2040032R189390	Date Of First Licensing	
Engine Number		Last COR	
Doors	4	License Expiry Date	
Color	WHITE	Power / Displacement	
Year Model	2011	Paint Finish	TWO COAT UNI
Km Reading	128,788 KM	Fuel	DIESEL
Cab / Body Type	SEDAN	Transmission	AUTOMATIC

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

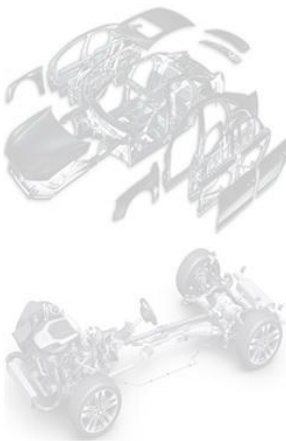

Damage	Repair Way
Engine Oil Leak	Repair
Engine Wiring Defective	Repair
Hoses Defective	Replace
Expansion Bottle Damaged	Replace
Bonnet stay and shocks Damaged	Replace
Air Conditioner Insufficient	Replace
Indicator Light Front Left Damaged	Replace
Indicator Light Front Right Damaged	Replace
Headlight Left Damaged	Replace
Headlight Right Damaged	Replace
Seat Front Right Damaged	Repair
Seat Belt Rear Left Damaged	Repair
Seat Belt Rear Right Damaged	Replace
Front Bumper Damaged	Repair
Grill Damaged	Replace
Bonnet Residual Traces of Repair	Repair
Bonnet slam plate (Shock tower/ Inner tray) Dented	Repair
A • Pillar Left Residual Traces of Repair	Repair
Front Fender Left Residual Traces of Repair	Repair

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WDD2040032R189390



CONDITION REPORT

Report No: 2016871497

DATE
09/05/2025

Damage	Repair Way
Front Fender Right Residual Traces of Repair	Repair
Rear Fender Left Paintwork • Scratched	Repair
Rear Fender Right Paintwork • Scratched	Repair
Front Fender Right / Inner Tray Damaged	Repair
Door Front Left Paintwork • Scratched	Repair
Door Front Right Residual Traces of Repair	Repair
Door Rear Left Paintwork • Scratched	Repair
Door Rear Right Residual Traces of Repair	Repair
Boot Lid / Hatch door Paintwork • Chipmarks	Repair
Rear bumper Damaged	Repair
Windscreen Chipped	Repair
Service Brake Performance Rear Axle Left / Right	Repair
Difference out of legal range	Repair
Shock Absorber Front Left Leak	Replace
Shock Absorber Front Right Leak	Replace
Stabilizer Mounting Front Left Damaged	Replace
Stabilizer Mounting Front Right Defective	Replace
Control Arm Bush(es) Front Axle Left Cracked	Replace
Control Arm Bush(es) Front Axle Right Cracked	Replace
Tyre Rear Left Damaged	Replace
Rim Front Right Defective	Repair
Main Beam Right Welded	Repair
Engine to silencer pipe Damaged	Repair
Gearbox Oil Leak	Repair
Differential Oil Leak	Repair
Engine Smoke Excessive	Repair
Gear Selections Malfunction	Repair
Undercarriage	Bottom of engine and gearbox fully covered
Body and Exterior	Poor residual traces of repair on some body panels
Body and Exterior	Dents and scratches on some body panels
Body and Exterior	Stone chips and spray work on some body panels
Body and Exterior	Some body panels misaligned
Body and Exterior	Vehicle safety integrity compromised
Body and Exterior	Vehicle a cut and joint on front right main beam
Tyres and rims	Only loose tyre inside boot of vehicle
Tyres and rims	Front and rear tyre sizes different
Dipstick holder broken	Replace
Excessive oil leak on undercarriage	Repair

Brakes

Brake Test Results

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s ²]
Front	3.85	3.69	-	
Rear	2.56	3.58	-	
Emergency / Parking	2.53	1.67	-	

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WDD2040032R189390



CONDITION REPORT

Report No: 2016871497

DATE
09/05/2025

Tyres and Rims
Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	225/40 R18	92W	Pallyking	Grip tech	V	3023	4 mm
Front Right	225/40 R18	92W	Pallyking	Grip tech	V	3023	3 mm
Rear Left	255/35Z R18	94W	Toledo	TL1000	V	0118	0 mm
Rear Right	255/35Z R18	94W	Toledo	TL1000	V	0118	3 mm
Spare	P225/40Z R18	92W	Nexen	Nfera	V	2422	6 mm

* Tyre Legend: V=Virgin, R=Recap

Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

No	System	Code	Description	Status
1	ECM(ENGINE CONTROL UNIT)	P068500	THE OUTPUT FOR RELAY'CIRCUIT 87' HAS AN ELECTRICAL	

Inspection Conditions

No Test Drive
Battery Flat
Engine number – not possible to verify engine number (not visible without dismantling)
Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Sibusiso Mokase

This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WDD2040032R189390



CONDITION REPORT

Report No: 2016871497

DATE
09/05/2025

FRONT RIGHT CORNER



REAR LEFT CORNER



90 DEGREE FRONT



90 DEGREE REAR



90 DEGREE LEFT



90 DEGREE RIGHT

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WDD2040032R189390



CONDITION REPORT

Report No: 2016871497

DATE
09/05/2025

ODOMETER



DASHBOARD (W/ ENGINE RUNNING)




INTERIOR (FRONT DRIVER DOOR)



LF TYRE TREAD



RF TYRE TREAD

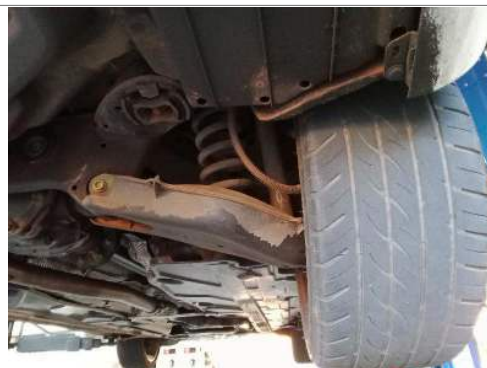

RR TYRE TREAD

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WDD2040032R189390



CONDITION REPORT

Report No: 2016871497

DATE
09/05/2025

LR TYRE TREAD



Spare tyre and Accessories



Oil cap and dipstick



Front chassis



Rear chassis



Automatic Transmission

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WDD2040032R189390



CONDITION REPORT

Report No: 2016871497

DATE
09/05/2025

ENGINE 1




VIN PLATE OR STICKER



LICENSE DISC



Brake and shock absorber report

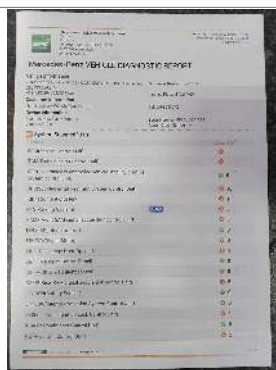

Diagnostic report page 1



Diagnostic report page 2

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WDD2040032R189390



Diagnostic report page 3



Diagnostic report page 4




Diagnostic report page 5



Diagnostic report page 6



Diagnostic report page 7

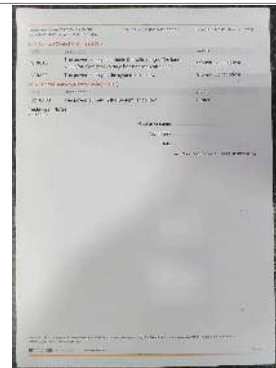

Diagnostic report page 8

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WDD2040032R189390



CONDITION REPORT

Report No: 2016871497

DATE
09/05/2025

Seat Front Right



Seat Belt Rear Right



Seat Belt Rear Left



Rear Fender Left



Door Rear Left



Door Front Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WDD2040032R189390



CONDITION REPORT

Report No: 2016871497

DATE
09/05/2025

Front Fender Left



Indicator Light Front Left



Front Bumper



Bonnet



Grill



Front Fender Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WDD2040032R189390



CONDITION REPORT

Report No: 2016871497

DATE
09/05/2025

Door Front Right



Door Rear Right



Rear Fender Right



Windscreen



A • Pillar Left



Rear bumper

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WDD2040032R189390



CONDITION REPORT

Report No: 2016871497

DATE
09/05/2025




Rear bumper




Boot Lid / Hatch door



Air Conditioner

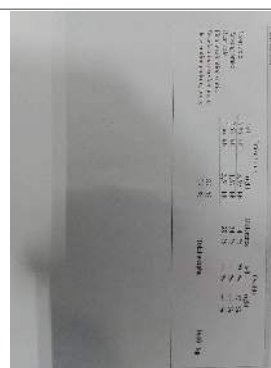

Service Brake Performance Rear Axle

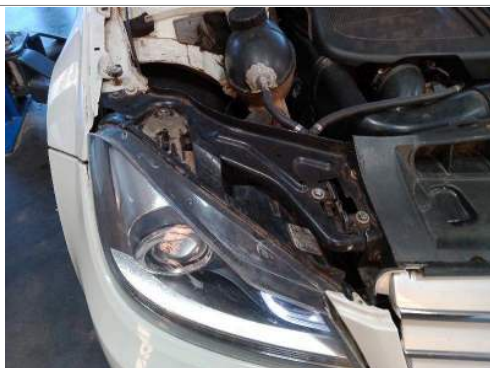

Headlight Right



Headlight Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WDD2040032R189390



CONDITION REPORT

Report No: 2016871497

DATE
09/05/2025

Front Fender Right / Inner Tray



Main Beam Right



Rim Front Right



Control Arm Bush(es) Front Axle Right



Tyre Rear Left



Shock Absorber Front Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WDD2040032R189390



CONDITION REPORT

Report No: 2016871497

DATE
09/05/2025

Shock Absorber Front Right



Control Arm Bush(es) Front Axle Left



Stabilizer Mounting Front Left



Stabilizer Mounting Front Right



Main Beam Right



Engine

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WDD2040032R189390



CONDITION REPORT

Report No: 2016871497

DATE
09/05/2025

Gearbox



Differential



Engine to silencer pipe



Hoses



Water level



Expansion Bottle

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WDD2040032R189390



CONDITION REPORT


Report No: 2016871497

DATE
09/05/2025

Engine Wiring



Bonnet slam plate (Shock tower/ Inner tray)

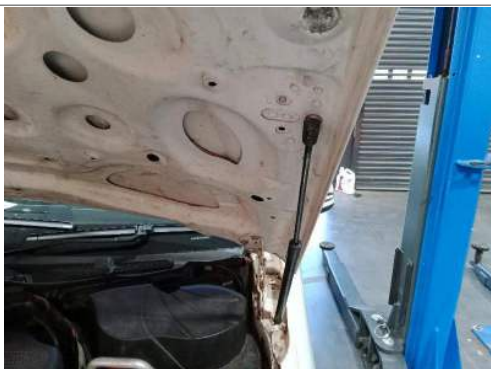

Bonnet stay and shocks



Bonnet stay and shocks



Gear Selections

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WDD2040032R189390