

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	05/01/2024		M57 Pretoria Road - 1619
Inspection Date	05/01/2024		Kempton Park - GT

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	MFC
Manufacturer	MERCEDES-BENZ	Registration Number	CY56973
Model	C180	Register Number	
VIN	WDD2040492R168166	Date Of First Licensing	
Engine Number		Last COR	
Doors	4	License Expiry Date	31/07/2024
Color	WHITE	Power / Displacement	
Year Model		Paint Finish	TWO COAT UNI
Km Reading	228,605 KM	Fuel	PETROL
Cab / Body Type	SEDAN	Transmission	AUTOMATIC

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

	Damage	Repair Way
	Engine Oil Leak	Repair
	Center Console / Cubbyhole + Lid Damaged	Repair
	Brake Light Left Defective	Repair
	Brake Light Right Defective	Replace
	Front Bumper Damaged	Repair
	Bonnet Damaged	Repair
	Front Fender Left Damaged	Repair
	Front Fender Right Damaged	Repair
	Rear Fender Left Damaged	Repair
	Rear Fender Right Damaged	Repair
	Door Front Left Damaged	Repair
	Door Front Right Damaged	Repair
	Door Rear Left Damaged	Repair
	Door Rear Right Damaged	Repair
	Boot Lid / Hatch door Damaged	Repair
	Rear bumper Damaged	Repair
	Windscreen Chipped	Replace
	Stabilizer Mounting Front Left Damaged	Replace
	Stabilizer Mounting Front Right Damaged	Replace
	Control Arm Bush(es) Rear Axle Left Worn	Replace
	Control Arm Bush(es) Rear Axle Right Worn	Replace
	Tyre Rear Left Worn	Replace
	Tyre Rear Right Worn	Replace
	Mounting rubber(s) Rear Left Worn	Replace
	Mounting rubber(s) Rear Right Worn	Replace
	Gearbox Oil Leak	Repair
	Engine Performance Insufficient	Repair
	Gear Selections Slippy Hesitation	Repair

Brakes

Brake Test Results

	Left	Right	Axle Weight [KG]	Deceleration [m/s ²]
	Braking Force [KN]	Braking Force [KN]		
Front	3.07	3.21	-	
Rear	2.45	2.75	-	
Emergency / Parking	2.29	1.97	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	225/45R17	94W	Landsail	Radial	V	0623	3 mm
Front Right	225/45R17	94W	Landsail	Radial	V	0623	2 mm
Rear Left	225/45R17	94W	Achilles	Radial	V	4017	0 mm
Rear Right	225/45R17	94Y	Goodyear	Eagle	V	2714	0 mm

* Tyre Legend: V=Virgin, R=Recap

Diagnostic

During the diagnostic no active error messages were detected. (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

Inspection Conditions

No Test Drive

Battery Flat

Engine number – not possible to verify engine number (not visible without dismantling)

Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO AGE AND MILEAGE OF VEHICLE NORMAL WEAR AND TEAR ON INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS. SHOCK ABSORBER TEST NOT PERFORMED. ENGINE MANAGEMENT LIGHTS ILLUMINATED ON CLUSTER. VEHICLE ELECTRONICS MALFUNCTIONING.

Body • Exterior: Minor dents and scratches and stone chips to some body panels. Signs of repair work done to some body panels. Poor alignment to some body panels.

Road Test: Excessive noise from front and rear suspension.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Werner Laubscher

This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.



FRONT RIGHT CORNER



REAR LEFT CORNER



INTERIOR (FRONT DRIVER DOOR)



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER



90 DEGREE FRONT



CONDITION REPORT

Report No: 2016219037

VIN: WDD2040492R168166

DATE

05/01/2024



90 DEGREE RIGHT



90 DEGREE REAR




90 DEGREE LEFT



LF TYRE TREAD



LR TYRE TREAD

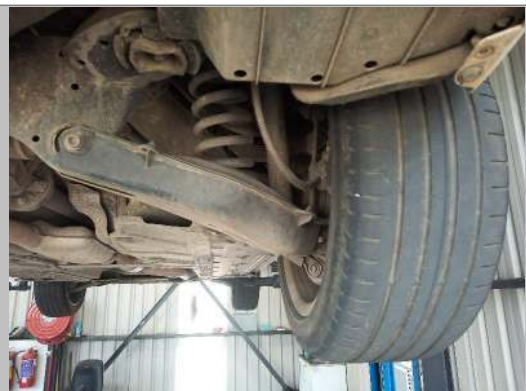

RR TYRE TREAD




RF TYRE TREAD



LICENSE DISC



VIN PLATE OR STICKER

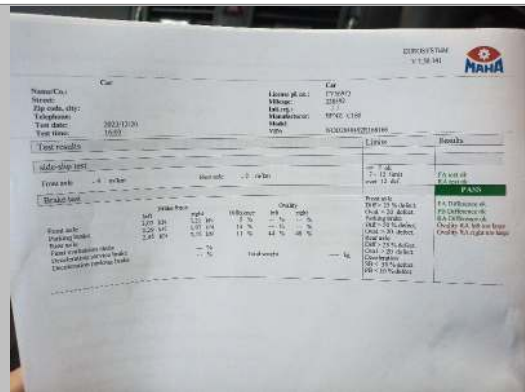

ADDITIONAL 1



ADDITIONAL 2



ADDITIONAL 3

VIN: WDD2040492R168166

7 / 13

VIN: WDD2040492R168166

8 / 13




ADDITIONAL 4



ADDITIONAL 5



ADDITIONAL 6

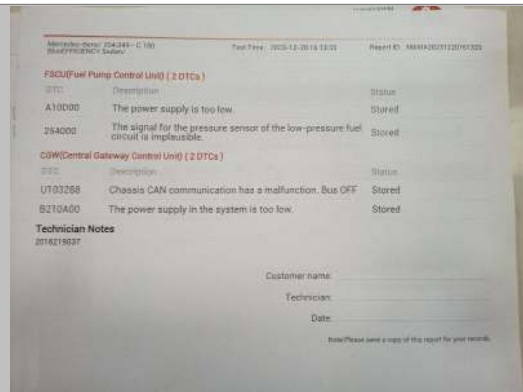

ADDITIONAL 7



ADDITIONAL 8




ADDITIONAL 9

VIN: WDD2040492R168166

9 / 13



ENGINE 1

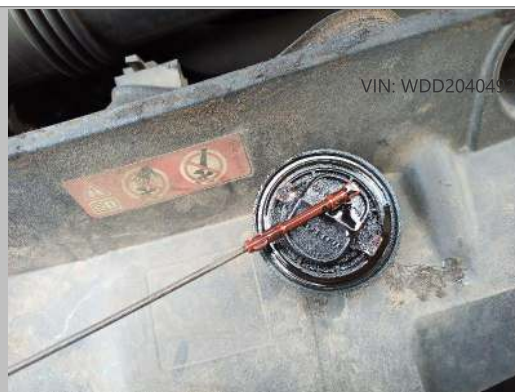VIN: WDD204049 168166
10 / 13

ADDITIONAL 10



ADDITIONAL 11



Water level



Front Bumper



Front Bumper

VIN: WDD2040492R168166

11 / 13



Bonnet



VIN: WDD2040492R168166

12 / 13

Front Fender Left



Door Front Left



Door Rear Left



Rear Fender Left



Rear bumper

VIN: WDD2040492R168166

13 / 13



Rear bumper



Boot Lid / Hatch door



Rear Fender Right



Front Fender Right



Door Front Right



Door Rear Right



Windscreen




Brake Light Left




Brake Light Right



Center Console / Cubbyhole + Lid

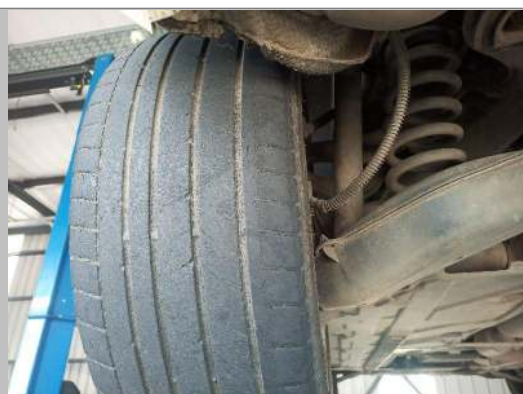

Tyre Rear Left

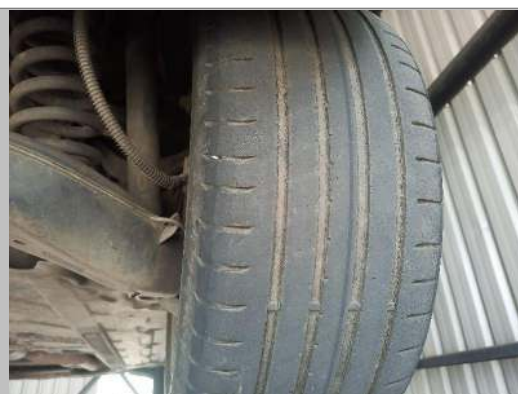

Tyre Rear Right



Engine



Gearbox



Stabilizer Mounting Front Left



Stabilizer Mounting Front Right



Control Arm Bush(es) Rear Axle Right




Control Arm Bush(es) Rear Axle Left



Mounting rubber(s) Rear Right



Mounting rubber(s) Rear Left

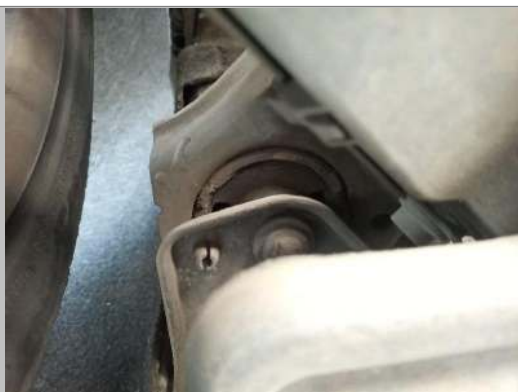

Mounting rubber(s) Rear Left



Mounting rubber(s) Rear Right



CONDITION REPORT

Report No: 2016219037

DATE
05/01/2024

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za