

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	11/12/2023		M57 Pretoria Road - 1619
Inspection Date	11/12/2023		Kempton Park - GT

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	MFC
Manufacturer	MERCEDES-BENZ	Registration Number	FB26NYGP
Model	C200	Register Number	
VIN	WDD2050422R127583	Date Of First Licensing	
Engine Number		Last COR	
Doors	4	License Expiry Date	30/04/2023
Color	WHITE	Power / Displacement	
Year Model		Paint Finish	C - COMMON
Km Reading	215,017 KM	Fuel	PETROL
Cab / Body Type	SEDAN	Transmission	AUTOMATIC

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

Damage	Repair Way
Switch Electrical Window Winder rear right Defective	Repair
Windscreen Wiper Worn	Replace
Seat Front Right Torn / Cut	Repair
Side Mirror Right Paintwork • Scratched	Repair
Front Bumper Paintwork • Scratched	Repair
Front Fender Left Dented	Repair
Front Fender Right Dented	Repair
Rear Fender Right Paintwork • Scratched	Repair
Rear bumper Paintwork • Scratched	Repair
Windscreen Cracked	Replace
Alignment Left / Right Difference out of legal range	Repair
Control Arm Bush(es) Front Axle Left Damaged	Replace

Brakes

Brake Test Results

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s ²]
Front	3.7	3.6	-	
Rear	2.2	2.3	-	
Emergency / Parking	1.1	1.6	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	225/50R17	94W	Bridgestone	Turanza	V	1815	1 mm
Front Right	225/50R17	94W	Bridgestone	Potenza	V	3520	1 mm
Rear Left	225/45R17	94W	Hilo	Vantage	V	2119	2 mm
Rear Right	225/45R17	91W	Continental	Contact	V	1622	3 mm

* Tyre Legend: V=Virgin, R=Recap

Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

No	System	Code	Description	Status
1	ENGINE CONTROL UNIT	P06DA00	THE ACTUATION OF THE VALVE OF THE OIL PUMP IN THE	

Inspection Conditions

No Test Drive
Rain at time of inspection
Battery Flat
Engine number – not possible to verify engine number (not visible without dismantling)
Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE NORMAL WEAR AND TEAR MARKS ON BODY INTERIOR EXTERIOR AND MECHANICAL ENGINEERING PARTS.
Engine Compartment: Bottom of engine is fully covered.
Body • Exterior: Minor dents scratches and stone chips on some body panels. Sings of spray work done on some body panels.
Axle and Suspension: Excessive noise from front suspension.
Undercarriage: Bottom of undercarriage is covered.

Concluding Remarks


THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician


Trevino Julius

This document was created electronically and is valid without signature.


General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

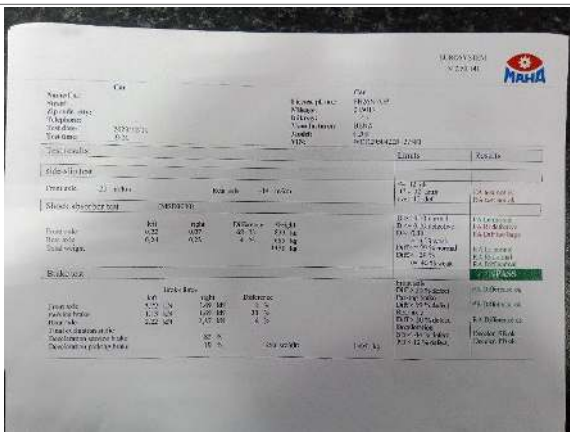


BRAKE REPORT

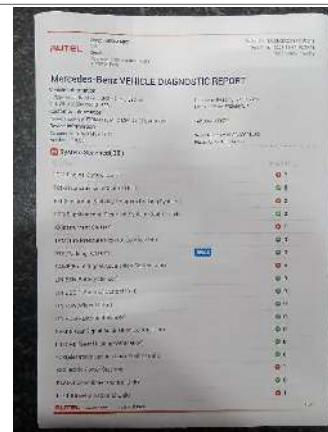

Diagnostic test

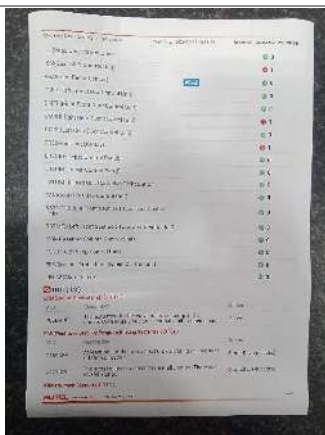

Diagnostic test

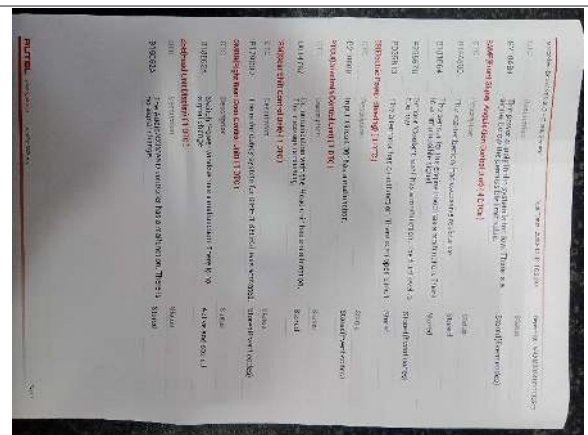

Diagnostic test



Diagnostic test



VIN PLATE OR STICKER



LICENSE DISC



R/F day time running light def



Automatic



No sparewheel



Expansion bottle



Oil cap and dipstick



Rear chassis



FRONT RIGHT CORNER



REAR LEFT CORNER



INTERIOR (FRONT DRIVER DOOR)



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER

VIN: WDD2050422R127583

7 / 12

VIN: WDD2050422R127583

8 / 12



90 DEGREE FRONT



90 DEGREE RIGHT



90 DEGREE REAR



90 DEGREE LEFT



LF TYRE TREAD



LR TYRE TREAD

VIN: WDD2050422R127583

9 / 12



RR TYRE TREAD



RF TYRE TREAD



ENGINE 1



CHASSIS



ENGINE 2



Water level

VIN: WDD2050422R127583

11 / 12



Water level



12 / 12

Front Fender Right



Front Bumper



Front Bumper



Rear bumper



Rear bumper



Rear bumper



Rear Fender Right



Front Bumper



Front Bumper



Control Arm Bush(es) Front Axle Left



Control Arm Bush(es) Front Axle Left



Control Arm Bush(es) Front Axle Left



Windscreen



Side Mirror Right



Front Fender Left



Windscreen Wiper



Seat Front Right



Seat Front Right



Seat Front Right



Switch Electrical Window Winder rear right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za