



CONDITION REPORT

Report No: 2016252626

DATE
02/02/2024

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572

**Assignment**

Client	MFC Auction House	Inspection Location	MFC
Requested Date	02/02/2024		M57 Pretoria Road - 1619
Inspection Date	02/02/2024		Kempton Park - GT


Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	MFC AUCTION HOUSE
Manufacturer	FORD	Registration Number	FJ36GSGP
Model	FIESTA	Register Number	
VIN	WF0DXXGAKDGR54328	Date Of First Licensing	
Engine Number		Last COR	
Doors	5	License Expiry Date	31/12/2023
Color	GREY	Power / Displacement	
Year Model		Paint Finish	M - METALLIC
Km Reading	135,284 KM	Fuel	PETROL
Cab / Body Type	HATCHBACK	Transmission	MANUAL

Vehicle Options & Accessories**Items**

VEHICLE INSPECTION

Damage	Repair Way
Under bonnet insulation cover Damaged	Replace
Front Bumper Paintwork • Scratched	Repair
Front Fender Left Dented	Repair
Front Fender Right Paintwork • Scratched	Repair
Rear Fender Right Dented	Repair
Door Front Left Dented	Repair
Door Front Right Dented	Repair
Door Rear Left Paintwork • Discoloured	Repair
Rear bumper Paintwork • Scratched	Repair
CV Joint(s) Boot(s) Front Right (inner/outer) Defective	Repair

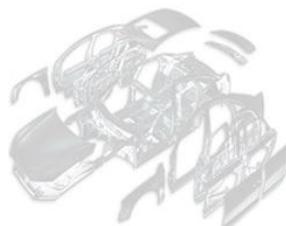



CONDITION REPORT

Report No: 2016252626

DATE
02/02/2024

Brakes

Brake Test Results

	Left	Right	Axle Weight [KG]	Deceleration [m/s ²]
	Braking Force [kN]	Braking Force [kN]		
Front	3.1	3.2	-	
Rear	2.1	2.0	-	
Emergency / Parking	1.4	1.6	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	195/50R15	82V	Hankook	Ventus	V	0620	2 mm
Front Right	195/50R15	82V	Hankook	Ventus	V	0520	3 mm
Rear Left	195/50R15	82V	Hankook	Ventus	V	0520	3 mm
Rear Right	175/65R14	82T	Continental	Contact	V	0316	4 mm
Spare	195/50R15	82H	Hankook	Ventus	V	///	4 mm

* Tyre Legend: V=Virgin, R=Recap

Diagnostic

During the diagnostic no active error messages were detected. (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacturer).

Inspection Conditions

No Test Drive

Battery Flat

Engine number – not possible to verify engine number (not visible without dismantling)

Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS. Body • Exterior: Vehicle got some, scratches stone chips and dents on some body panels

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Andrick Wymers

This document was created electronically and is valid without signature.

General Remarks:

The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.



CONDITION REPORT

VIN: WBYFVWYNGA0C952626


Report No: 2016232626

2 / 9

DATE

02/02/2024

Shock and brake report

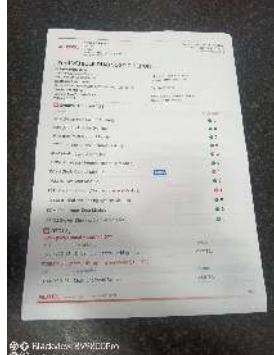

**CONDITION REPORT****Report No: 2016252626**

VIN: WF0DXXGAKDGR54328

DATE

02/02/2024

3/9

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016252626

DATE

VIN: WF0DXXGA620000000 02/02/2024

4 / 9



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER



90 DEGREE FRONT



90 DEGREE RIGHT



90 DEGREE REAR



90 DEGREE LEFT



CONDITION REPORT

Report No: 2016252626

DATE
02/02/2024

VIN: WF0DXXGAKDGR54328

5 / 9

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016252626

DATE
02/02/2024

VIN: WF0DXXGAKDGR54328

6 / 9



LF TYRE TREAD



LR TYRE TREAD



RR TYRE TREAD



RF TYRE TREAD



Spare wheel fitted



LICENSE DISC



CONDITION REPORT

Report No: 2016252626

DATE
02/02/2024

VIN: WF0DXXGAKDGR54328

7 / 9

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016252626

DATE
02/02/2024

VIN PLATE OR STICKER



ENGINE 1



ENGINE 2



CHASSIS



Expansion bottle



Oil cap and dipstick



CONDITION REPORT

Report No: 2016252626

DATE
02/02/2024

VIN: WF0DXXGAKDGR54328

9 / 9



CONDITION REPORT

Report No: 2016252626

DATE
02/02/2024

Manual



Water level



Under bonnet insulation cover



Door Front Right



Front Fender Right



Front Bumper



CONDITION REPORT

Report No: 2016252626

DATE
02/02/2024

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016252626

DATE
02/02/2024

Front Bumper



Front Fender Left



Door Front Left



Door Rear Left



Rear bumper



Rear bumper



CONDITION REPORT

Report No: 2016252626

DATE
02/02/2024

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016252626

DATE
02/02/2024

Rear Fender Right



CV Joint(s) Boot(s) Front Right (inner/outer)

**CONDITION REPORT**

Report No: 2016252626

DATE
02/02/2024

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za