



CONDITION REPORT

Report No: 2016403039

DATE
03/06/2024

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	03/06/2024		M57 Pretoria Road - 1619
Inspection Date	03/06/2024		Kempton Park -


Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	MFC AUCTION HOUSE
Manufacturer	VOLKSWAGEN	Registration Number	KHX312NW
Model	GOLF TSI	Register Number	
VIN	WVWZZZ1KZCW163177	Date Of First Licensing	
Engine Number		Last COR	
Doors	5	License Expiry Date	03/06/2024
Color	GREY	Power / Displacement	
Year Model		Paint Finish	M - METALLIC
Km Reading	264,151 KM	Fuel	PETROL
Cab / Body Type	HATCHBACK	Transmission	MANUAL

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

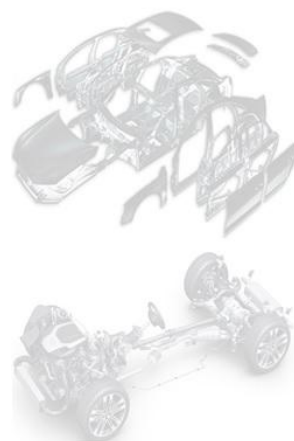

Damage	Repair Way
Engine Oil Leak	Repair
Air cleaner Damaged	Replace
Hooter Defective	Repair
Seat Front Right Torn / Cut	Repair
Side Mirror Left Paintwork • Scratched	Repair
Front Bumper Damaged	Repair
Bonnet Paintwork • Discoloured	Repair
Front Fender Left Paintwork • Discoloured	Repair
Front Fender Right Paintwork • Discoloured	Repair
Rear Fender Left Paintwork • Scratched	Repair
Door Front Left Paintwork • Scratched	Repair
Door Front Right Paintwork • Scratched	Repair
Door Rear Left Paintwork • Scratched	Repair
Door Rear Right Paintwork • Scratched	Repair
Boot Lid / Hatch door Dented	Repair
Rear bumper Damaged	Repair
Brake disc 2. Axle right Damaged	Replace
Brake Pad/Shoe 2. Axle right Damaged	Replace
Service Brake Performance Rear Axle Left / Right	Repair
Difference out of legal range	
Parking Brake Performance Left / Right Difference out of legal range	Repair
Control Arm Bush(es) Front Axle Left Cracked	Replace
Control Arm Bush(es) Front Axle Right Cracked	Replace
Tyre Front Right Damaged	Replace
Spare Tyre Damaged	Replace
Bolt(s) / Nut(s) Front Wheel Left Missing	Replace
Bolt(s) / Nut(s) Rear Wheel Left Missing	Replace
Bolt(s) / Nut(s) Rear Wheel Right Missing	Replace

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WVWZZZ1KZCW163177

1 / 14



CONDITION REPORT

Report No: 2016403039

DATE
03/06/2024

Damage

Radiator Cradle Damaged
Engine Performance Idling / Hunting
Engine Noise Excessive
Engine Smoke Excessive
Battery loose
Engine management lights illuminated
Aircon not working
Both front fog lights malfunction
No license disc

Repair Way

Repair
Repair
Repair
Repair
Repair
Repair
Repair
Repair
Replace

Brakes

Brake Test Results

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s ²]
Front	2.5	2.8	-	
Rear	1.9	0.2	-	
Emergency / Parking	1.6	0.1	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	245/40R18	97Y	Continental	Contact	V	0419	1 mm
Front Right	225/40R18	92W	Frun-two	Full run	V	3919	3 mm
Rear Left	T125/70R19	100M	Continental	Temporary	V	2014	3 mm
Rear Right	225/45R18	95W	Rapid	P609	V	0221	1 mm
Spare	225/40R18	92Y	Michelin	Pilot sport	V	1111	0 mm

* Tyre Legend: V=Virgin, R=Recap

Diagnostic

During the diagnostic no active error messages were detected. (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

Inspection Conditions

No Test Drive
Battery Flat
Engine number – not possible to verify engine number (not visible without dismantling)
Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS. Body • Exterior: Discoloring on some body panels.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Andrick Wymers

This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT


VIN: WVGZZ71K36W163177

Report No: 2616403099

2 / 14

DATE

03/06/2024

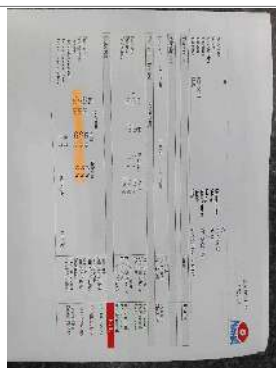


Shock and brake report



Diagnostic report



Diagnostic report

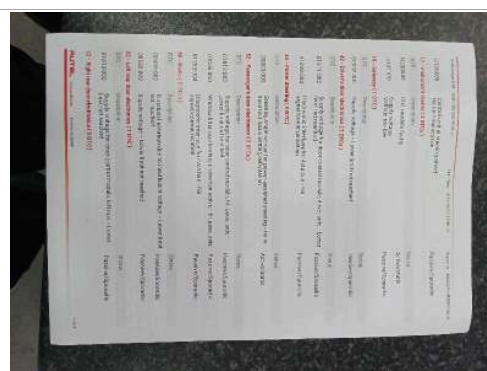

Diagnostic report



Diagnostic report



FRONT RIGHT CORNER

**CONDITION REPORT****Report No: 2016403039**

VIN: WVVZZZ1KZCW163177

DATE**03/06/2024**

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016403039

VIN: WVVZZZ1KZCW163177
DATE
03/06/2024
4 / 14

REAR LEFT CORNER



INTERIOR (FRONT DRIVER DOOR)



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER



Manual



90 DEGREE FRONT



CONDITION REPORT

Report No: 2016403039

DATE
03/06/2024

VIN: ~~WWWZZZ1KZCW163177~~

5 / 14

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016403039

DATE
03/06/2024

VIN: VVVZZZ1KZCW163177

6 / 14




90 DEGREE RIGHT




90 DEGREE REAR




90 DEGREE LEFT

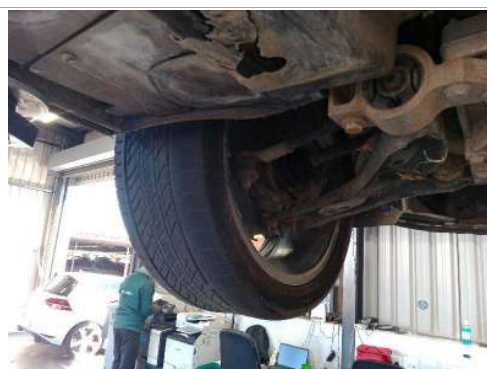

LF TYRE TREAD

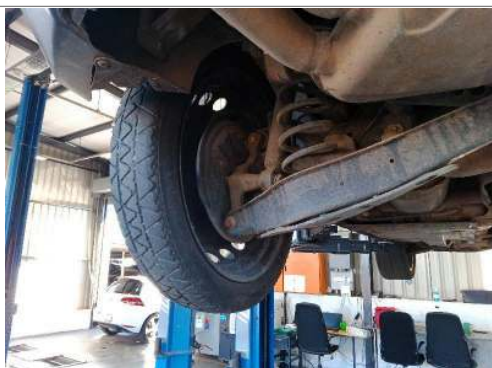

LR TYRE TREAD

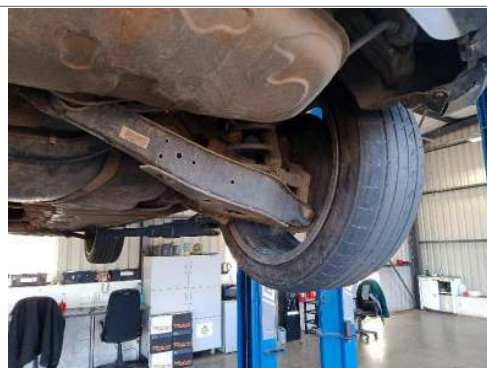

RR TYRE TREAD



CONDITION REPORT

Report No: 2016403039

DATE
03/06/2024

VIN: WVVZZZ1KZCW163177
7 / 14

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016403039

DATE
03/06/2024

RF TYRE TREAD



Spare wheel fitted



LICENSE DISC



VIN PLATE OR STICKER



ENGINE 1



ENGINE 2



CONDITION REPORT

Report No: 2016403039

DATE
03/06/2024

VIN: WWZZZ1KZCW163177
9 / 14

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016403039

DATE
03/06/2024



CHASSIS




Battery loose




Oil cap and dipstick



Expenditure bottle

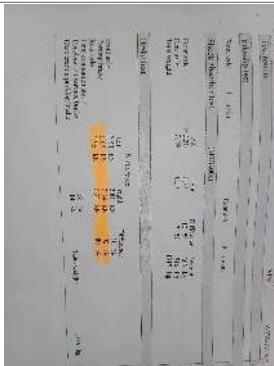

Parking Brake Performance

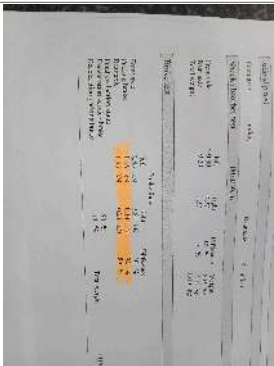

Service Brake Performance Rear Axle

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016403039

DATE
03/06/2024

VIN: WVVZZZ1KZCW163177

11 / 14



CONDITION REPORT


Report No: 2016403039

DATE
03/06/2024

Water level



Air cleaner

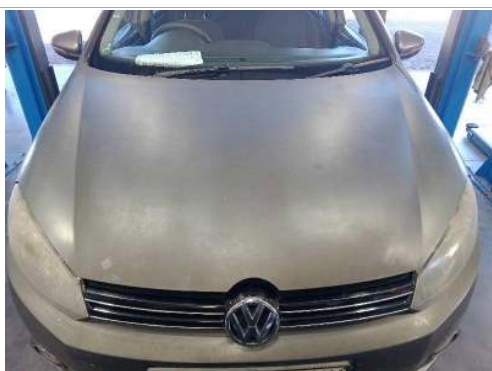VIN: WVVZZZ1KZCW163177
12 / 14

Bonnet



Spare Tyre



Boot Lid / Hatch door



Hooter



CONDITION REPORT

Report No: 2016403039

DATE
03/06/2024

VIN: WWZZZ1KZCW163177
13 / 14

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT


Report No: 2016403039

DATE
03/06/2024


Seat Front Right



Bolt(s) / Nut(s) Rear Wheel Right

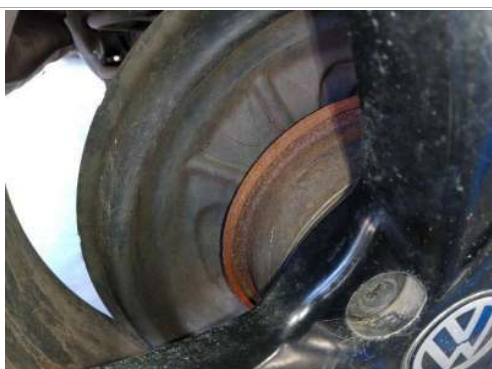VIN: W07ZZZ1KZCW163177
14 / 14

Brake disc 2. Axle right

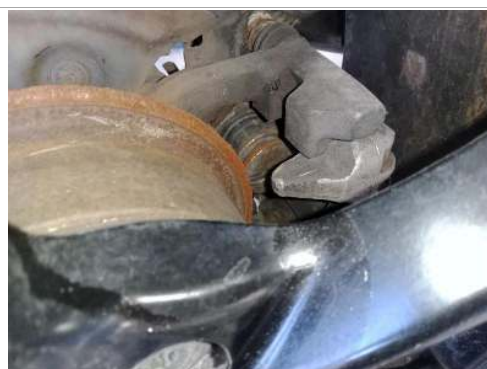

Brake Pad/Shoe 2. Axle right



Bolt(s) / Nut(s) Rear Wheel Left



Bolt(s) / Nut(s) Front Wheel Left



CONDITION REPORT

Report No: 2016403039

DATE
03/06/2024

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016403039

DATE
03/06/2024

Door Rear Right



Door Front Right



Front Fender Right



Front Bumper



Front Bumper



Front Bumper



CONDITION REPORT

Report No: 2016403039

DATE
03/06/2024

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016403039

DATE
03/06/2024

Front Fender Left




Door Front Left



Side Mirror Left



Door Rear Left

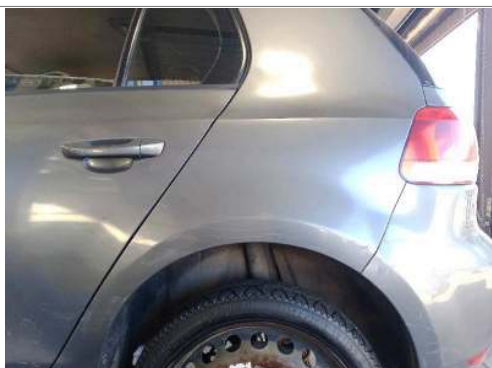

Rear Fender Left



Rear bumper



CONDITION REPORT

Report No: 2016403039

DATE
03/06/2024

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016403039

DATE
03/06/2024

Rear bumper



Engine



Engine



Engine



Control Arm Bush(es) Front Axle Left



Control Arm Bush(es) Front Axle Right



CONDITION REPORT

Report No: 2016403039

DATE
03/06/2024

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016403039

DATE
03/06/2024

Radiator Cradle



Radiator Cradle



Tyre Front Right

**CONDITION REPORT****Report No: 2016403039****DATE**
03/06/2024

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za