



CONDITION REPORT

Report No: 2016337113

DATE
11/04/2024

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	11/04/2024		M57 Pretoria Road - 1619
Inspection Date	11/04/2024		Kempton Park - GT

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	MFC AUCTION HOUSE
Manufacturer	VOLKSWAGEN	Registration Number	NONE
Model	GOLF GTI	Register Number	
VIN	WVWZZZAUZEW271412	Date Of First Licensing	
Engine Number		Last COR	
Doors	5	License Expiry Date	11/04/2024
Color	SILVER	Power / Displacement	
Year Model		Paint Finish	TWO COAT UNI
Km Reading	139,822 KM	Fuel	PETROL
Cab / Body Type	HATCHBACK	Transmission	AUTOMATIC

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

Damage	Repair Way
Engine Oil Leak	Repair
Expansion Bottle Defective	Repair
Bonnet stay and shocks Damaged	Replace
Switch Electrical Window Winder front left Defective	Replace
Switch Electrical Window Winder front right Defective	Replace
Hazard Lights Defective	Replace
Park Light Front Left Defective	Replace
Headlight Left Defective	Replace
Headlight Right Defective	Replace
Number Plate Front Missing	Replace
Number Plate Rear Missing	Replace
Front Bumper Residual Traces of Repair	Repair
Bonnet Residual Traces of Repair	Repair
Rear Fender Right Paintwork • Scratched	Repair
Door Front Left Residual Traces of Repair	Repair
Door Front Right Paintwork • Scratched	Repair
Door Rear Left Residual Traces of Repair	Repair
Door Rear Right Paintwork • Scratched	Repair
Boot Lid / Hatch door Paintwork • Scratched	Repair
Rear bumper Paintwork • Scratched	Repair
Control Arm Bush(es) Front Axle Right Cracked	Replace
Rim Front Left Scratched	Repair
Rim Front Right Scratched	Repair
Sub Frame Dented	Repair
Belly plates Damaged	Repair
CV Joint(s) Boot(s) Front Right (inner/outer) Damaged	Replace
Engine Noise Excessive	Repair
Air Conditioner Insufficient	Replace
Interior	Vehicle interior dirty and some panels scratched

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WVWZZZAUZEW271412

1 / 13



CONDITION REPORT

Report No: 2016337113

DATE
11/04/2024

Damage	Repair Way
Body and Exterior	Dents and scratches on some body panels
Body and Exterior	Stone chips and spray work on some body panels
Body and Exterior	Some body panels misaligned
Tyres and rims	Spare wheel missing
Engine	Engine bay dirty
Body and Exterior	Residual traces of repair on some body panels
Tyres and rims	Rear left and right tyre sizes different
Warning lights illuminated on dashboard	Repair
Electrical instruments and components	Vehicle electronics malfunctioning
Vehicle	Vehicle license has no license disc

Brakes

Brake Test Results

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s ²]
Front	3.84	3.7	-	
Rear	2.45	2.76	-	
Emergency / Parking	1.67	2.27	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	225/40 R18	92W	Dunlop	Sp-Sport	V	1321	3 mm
Front Right	225/40 R18	92W	Dunlop	Sp-Sport	V	1321	4 mm
Rear Left	225/40 R18	92Y	Continental	ContiSport	V	0520	2 mm
Rear Right	T125/70 R18	99M	Continental	Temporary	V	0114	3 mm

* Tyre Legend: V=Virgin, R=Recap

Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

No	System	Code	Description	Status
1	01- ENGINE CONTROL MODULE 1	P0E7B00	COOLANT BYPASS VALVE'B'CONTROL CIRCUIT/OPEN	

Inspection Conditions

No Test Drive
Battery Flat
Engine number – not possible to verify engine number (not visible without dismantling)
Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS. FOREIGN SUBSTANCE IN EXPANSION BOTTLE.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Sibusiso Mokase

This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

VIN: W001774U261637113

2 / 13

DATE

11/04/2024

Item	Value	Unit	Limit	Result
Front Left	1.2	mm	1.5	OK
Front Right	1.1	mm	1.5	OK
Rear Left	1.3	mm	1.5	OK
Rear Right	1.4	mm	1.5	OK

Brake and shock absorber report

System	Component	Value	Unit	Limit	Result
Engine	Oil Pressure	4.5	bar	3.5	OK
Engine	Water Temp	90	°C	105	OK
Engine	Oil Temp	100	°C	115	OK
Engine	Oil Level	4.5	l	4.5	OK
Engine	Oil Quality	4.5	l	4.5	OK
Engine	Oil Color	4.5	l	4.5	OK
Engine	Oil Smell	4.5	l	4.5	OK
Engine	Oil Sound	4.5	l	4.5	OK
Engine	Oil Vibration	4.5	l	4.5	OK
Engine	Oil Pressure	4.5	bar	3.5	OK
Engine	Water Temp	90	°C	105	OK
Engine	Oil Temp	100	°C	115	OK
Engine	Oil Level	4.5	l	4.5	OK
Engine	Oil Quality	4.5	l	4.5	OK
Engine	Oil Color	4.5	l	4.5	OK
Engine	Oil Smell	4.5	l	4.5	OK
Engine	Oil Sound	4.5	l	4.5	OK
Engine	Oil Vibration	4.5	l	4.5	OK

Diagnostic report page 1

System	Component	Value	Unit	Limit	Result
Engine	Oil Pressure	4.5	bar	3.5	OK
Engine	Water Temp	90	°C	105	OK
Engine	Oil Temp	100	°C	115	OK
Engine	Oil Level	4.5	l	4.5	OK
Engine	Oil Quality	4.5	l	4.5	OK
Engine	Oil Color	4.5	l	4.5	OK
Engine	Oil Smell	4.5	l	4.5	OK
Engine	Oil Sound	4.5	l	4.5	OK
Engine	Oil Vibration	4.5	l	4.5	OK
Engine	Oil Pressure	4.5	bar	3.5	OK
Engine	Water Temp	90	°C	105	OK
Engine	Oil Temp	100	°C	115	OK
Engine	Oil Level	4.5	l	4.5	OK
Engine	Oil Quality	4.5	l	4.5	OK
Engine	Oil Color	4.5	l	4.5	OK
Engine	Oil Smell	4.5	l	4.5	OK
Engine	Oil Sound	4.5	l	4.5	OK
Engine	Oil Vibration	4.5	l	4.5	OK

Diagnostic report page 2

System	Component	Value	Unit	Limit	Result
Engine	Oil Pressure	4.5	bar	3.5	OK
Engine	Water Temp	90	°C	105	OK
Engine	Oil Temp	100	°C	115	OK
Engine	Oil Level	4.5	l	4.5	OK
Engine	Oil Quality	4.5	l	4.5	OK
Engine	Oil Color	4.5	l	4.5	OK
Engine	Oil Smell	4.5	l	4.5	OK
Engine	Oil Sound	4.5	l	4.5	OK
Engine	Oil Vibration	4.5	l	4.5	OK
Engine	Oil Pressure	4.5	bar	3.5	OK
Engine	Water Temp	90	°C	105	OK
Engine	Oil Temp	100	°C	115	OK
Engine	Oil Level	4.5	l	4.5	OK
Engine	Oil Quality	4.5	l	4.5	OK
Engine	Oil Color	4.5	l	4.5	OK
Engine	Oil Smell	4.5	l	4.5	OK
Engine	Oil Sound	4.5	l	4.5	OK
Engine	Oil Vibration	4.5	l	4.5	OK

Diagnostic report page 3

System	Component	Value	Unit	Limit	Result
Engine	Oil Pressure	4.5	bar	3.5	OK
Engine	Water Temp	90	°C	105	OK
Engine	Oil Temp	100	°C	115	OK
Engine	Oil Level	4.5	l	4.5	OK
Engine	Oil Quality	4.5	l	4.5	OK
Engine	Oil Color	4.5	l	4.5	OK
Engine	Oil Smell	4.5	l	4.5	OK
Engine	Oil Sound	4.5	l	4.5	OK
Engine	Oil Vibration	4.5	l	4.5	OK
Engine	Oil Pressure	4.5	bar	3.5	OK
Engine	Water Temp	90	°C	105	OK
Engine	Oil Temp	100	°C	115	OK
Engine	Oil Level	4.5	l	4.5	OK
Engine	Oil Quality	4.5	l	4.5	OK
Engine	Oil Color	4.5	l	4.5	OK
Engine	Oil Smell	4.5	l	4.5	OK
Engine	Oil Sound	4.5	l	4.5	OK
Engine	Oil Vibration	4.5	l	4.5	OK

Diagnostic report page 4

System	Component	Value	Unit	Limit	Result
Engine	Oil Pressure	4.5	bar	3.5	OK
Engine	Water Temp	90	°C	105	OK
Engine	Oil Temp	100	°C	115	OK
Engine	Oil Level	4.5	l	4.5	OK
Engine	Oil Quality	4.5	l	4.5	OK
Engine	Oil Color	4.5	l	4.5	OK
Engine	Oil Smell	4.5	l	4.5	OK
Engine	Oil Sound	4.5	l	4.5	OK
Engine	Oil Vibration	4.5	l	4.5	OK
Engine	Oil Pressure	4.5	bar	3.5	OK
Engine	Water Temp	90	°C	105	OK
Engine	Oil Temp	100	°C	115	OK
Engine	Oil Level	4.5	l	4.5	OK
Engine	Oil Quality	4.5	l	4.5	OK
Engine	Oil Color	4.5	l	4.5	OK
Engine	Oil Smell	4.5	l	4.5	OK
Engine	Oil Sound	4.5	l	4.5	OK
Engine	Oil Vibration	4.5	l	4.5	OK

Diagnostic report page 5

**CONDITION REPORT****Report No: 2016337113**

VIN: WVVZZZAUZEW271412

DATE

11/04/2024

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016337113

DATE
11/04/2024
VIN: WVVZZAU11024
4/13



FRONT RIGHT CORNER



REAR LEFT CORNER



INTERIOR (FRONT DRIVER DOOR)



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER



Automatic transmission

**CONDITION REPORT****Report No: 2016337113****DATE**
11/04/2024

VIN: WVVZZZAUZEW271412

5 / 13

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016337113

DATE
11/04/2024

VIN: WVGZZZAUZEW271412

6 / 13



90 DEGREE FRONT



90 DEGREE RIGHT



90 DEGREE REAR



90 DEGREE LEFT



LF TYRE TREAD



LR TYRE TREAD



CONDITION REPORT

Report No: 2016337113

DATE
11/04/2024

VIN: WWZZZAUZEW271412
7 / 13

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016337113

DATE
11/04/2024

RR TYRE TREAD



RF TYRE TREAD



Spare wheel Accessories



LICENSE DISC



VIN PLATE OR STICKER



ENGINE 1



CONDITION REPORT

Report No: 2016337113

DATE
11/04/2024

VIN: WVVZZZAUZEW271412
9 / 13

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016337113

DATE
11/04/2024

Front chassis



Rear chassis



Oil cap and dipstick



Bonnet stay and shocks



Number Plate Front



Front Bumper

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016337113

DATE
11/04/2024

VIN: WWWZZZAUZEW271412

11 / 13

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT


Report No: 2016337113

DATE
11/04/2024

Front Bumper



Bonnet

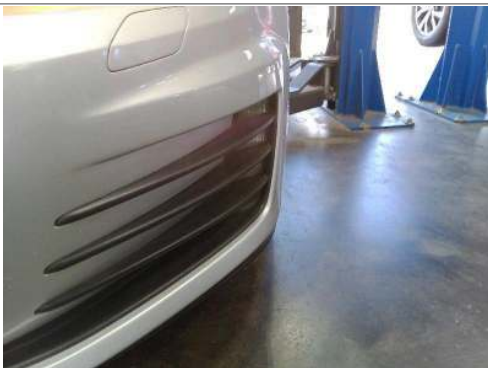VIN: WVGZZZ9ZEW271412
12 / 13

Park Light Front Left



Air Conditioner



Boot Lid / Hatch door



Boot Lid / Hatch door



CONDITION REPORT

Report No: 2016337113

DATE
11/04/2024

VIN: WVVZZZAUZEW271412

13 / 13

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016337113

DATE
11/04/2024

Rear bumper



Rear bumper



Engine



Rim Front Right



Control Arm Bush(es) Front Axle Right



Door Front Right



CONDITION REPORT

Report No: 2016337113

DATE
11/04/2024

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016337113

DATE
11/04/2024

Door Rear Right




Rear Fender Right



Number Plate Rear



Door Rear Left

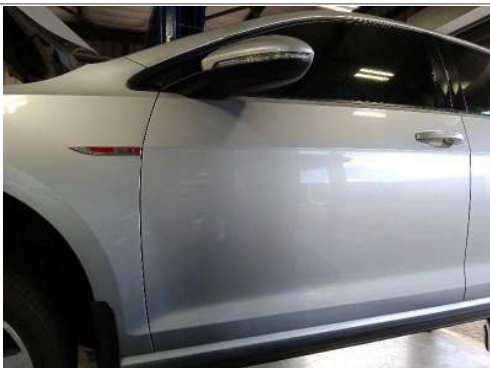

Door Front Left



Rim Front Left



CONDITION REPORT

Report No: 2016337113

DATE
11/04/2024

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016337113

DATE
11/04/2024

Headlight Left



Headlight Right



CV Joint(s) Boot(s) Front Right (inner/outer)



Belly plates



Sub Frame



Expansion Bottle



CONDITION REPORT

Report No: 2016337113

DATE
11/04/2024

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016337113

DATE
11/04/2024

Water level



Switch Electrical Window Winder front left



Switch Electrical Window Winder front right



Hazard Lights

**CONDITION REPORT****Report No: 2016337113****DATE**
11/04/2024

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za