



CONDITION REPORT

Report No: 2016220515

DATE
08/01/2024

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572

**Assignment**


Client	MFC Auction House	Inspection Location	MFC
Requested Date	08/01/2024		M57 Pretoria Road - 1619
Inspection Date	08/01/2024		Kempton Park - GT

Vehicle Data


Vehicle Type	PASSENGER VEHICLE	Registered Owner	MFC
Manufacturer	VOLKSWAGEN	Registration Number	NDE22350
Model	GOLF	Register Number	
VIN	WVWZZZAUZHW188096	Date Of First Licensing	
Engine Number		Last COR	
Doors	5	License Expiry Date	30/09/2023
Color	RED	Power / Displacement	
Year Model		Paint Finish	M - METALLIC
Km Reading	136,724 KM	Fuel	PETROL
Cab / Body Type	HATCHBACK	Transmission	AUTOMATIC

Vehicle Options & Accessories**Items**

VEHICLE INSPECTION

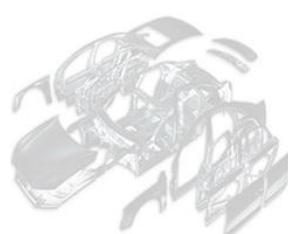

Damage	Repair Way
Switch Electrical Window Winder rear right Damaged	Repair
Windscreen Wiper Worn	Replace
Seat Front Right Torn / Cut	Repair
Front Fender Right Damaged	Repair
Rear Fender Left Paintwork • Flaking	Repair
Rear Fender Right Paintwork • Scratched	Repair
Door Rear Left Paintwork • Scratched	Repair
Rear bumper Paintwork • Flaking	Repair
Tyre Front Right Damaged	Replace

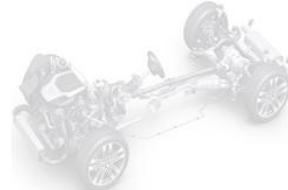



CONDITION REPORT

Report No: 2016220515

DATE
08/01/2024

Brakes

Brake Test Results

	Left	Right		
	Braking Force [kN]	Braking Force [kN]	Axle Weight [kg]	Deceleration [m/s ²]
Front	3.0	3.5	-	
Rear	2.3	2.3	-	
Emergency / Parking	1.4	1.1	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	225/45R17	94W	Hilo	Green plus	V	0119	1 mm
Front Right	225/45R17	94W	Goodyear	Goodyear	V	0921	5 mm
Rear Left	225/45R17	94W	Goodyear	Goodyear	V	0000	6 mm
Rear Right	225/45R17	94W	Goodyear	Goodyear	V	0821	5 mm
Spare	205/50R17	93W	Tracmak	Radial	V	////	1 mm

* Tyre Legend: V=Virgin, R=Recap

Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

No	System	Code	Description	Status
1	ENGINE CONTROL MODULE	P305400	STARTER DOES NOT TURN MECHANICALLY BLOCKED OR ELE	

Inspection Conditions

No Test Drive

Battery Flat

Engine number – not possible to verify engine number (not visible without dismantling)

Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS.

Engine Compartment: Bottom of engine is fully covered.

Body • Exterior: Minor dents scratches and stone chips on some body panels. Signs of spray work done on some body panels.

Axle and Suspension: Both front control arm bushes covered

Undercarriage: Bottom of undercarriage is covered

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Trevino Julius

This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.



CONDITION REPORT


VIN: WAWZZZKU2Y62200515

Report No: 20162200515


2 / 9

DATE

08/01/2024

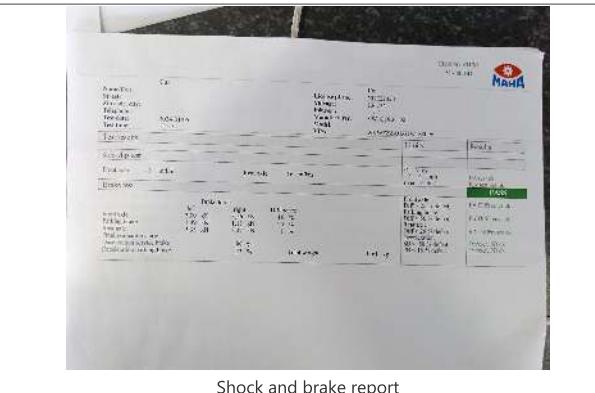

Shock and brake report

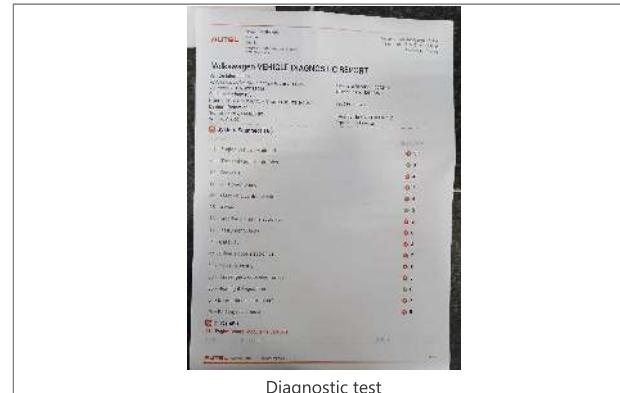

Diagnostic test



Diagnostic test



Diagnostic test



Diagnostic test



Diagnostic test

**CONDITION REPORT****Report No:** 2016220515

VIN: WVWZZZAUZHW188096

DATE

08/01/2024

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016220515

DATE

VIN: WVWZZZAU7J8Y0192024

4 / 9



FRONT RIGHT CORNER



REAR LEFT CORNER



INTERIOR (FRONT DRIVER DOOR)



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER



90 DEGREE FRONT



CONDITION REPORT

Report No: 2016220515

DATE
08/01/2024

VIN: WVWZZZAUZHW188096

5 / 9

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016220515

DATE
08/01/2024

VIN: VVWZZZAUZHW188096

6 / 9



90 DEGREE RIGHT



90 DEGREE REAR



90 DEGREE LEFT



LF TYRE TREAD



LR TYRE TREAD



RR TYRE TREAD



CONDITION REPORT

Report No: 2016220515

DATE
08/01/2024

VIN: WVWZZZAUZHW188096

7 / 9



CONDITION REPORT

Report No: 2016220515

DATE
08/01/2024

RF TYRE TREAD



Sparewheel

V/WVWZZZAUZHW188096
8 / 9

LICENSE DISC



VIN PLATE OR STICKER



ENGINE 1



ENGINE 2



CONDITION REPORT

Report No: 2016220515

DATE
08/01/2024

VIN: WVWZZZAUZHW188096

9 / 9



CONDITION REPORT

Report No: 2016220515

DATE
08/01/2024

CHASSIS



Rear end



Automatic



Expansion bottle



Oil cap and dipstick



Windscreen Wiper



CONDITION REPORT

Report No: 2016220515

DATE
08/01/2024

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016220515

DATE
08/01/2024

Water level



Front Fender Right



Tyre Front Right



Rear Fender Left



Door Rear Left



Rear bumper



CONDITION REPORT

Report No: 2016220515

DATE
08/01/2024

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016220515

DATE
08/01/2024

Rear bumper



Rear Fender Right



Seat Front Right



Switch Electrical Window Winder rear right

**CONDITION REPORT**

Report No: 2016220515

DATE
08/01/2024

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za