



CONDITION REPORT

Report No: 2016204986

DATE
18/12/2023

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572

**Assignment**

| | | | |
|-----------------|-------------------|---------------------|--------------------------|
| Client | MFC Auction House | Inspection Location | MFC |
| Requested Date | 18/12/2023 | | M57 Pretoria Road - 1619 |
| Inspection Date | 18/12/2023 | | Kempton Park - GT |

Vehicle Data

| | | | |
|-----------------|-------------------|-------------------------|--------------|
| Vehicle Type | PASSENGER VEHICLE | Registered Owner | MFC |
| Manufacturer | VOLKSWAGEN | Registration Number | HK41BWGP |
| Model | GOLF | Register Number | |
| VIN | WVWZZZAUZJW169283 | Date Of First Licensing | |
| Engine Number | | Last COR | |
| Doors | 5 | License Expiry Date | 30/09/2023 |
| Color | BLUE | Power / Displacement | |
| Year Model | | Paint Finish | M - METALLIC |
| Km Reading | 208,004 KM | Fuel | PETROL |
| Cab / Body Type | HATCHBACK | Transmission | MANUAL |

Vehicle Options & Accessories**Items**

VEHICLE INSPECTION



| Damage | Repair Way |
|--|------------|
| Engine Oil Leak | Repair |
| Dim Light Right Defective | Repair |
| Number Plate Light Right Defective | Repair |
| Spare Tyre Smooth | Replace |
| Tyre pressure warning light illuminated. | Repair. |
| Engine warning light illuminated. | Repair. |



CONDITION REPORT

Report No: 2016204986

DATE
18/12/2023**Brakes****Brake Test Results**

| | Left | Right | Axle Weight [KG] | Deceleration [m/s ²] |
|---------------------|--------------------|--------------------|------------------|----------------------------------|
| | Braking Force [kN] | Braking Force [kN] | | |
| Front | 2.9 | 2.7 | - | |
| Rear | 2.2 | 1.8 | - | |
| Emergency / Parking | 1.5 | 1.1 | - | |

Tyres and Rims**Tyre Specification & Measurement**

| | Size | Load/Speed Index | Manufacture | Model | Type* | Production Date | Tread Depth (mm) |
|-------------|-----------|------------------|-------------|---------|-------|-----------------|------------------|
| Front Left | 205/55R16 | 91V | GT radial | Champro | V | 1221 | 2 mm |
| Front Right | 205/55R16 | 91V | GT radial | Champro | V | 1221 | 3 mm |
| Rear Left | 205/55R16 | 91V | Sumitomo | BC100 | V | 1223 | 7 mm |
| Rear Right | 205/55R16 | 91V | Sumitomo | BC100 | | 3722 | 7 mm |
| Spare | 205/55R15 | 91V | Continental | Contact | V | ////// | 0 mm |

* Tyre Legend: V=Virgin, R=Recap

Diagnostic

During the diagnostic no active error messages were detected. (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

Inspection Conditions

No Test Drive
 Rain at time of inspection
 Battery Flat
 Engine number – not possible to verify engine number (not visible without dismantling)
 Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS.
 Engine Compartment: Bottom of engine is fully covered.
 Body • Exterior: Minor dents scratches and stone chips on some body panels. Signs of spray work done on some body panels.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Trevino Julius

This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.



CONDITION REPORT

VIN: MMWZ7AUU10000886

Report No: 20Y6204986

2 / 8

DATE

18/12/2023




Shock and brake report



Diagnostic test



Diagnostic test

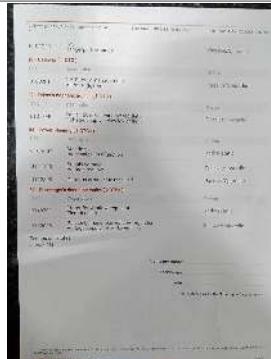

Diagnostic test



FRONT RIGHT CORNER



REAR LEFT CORNER



CONDITION REPORT

Report No: 2016204986

VIN: VVVZZZAUZJW169283

DATE

18/12/2023

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016204986

DATE

VIN: WVWZZAU78M129203

4 / 8



INTERIOR (FRONT DRIVER DOOR)



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER



90 DEGREE FRONT



90 DEGREE RIGHT



90 DEGREE REAR



CONDITION REPORT

Report No: 2016204986

DATE
18/12/2023

VIN: WWWZZZAUZJW169283

5 / 8

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016204986

DATE
18/12/2023

VIN: WVWZZAUZJW169283

6 / 8



90 DEGREE LEFT



LF TYRE TREAD



LR TYRE TREAD



RR TYRE TREAD



RF TYRE TREAD



Sparewheel



CONDITION REPORT

Report No: 2016204986

DATE
18/12/2023


VIN: VVWZZZAUZJW169283

7 / 8



CONDITION REPORT

Report No: 2016204986

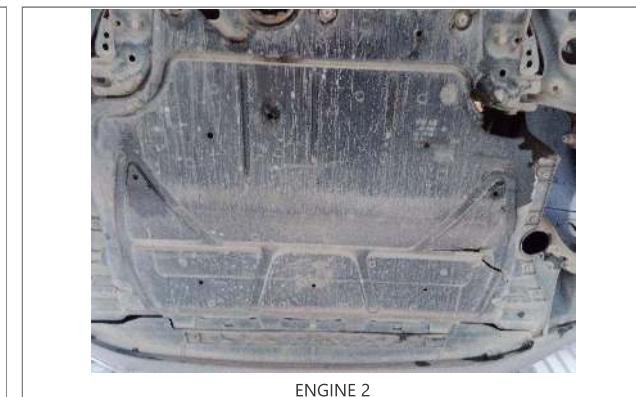DATE
18/12/2023



CONDITION REPORT

Report No: 2016204986

DATE
18/12/2023



CONDITION REPORT

Report No: 2016204986

DATE
18/12/2023

Oil cap and dipstick



Engine warning light illuminat



Expansion bottle



Manual



Tyre pressure warning light il



Spare Tyre



CONDITION REPORT

Report No: 2016204986

DATE
18/12/2023



CONDITION REPORT

Report No: 2016204986

DATE
18/12/2023

Water level



Engine



Number Plate Light Right



Dim Light Right



CONDITION REPORT

Report No: 2016204986

DATE
18/12/2023

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za