DEKRA

CONDITION REPORT

Report No:
2017257542
DATE
19/06/2026

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572







Assignment

Client	**MFC Auction House**	Inspection Location	**MFC** **M57 Pretoria Road - 1619** **Kempton Park -**
Requested Date	**19/06/2026**		
Inspection Date	**19/06/2026**		

Vehicle Data

Vehicle Type	**MINI BUS**	Registered Owner	**MFC**
Manufacturer	**TOYOTA**	Registration Number	**LH82KWGP**
Model	**HI-ACE 2.7 SESFIKILE 16-S MINIBUS [2021-2024]**	Register Number	
		Date Of First Licensing	
VIN	**AHTSX22P507112006**	Last COR	
Engine Number		License Expiry Date	**31/07/2026**
Doors	**4**	Power / Displacement	
Color	**WHITE**	Paint Finish	**C - COMMON**
Year Model	**2023**	Fuel	**PETROL**
Km Reading	**244,872 KM**	Transmission	**MANUAL**
Cab / Body Type	**OTHERS**		

Vehicle Options & Accessories

Items

VEHICLE INSPECTION


DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AHTSX22P507112006

DEKRA

CONDITION REPORT

Report No:
2017257542
DATE
19/06/2026

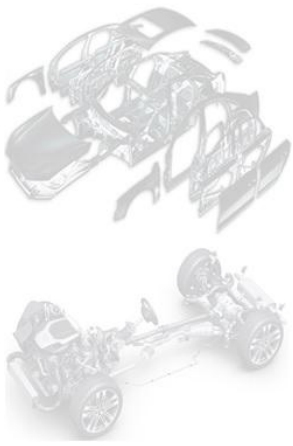

Damage	Repair Way
Engine Wiring Defective	Repair
Seat Front Right Torn / Cut	Repair
Seat Rear Torn / Cut	Repair
Seat Rear (2. Row) Torn / Cut	Repair
Rear Fender Right Dented	Repair
Door Front Right Dented	Repair
Boot Lid / Hatch door Dented	Repair
Rear bumper Deformed	Repair
Sliding Door Dented	Repair
Tyre Rear Left Smooth	Replace
Bolt(s) / Nut(s) Front Wheel Right Missing	Replace
Engine Performance Idling / Hunting	Repair
Warning lights illuminated	Repair
Boot does not open	Repair

Brakes

Brake Test Results

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s²]
Front	4.9	5.1	-	
Rear	1.9	2.1	-	
Emergency / Parking	1.7	2.5	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	205/75R14	109/107S	Yokohama	Steel	V	4425	5 mm
Front Right	205/75R14	109/107S	Yokohama	Steel	V	4425	5 mm
Rear Left	195R15	106/104R	Powertac	Vanmarch	V	1426	0 mm
Rear Right	195R15	106/104S	Bridgestone	Steel	V	3722	2 mm

* Tyre Legend: V=Virgin, R=Recap

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AHTSX22P507112006

DEKRA

CONDITION REPORT

Report No:
2017257542
DATE
19/06/2026

Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

No	System	Code	Description	Status
1	ENGINE AND ECT	P0113	INTAKE AIR TEMPERATURE CIRCUIT INPUT HIGH	

Inspection Conditions

No Test Drive
Battery Flat
Engine number – not possible to verify engine number (not visible without dismantling)
Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS.Body • Exterior: Signs of spray work done on body panels.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Trevino Julius

This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.


DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AHTSX22P507112006


DEKRA

CONDITION REPORT


Report No:
2017257542
DATE
19/06/2026

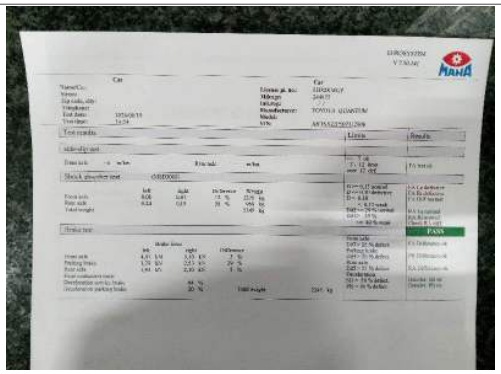

Shock and brake report

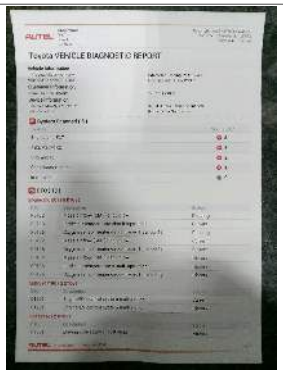

Diagnostic test

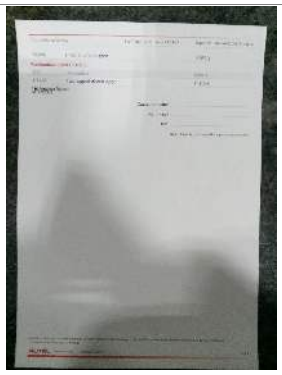

Diagnostic test



FRONT RIGHT CORNER



REAR LEFT CORNER



INTERIOR (FRONT DRIVER DOOR)

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AHTSX22P507112006

DEKRA

CONDITION REPORT


Report No:
2017257542
DATE
19/06/2026



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER

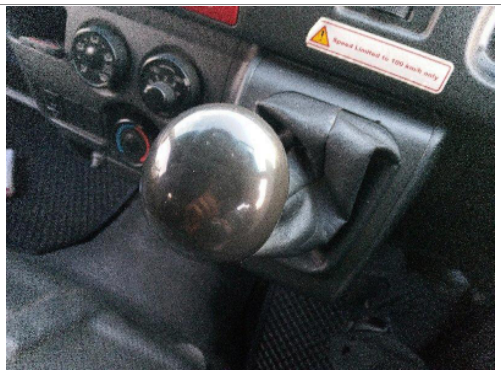

Manual



90 DEGREE FRONT



90 DEGREE RIGHT



90 DEGREE REAR

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AHTSX22P507112006

DEKRA

CONDITION REPORT

Report No:
2017257542
DATE
19/06/2026



90 DEGREE LEFT



LF TYRE TREAD



LR TYRE TREAD



RR TYRE TREAD



RF TYRE TREAD



LICENSE DISC

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AHTSX22P507112006

DEKRA

CONDITION REPORT

Report No:
2017257542
DATE
19/06/2026




VIN PLATE OR STICKER


ENGINE 1


ENGINE 2


CHASSIS

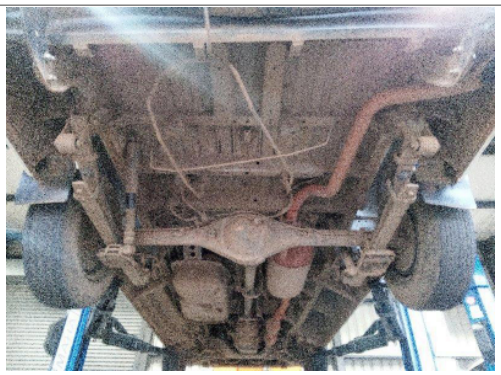
REAR


Oil cap and dipstick

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AHTSX22P507112006

DEKRA

CONDITION REPORT

Report No:
2017257542
DATE
19/06/2026



Expansion bottle



Warning lights illuminated



No sparewheel



Seat Front Right



Water level



Seat Rear

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AHTSX22P507112006

DEKRA

CONDITION REPORT

Report No:
2017257542
DATE
19/06/2026



Seat Rear



Seat Rear



Seat Rear (2. Row)



Door Front Right



Rear Fender Right



Boot Lid / Hatch door

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AHTSX22P507112006

DEKRA

CONDITION REPORT

Report No:
2017257542
DATE
19/06/2026




Rear bumper



Sliding Door



Bolt(s) / Nut(s) Front Wheel Right

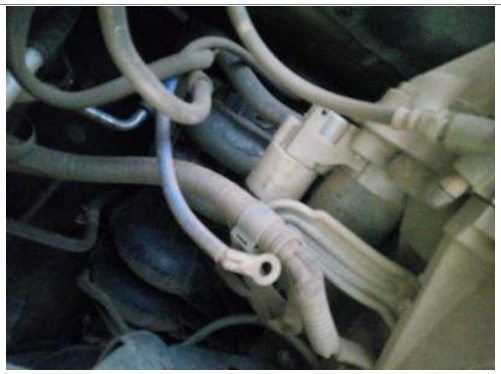

Engine Wiring



Tyre Rear Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AHTSX22P507112006