



## CONDITION REPORT

Report No: 2016442290

DATE  
04/07/2024

MFC Auction House  
M57 Pretoria Rd, Glenmarais, KEMPTON PARK  
Gauteng

DEKRA MFC  
M57 Pretoria Rd - 1619  
KEMPTON PARK - GT  
08610 33572



## Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	04/07/2024		M57 Pretoria Road - 1619
Inspection Date	04/07/2024		Kempton Park - GT

## Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	MFC AUCTION HOUSE
Manufacturer	VOLKSWAGEN	Registration Number	NP72991
Model	POLO	Register Number	
VIN	AAVZZZ6RZDU031748	Date Of First Licensing	
Engine Number		Last COR	
Doors	5	License Expiry Date	04/07/2024
Color	RED	Power / Displacement	
Year Model		Paint Finish	TWO COAT METALLIC
Km Reading	255,693 KM	Fuel	PETROL
Cab / Body Type	HATCHBACK	Transmission	MANUAL

## Vehicle Options &amp; Accessories

## Items

## VEHICLE INSPECTION

Damage	Repair Way
Engine Oil Leak	Replace
Central Air Vent Damaged	Replace
Radio/CD/USB Missing	Replace
Engine Management Lights Set	Replace
Headlight Left Damaged	Replace
Headlight Right Damaged	Replace
Seat Front Right Damaged	Repair
Seat Rear Damaged	Repair
Front Bumper Damaged	Repair
Bonnet Damaged	Repair
Front Fender Left Damaged	Repair
Front Fender Right Damaged	Repair
Rear Fender Left Damaged	Repair
Rear Fender Right Damaged	Repair
Door Front Left Damaged	Repair
Door Rear Left Damaged	Repair
Rear bumper Damaged	Repair
Roof Damaged	Repair
Tie Rod End left Worn	Replace
Wheel bearing Rear Right Excessive Wear & Tear	Replace
Tyre Front Right Worn	Replace
Gearbox Oil Leak	Replace
Radiator Cradle Damaged	Replace
Steering Insufficient	Repair
Engine	Battery loose
interior	ignition damage starter button fitted to vehicle
interior	vehicle interior in poor condition
interior	some interior panels missing
Body and exterior	Signs of stone chips to some body panels.

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za

VIN: AAVZZZ6RZDU031748

1 / 12



## CONDITION REPORT

Report No: 2016442290

DATE  
04/07/2024

Damage	Repair Way
Body and exterior	Signs of repair work done to somebody panels.
Body and exterior	Poor alignment to somebody panels.
Body and exterior	Repair work done to vehicle below standard.
Body and exterior	Vehicle body in poor condition.
Body and exterior	Signs of impact damage to front of vehicle
axle and suspension	excessive noise from front and rear suspension

### Brakes

#### Brake Test Results

	Left	Right	Axle Weight [KG]	Deceleration [m/s <sup>2</sup> ]
	Braking Force [KN]	Braking Force [KN]		
Front	2.51	2.58	-	
Rear	1.54	1.47	-	
Emergency / Parking	0.33	1.23	-	

### Tyres and Rims

#### Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	185/60R15	84H	Maxtrek	Radial	V	1622	2 mm
Front Right	185/60R15	84H	Hilo	Radial	V	1921	0 mm
Rear Left	195/60R15	88H	Continental	Contieco	V	2803	2 mm
Rear Right	185/60R15	84H	Hilo	Radial	V	3822	3 mm

\* Tyre Legend: V=Virgin, R=Recap

### Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

No	System	Code	Description	Status
1	GATEWAY	01304:004	RADIO- NO SIGNAL/ COMMUNICATION	

### Inspection Conditions

No Test Drive  
 Battery Flat  
 Engine number – not possible to verify engine number (not visible without dismantling)  
 Inspection conditions for the vehicle inspection were sufficient

### Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS.

### Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

### Technician

Werner Laubscher

This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

DEKRA Automotive (PTY) Ltd.  
 97 Willem Cruywagen Ave  
 Klerksoord, Pretoria, 0200  
 Phone: 012 542 4867  
 www.dekraauto.co.za




CONDITION REPORT

VIN: AAV7776RZDU031748  
Report No: 201642290


2 / 12

DATE


04/07/2024

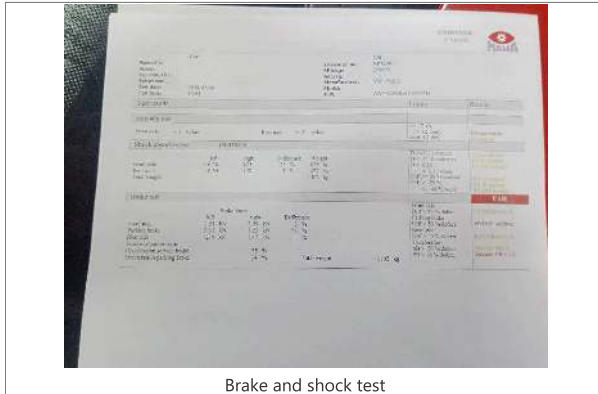

Brake and shock test

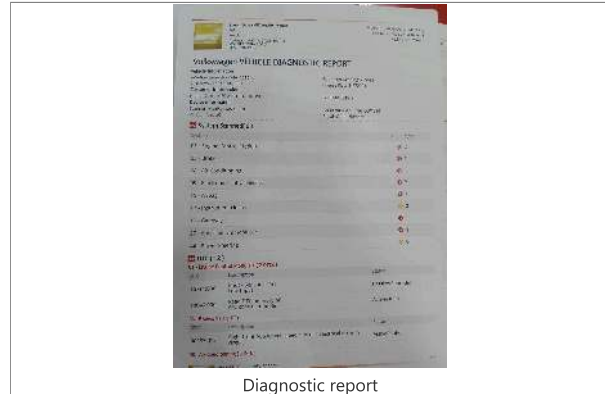


Diagnostic report

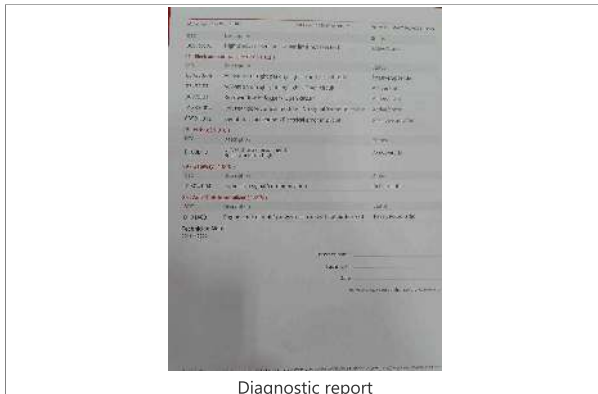

Diagnostic report



FRONT RIGHT CORNER

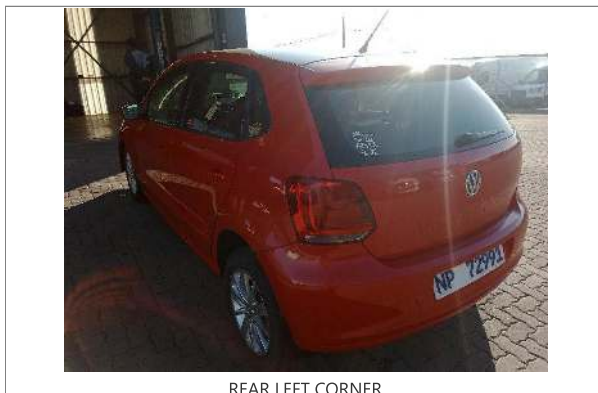

REAR LEFT CORNER



INTERIOR (FRONT DRIVER DOOR)

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za



**CONDITION REPORT**

**Report No: 2016442290**  
VIN: AAVZZZ6RZDU031748  
DATE  
**04/07/2024**

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016442290

DATE: 04/07/2024  
VIN: AAVZZZ6RZDU031748  
4/12



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER



Manual



90 DEGREE FRONT



90 DEGREE RIGHT



90 DEGREE REAR

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016442290

DATE

04/07/2024

VIN: AAVZZZ6RZDU031748

5 / 12

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016442290

DATE  
04/07/2024

VIN: AAVZZZ6RZDU031748

6 / 12



90 DEGREE LEFT




LF TYRE TREAD



LR TYRE TREAD



RR TYRE TREAD

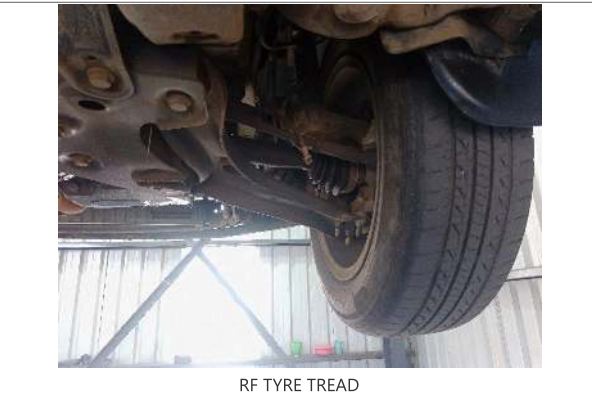

RF TYRE TREAD



NO LICENSE DISC

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016442290

DATE  
04/07/2024

VIN: AAVZZZ6RZDU031748

7 / 12

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za



VIN PLATE OR STICKER



ENGINE 1



ADDITIONAL 4



ADDITIONAL 5



ADDITIONAL 10



Water level



CONDITION REPORT

Report No: 2016442290

DATE  
04/07/2024

VIN: AAVZZZ6RZDU031748

9 / 12

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016442290


DATE  
04/07/2024



Headlight Left



Headlight Right

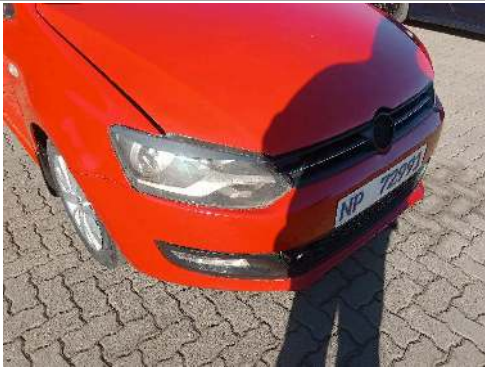

Front Bumper



Front Bumper



Bonnet



Front Fender Left

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016442290

DATE  
04/07/2024

VIN: AAVZZZ6RZDU031748

11 / 12

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016442290

DATE  
04/07/2024



Door Front Left



Door Rear Left

VIN: AAVZZZ6RZDU031748  
12 / 12



Rear bumper



Rear bumper



Front Fender Right



Rear Fender Right

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016442290

DATE  
04/07/2024

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016442290


DATE  
04/07/2024




Rear Fender Left



Roof

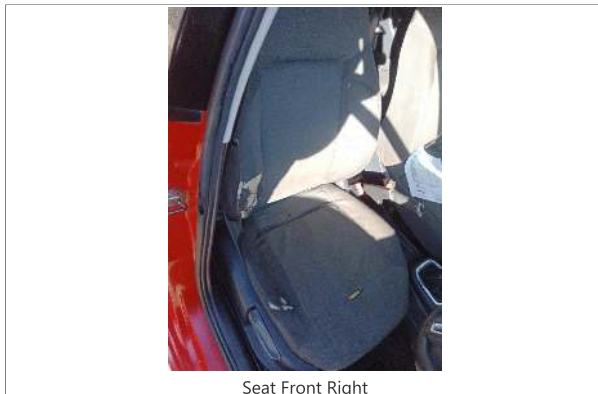

Seat Front Right

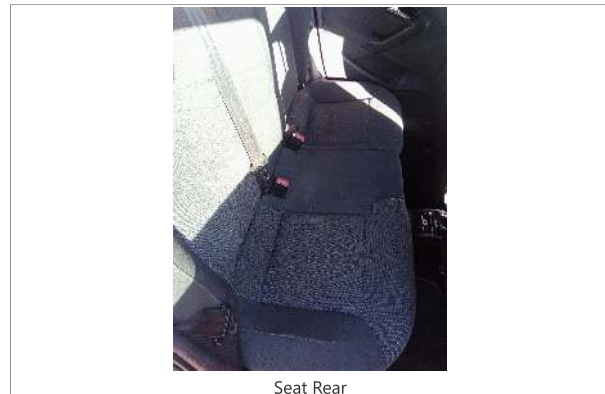

Seat Rear



Engine Management Lights



Radio/CD/USB

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016442290

DATE  
04/07/2024

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016442290

DATE  
04/07/2024



Central Air Vent




Wheel bearing Rear Right



Engine



Gearbox

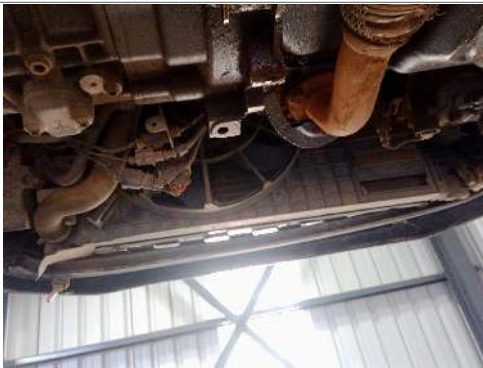

Radiator Cradle



Front Bumper

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016442290

DATE  
04/07/2024

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016442290

DATE  
04/07/2024



Tyre Front Right



Tie Rod End left

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za



**CONDITION REPORT**

**Report No: 2016442290**

**DATE**  
**04/07/2024**

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za