



CONDITION REPORT

Report No: 2016222268

DATE
09/01/2024

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	09/01/2024		M57 Pretoria Road - 1619
Inspection Date	09/01/2024		Kempton Park - GT

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	MFC
Manufacturer	VOLKSWAGEN	Registration Number	KPY432MP
Model	CROSS POLO	Register Number	
VIN	AAVZZZ6RZFU039856	Date Of First Licensing	
Engine Number		Last COR	
Doors	5	License Expiry Date	31/07/2024
Color	RED	Power / Displacement	
Year Model		Paint Finish	TWO COAT UNI
Km Reading	177,346 KM	Fuel	PETROL
Cab / Body Type	HATCHBACK	Transmission	MANUAL

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

Damage	Repair Way
Engine Oil Sweat	Repair
Center Console / Cubbyhole + Lid Damaged	Repair
Air Conditioner Insufficient	Replace
Tail Light Left Scratched	Repair
Headlight Left Defective	Repair
Headlight Right Defective	Repair
Seat Front Right Dirty	Repair
Seat Rear Defective	Repair
Hood Lining Dirty	Repair
Door Sealing Rubber Front Right Damaged	Replace
Parcel Tray Damaged	Replace
Front Bumper Damaged	Repair
Bonnet Paintwork • Scratched	Repair
Front Fender Left Paintwork • Scratched	Repair
Rear Fender Left Paintwork • Scratched	Repair
Door Front Left Paintwork • Scratched	Repair
Door Rear Left Paintwork • Scratched	Repair
Boot Lid / Hatch door Residual Traces of Repair	Repair
Rear bumper Paintwork • Scratched	Repair
Inner Boot Floor Pan and Spare Wheel Well Paintwork • Scratched	Repair
Sill Panel Left Paintwork • Scratched	Repair
Sill Panel Right Paintwork • Scratched	Repair
Windscreen Cracked	Replace
Control Arm Bush(es) Front Axle Left Cracked	Replace
Control Arm Bush(es) Front Axle Right Cracked	Replace
Rim Rear Right Dented	Repair
Belly plates Damaged	Replace
Fuel Lines Defective	Repair

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZZ6RZFU039856



CONDITION REPORT

Report No: 2016222268

DATE
09/01/2024

Damage	Repair Way
Tyre pressure warning light illuminated on dashboa	Repair
Key fob faulty	Repair

Brakes

Brake Test Results

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s²]
Front	2.63	2.78	-	
Rear	1.57	1.69	-	
Emergency / Parking	1.6	1.7	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	215/40Z R17	87W	Rapid	P609	V	3421	4 mm
Front Right	215/40Z R17	87W	Rapid	P609	V	3421	4 mm
Rear Left	215/40Z R17	87W	Rapid	P609	V	3421	5 mm
Rear Right	215/40Z R17	87W	Rapid	P609	V	3521	5 mm
Spare	185/60 R15	84H	Continental	Contipremuim	V	3814	6 mm

* Tyre Legend: V=Virgin, R=Recap

Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

No	System	Code	Description	Status
1	01-ENGINE CONTROL MODULE 1	P190D00	COOLANT PUMP FOR CHARGE PRESSURE COOLER MECHANICAL	

Inspection Conditions

No Test Drive
Rain at time of inspection
Battery Flat
Engine number – not possible to verify engine number (not visible without dismantling)
Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS.Engine Compartment: Engine bay dirty.Brake fluid level ok.Signs of rodent in engine bay.Computer box st

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Sibusiso Mokase

This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT


VIN: AA4Z7692714039856

Report No: 2016222268


2 / 13

DATE

09/01/2024

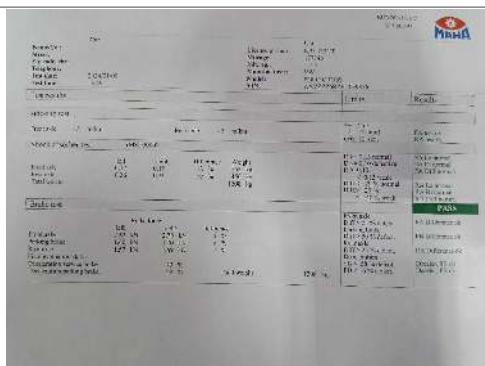


Brake and shock absorber report

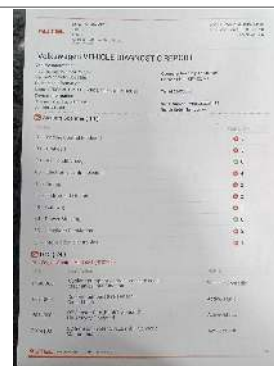

Diagnostic report page 1



Diagnostic report page 2

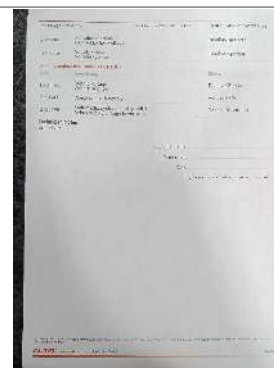

Diagnostic report page 3



FRONT RIGHT CORNER



REAR LEFT CORNER



CONDITION REPORT

Report No: 2016222268
VIN: AAVZZZ6RZFU039856
DATE 3/13
09/01/2024

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016222268

DATE
05/01/2024
VIN: AAVZZZ6R550019024
4 / 13



INTERIOR (FRONT DRIVER DOOR)



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER



90 DEGREE FRONT



90 DEGREE RIGHT



90 DEGREE REAR



CONDITION REPORT

Report No: 2016222268

DATE
09/01/2024

VIN: AAVZZZ6RZFU039856

5 / 13

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016222268

DATE
09/01/2024

VIN: AAVZZZ6RZFU039856

6 / 13



90 DEGREE LEFT



LF TYRE TREAD



LR TYRE TREAD



RR TYRE TREAD



RF TYRE TREAD



Spare wheel and Accessories



CONDITION REPORT

Report No: 2016222268

DATE
09/01/2024

VIN: AAVZZZ6RZFU039856
7 / 13

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016222268

DATE
09/01/2024



LICENSE DISC



VIN PLATE OR STICKER



ENGINE 1



Front chassis



Rear chassis



Oil cap and dipstick

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016222268

DATE
09/01/2024

VIN: AAVZZZ6RZFU039856
9 / 13

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016222268

DATE
09/01/2024

Manual Transmission



Seat Front Right



Seat Rear



Sill Panel Right



Sill Panel Right



Rear bumper

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016222268

DATE
09/01/2024

VIN: AAVZZZ6RZFU039856

11 / 13

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016222268

DATE
09/01/2024

Rear bumper



Tail Light Left



Boot Lid / Hatch door



Parcel Tray



Seat Rear



Inner Boot Floor Pan and Spare Wheel Well



CONDITION REPORT

Report No: 2016222268

DATE
09/01/2024

VIN: AAVZZZ6RZFU039856
13 / 13

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016222268

DATE
09/01/2024

Rear Fender Left



Door Rear Left



Door Front Left



Sill Panel Left



Sill Panel Left



Front Fender Left



CONDITION REPORT

Report No: 2016222268

DATE
09/01/2024

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016222268

DATE
09/01/2024

Front Bumper



Front Bumper



Bonnet



Windscreen



Air Conditioner



Engine



CONDITION REPORT

Report No: 2016222268

DATE
09/01/2024

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016222268

DATE
09/01/2024

Control Arm Bush(es) Front Axle Right



Control Arm Bush(es) Front Axle Left



Headlight Right



Headlight Left



Rim Rear Right



Fuel Lines



CONDITION REPORT

Report No: 2016222268

DATE
09/01/2024

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016222268

DATE
09/01/2024

Belly plates




Water level



Center Console / Cubbyhole + Lid



Hood Lining

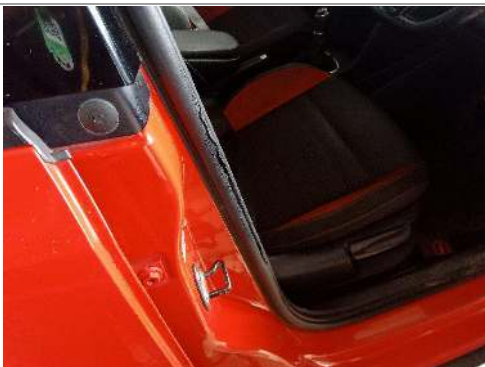

Door Sealing Rubber Front Right



CONDITION REPORT

Report No: 2016222268

DATE
09/01/2024

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za