



CONDITION REPORT

Report No: 2016210210

DATE
22/12/2023

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	22/12/2023		M57 Pretoria Road - 1619
Inspection Date	22/12/2023		Kempton Park - GT

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	MFC
Manufacturer	VOLKSWAGEN	Registration Number	JZL586NW
Model	POLO VIVO	Register Number	
VIN	AAVZZZ6RZJU015756	Date Of First Licensing	
Engine Number		Last COR	
Doors	5	License Expiry Date	31/10/2024
Color	RED	Power / Displacement	
Year Model		Paint Finish	C - COMMON
Km Reading	116,799 KM	Fuel	PETROL
Cab / Body Type	HATCHBACK	Transmission	MANUAL

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

Damage	Repair Way
Engine Oil Sweat	Repair
Hooter Defective	Repair
Headlight Left Damaged	Repair
Seat Front Right Damaged	Repair
Parcel Tray Missing	Replace
Side Mirror Left Damaged	Repair
Front Bumper Paintwork • Scratched	Repair
Bonnet Paintwork • Discoloured	Repair
Front Fender Left Paintwork • Runners / Teardrops	Repair
Front Fender Right Paintwork • Scratched	Repair
Rear Fender Left Paintwork • Scratched	Repair
Rear Fender Right Paintwork • Scratched	Repair
Door Front Left Paintwork • Scratched	Repair
Door Front Right Paintwork • Scratched	Repair
Door Rear Left Paintwork • Scratched	Repair
Boot Lid / Hatch door Defective	Repair
Rear bumper Paintwork • Scratched	Repair
Windscreen Cracked	Replace
Tie Rod End left Cracked	Replace
Tie Rod End right Cracked	Replace
Bolt(s) / Nut(s) Front Wheel Left Missing	Replace
Bolt(s) / Nut(s) Front Wheel Right Missing	Replace
Bolt(s) / Nut(s) Rear Wheel Left Missing	Replace
Boot not opening cannot see spare wheel	Repair
Computer box loose	Repair
Both front fender liner damage	Replace
L/F kick panel missing	Replace
Both front fog lights malfunction	Repair

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZZ6RZJU015756

1 / 12



CONDITION REPORT

Report No: 2016210210

 DATE
22/12/2023

Brakes

Brake Test Results

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s ²]
Front	2.7	3.0	-	
Rear	1.6	1.7	-	
Emergency / Parking	1.2	1	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	185/60R15	88H	Firestone	Touring	V	1222	1 mm
Front Right	185/60R15	88H	Firestone	Touring	V	3522	3 mm
Rear Left	185/60R15	88H	Firestone	Touring	V	1721	1 mm
Rear Right	185/60R15	88H	Firestone	Touring	V	1721	1 mm

* Tyre Legend: V=Virgin, R=Recap

Diagnostic

During the diagnostic no active error messages were detected. (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

Inspection Conditions

No Test Drive

Battery Flat

Engine number – not possible to verify engine number (not visible without dismantling)

Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS.

Body • Exterior: Vehicle got minor scratches, stone chips and dents on some body panels. Signs of spray work done on some body panels and discoloring on some body panels

Axle and Suspension: No shock test done due to shock machine not working

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Andrick Wymers

This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.




CONDITION REPORT

VIN: AA47360016215260

2 / 12

DATE


22/12/2023

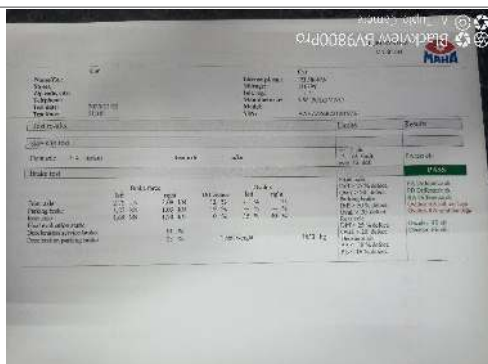

Brake report



Diagnostic report

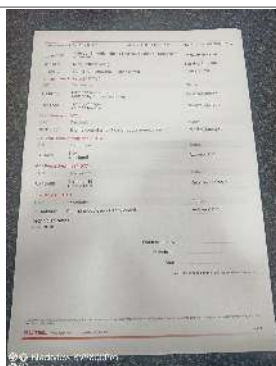

Diagnostic report



FRONT RIGHT CORNER



REAR LEFT CORNER



INTERIOR (FRONT DRIVER DOOR)



CONDITION REPORT

Report No: 2016210210

VIN: AAVZZZ6RZJU015756
DATE
22/12/2023

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016210210

DATE
VIN: AAVZZZ6P2210210210
4/12



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER



90 DEGREE FRONT



90 DEGREE RIGHT



90 DEGREE REAR



90 DEGREE LEFT

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016210210

DATE
22/12/2023

VIN: AAVZZZ6RZJU015756

5 / 12

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT


Report No: 2016210210

DATE
22/12/2023

VIN: AAVZZZ6RZJU015756
6 / 12



LF TYRE TREAD

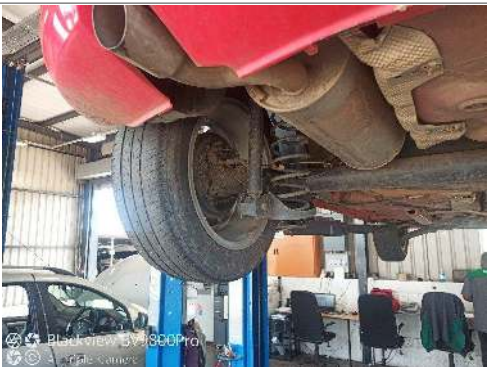

LR TYRE TREAD



RR TYRE TREAD



RF TYRE TREAD



LICENSE DISC



VIN PLATE OR STICKER



CONDITION REPORT

Report No: 2016210210

DATE
22/12/2023

VIN: AAVZZZ6RZJU015756

7 / 12



CONDITION REPORT

Report No: 2016210210

DATE
22/12/2023

ENGINE 1



ENGINE 2



CHASSIS



Computer box loose



L/F kick panel missing



Oil cap and dipstick



CONDITION REPORT

Report No: 2016210210

DATE
22/12/2023

VIN: AAVZZZ6RZJU015756
9 / 12

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016210210

DATE
22/12/2023

Expection bottle



Manual

VIN: AAVZZZ6RZJU015756
10 / 12

Windscreen



Water level



Engine



Headlight Left



CONDITION REPORT

Report No: 2016210210

DATE
22/12/2023

VIN: AAVZZZ6RZJU015756

11 / 12

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016210210

DATE
22/12/2023

Seat Front Right



Parcel Tray



Boot Lid / Hatch door



Bonnet



Front Fender Right



Front Bumper



CONDITION REPORT

Report No: 2016210210

DATE
22/12/2023

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016210210

DATE
22/12/2023

Front Bumper



Front Bumper



Front Fender Left



Side Mirror Left



Door Front Left



Door Rear Left



CONDITION REPORT

Report No: 2016210210

DATE
22/12/2023

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016210210

DATE
22/12/2023

Rear Fender Left



Rear bumper



Rear bumper



Rear bumper



Rear Fender Right



Door Front Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016210210

DATE
22/12/2023

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016210210

DATE
22/12/2023

Tie Rod End left



Tie Rod End right



Bolt(s) / Nut(s) Front Wheel Right



Bolt(s) / Nut(s) Front Wheel Left



Bolt(s) / Nut(s) Rear Wheel Left



Hooter

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016210210

DATE
22/12/2023

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za