



CONDITION REPORT



Report No:
2016984022
DATE
19/08/2025

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	19/08/2025		M57 Pretoria Road - 1619
Inspection Date	19/08/2025		Kempton Park - GT

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	MFC AUCTION HOUSE
Manufacturer	VOLKSWAGEN	Registration Number	FMG844L
Model	POLO VIVO 1.4 63KW COMFORTLINE 5-DR [2020-2022]	Register Number	
VIN	AAVZZZ6RZMU004358	Date Of First Licensing	
Engine Number		Last COR	
Doors	5	License Expiry Date	
Color	WHITE	Power / Displacement	
Year Model	2020	Paint Finish	C - COMMON
Km Reading	135,807 KM	Fuel	PETROL
Cab / Body Type	HATCHBACK	Transmission	MANUAL

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za


VIN: AAVZZZ6RZMU004358



CONDITION REPORT



Report No:
2016984022
DATE
19/08/2025

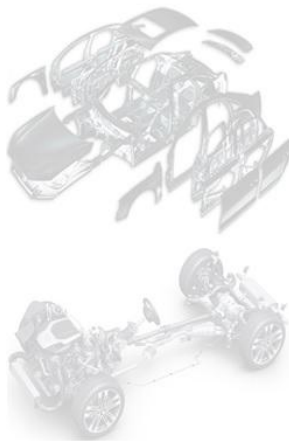**Damage****Repair Way**

Engine Oil Leak	Repair
Parcel Tray Missing	Replace
Side Mirror Left Paintwork • Scratched	Repair
Front Bumper Paintwork • Scratched	Repair
Bonnet Paintwork • Chipmarks	Repair
Door Front Left Dented	Repair
Door Front Right Dented	Repair
Door Rear Left Paintwork • Scratched	Repair
Rear bumper Paintwork • Scratched	Repair
Windscreen Cracked	Replace
Tyre Rear Left Smooth	Replace
Tyre Rear Right Smooth	Replace
Engine Performance Idling / Hunting	Repair
Warning lights illuminated	Repair
vehicle struggling to start	Repair
Boot does not close	Repair
Body exterior	Signs of spray work done on some body panels

Brakes**Brake Test Results**

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s ²]
Front	2.5	2.3	-	
Rear	1.4	1.4	-	
Emergency / Parking	0.8	1.2	-	

Tyres and Rims**Tyre Specification & Measurement**

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	185/60R15	84H	Continental	Contact	V	0524	5 mm
Front Right	185/60R15	84H	Continental	Contact	V	0524	5 mm
Rear Left	185/60R15	84H	Continental	Contact	V	4420	0 mm
Rear Right	185/60R15	84H	Continental	Contact	V	0524	0 mm
Spare	185/60R14	82H	Goodyear	Efficient	V	///////	5 mm

* Tyre Legend: V=Virgin, R=Recap

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZZ6RZMU004358



CONDITION REPORT



Report No:
2016984022
DATE
19/08/2025

Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

No	System	Code	Description	Status
1	ENGINE CONTROL MODULE	P0300:00/0768:000	RANDOM MULTIPLE CYLINDER MISFIRE DETECTED	

Inspection Conditions

No Test Drive
Battery Flat
Engine number – not possible to verify engine number (not visible without dismantling)
Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Trevino Julius

This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZZ6RZMU004358



CONDITION REPORT



Report No:
2016984022
DATE
19/08/2025



FRONT RIGHT CORNER



REAR LEFT CORNER



90 DEGREE FRONT



90 DEGREE RIGHT



90 DEGREE LEFT



90 DEGREE REAR

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZZ6RZMU004358



CONDITION REPORT



Report No:
2016984022
DATE
19/08/2025



ODOMETER



DASHBOARD (W/ ENGINE RUNNING)



INTERIOR (FRONT DRIVER DOOR)



Manual



Warning lights illuminated



LR TYRE TREAD

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZZ6RZMU004358



CONDITION REPORT



Report No:
2016984022
DATE
19/08/2025



LF TYRE TREAD



RF TYRE TREAD



RR TYRE TREAD



Sparewheel



board hinge.



Expansion bottle

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZZ6RZMU004358




CONDITION REPORT



Report No:
2016984022
DATE
19/08/2025



Oil cap and dipstick

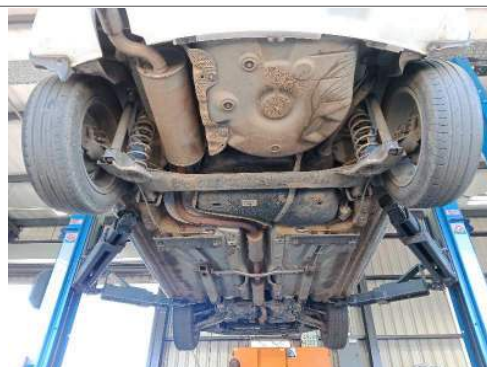

Rear end




ENGINE 1



CHASSIS



ENGINE 2

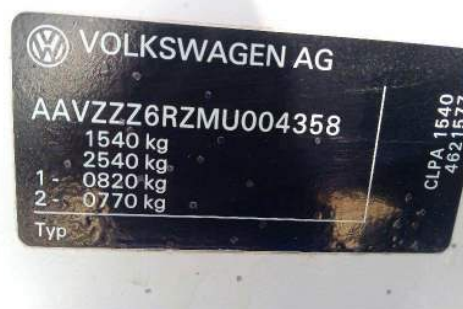

VIN PLATE OR STICKER

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZZ6RZMU004358




CONDITION REPORT




Report No:
2016984022
DATE
19/08/2025




LICENSE DISC

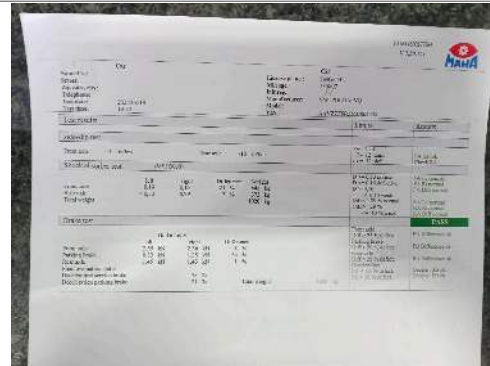

SHOCK AND BRAKE REPORT

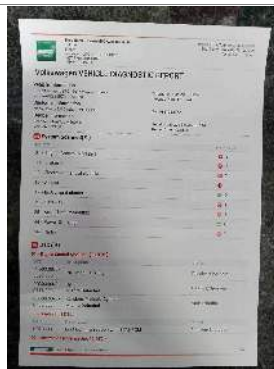

DIAGNOSTIC REPORT PAGE 1

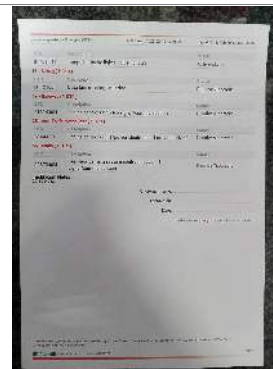

DIAGNOSTIC REPORT PAGE 2



Parcel Tray



Windscreen

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZ6RZMU004358



CONDITION REPORT



Report No:
2016984022
DATE
19/08/2025



Door Front Right



Door Front Right



Rear bumper



Rear bumper



Door Front Left



Door Front Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZZ6RZMU004358



CONDITION REPORT



Report No:
2016984022
DATE
19/08/2025



Side Mirror Left



Windscreen



Bonnet



Bonnet



Bonnet



Water level

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZZ6RZMU004358



CONDITION REPORT



Report No:
2016984022
DATE
19/08/2025



Engine



Front Bumper



Front Bumper



Door Rear Left



Door Rear Left



Tyre Rear Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZZ6RZMU004358



CONDITION REPORT



Report No:
2016984022
DATE
19/08/2025



Tyre Rear Left



Tyre Rear Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZZ6RZMU004358