



CONDITION REPORT

Report No: 2016577168

DATE
18/10/2024

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	18/10/2024		M57 Pretoria Road - 1619
Inspection Date	18/10/2024		Kempton Park - GT

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	
Manufacturer	VOLKSWAGEN	Registration Number	KR12YJGP
Model	POLO VIVO 1.4 55KW TRENDLINE 5-DR [2021-2023]	Register Number	
VIN	AAVZZZ6RZNU014639	Date Of First Licensing	
Engine Number		Last COR	
Doors	5	License Expiry Date	30/06/2023
Color	GREY	Power / Displacement	
Year Model	2022	Paint Finish	M - METALLIC
Km Reading	91,451 KM	Fuel	PETROL
Cab / Body Type	HATCHBACK	Transmission	MANUAL

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

Damage	Repair Way
Air Conditioner Insufficient	Repair
Side Mirror Right Damaged	Repair
Front Bumper Paintwork • Scratched	Repair
C • Pillar Right Paintwork • Scratched	Repair
Front Fender Right Dented	Repair
Door Front Right Paintwork • Chipmarks	Repair
Door Rear Right Paintwork • Scratched	Repair
Fuel Flap Damaged	Repair
Sill Panel Left Damaged	Repair
Windscreen Cracked	Replace
Spare Tyre Excessive Wear & Tear	Replace
Engine to silencer pipe Welded	Replace
L/F brake sensor damage	Repair
Aftermarket exhaust system fitted to vehicle	Repair
Rear tyre size differs	Replace.

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZZ6RZNU014639

1 / 10



CONDITION REPORT

Report No: 2016577168

DATE
18/10/2024

Brakes

Brake Test Results

	Left	Right	Axle Weight [KG]	Deceleration [m/s ²]
	Braking Force [KN]	Braking Force [KN]		
Front	2.7	2.6	-	
Rear	1.3	1.2	-	
Emergency / Parking	1	0.8	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	175/70R14	84T	Hilo	Genesys	V	0000	1 mm
Front Right	175/70R14	84T	Hilo	Genesys	V	3423	4 mm
Rear Left	185/60R14	82H	Goodyear	Duragrip	V	0619	5 mm
Rear Right	175/70R14	84T	Continental	Contact	V	4417	3 mm
Spare	185/60R14	82H	Continental	Contact	V	0000	0 mm

* Tyre Legend: V=Virgin, R=Recap

Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

No	System	Code	Description	Status
1	ENGINE CONTROL MODULE	U0151:00/4948:000	LOST COMMUNICATION WITH RESTRAINTS CONTROL MODULE	

Inspection Conditions

No Test Drive
Battery Flat
Engine number – not possible to verify engine number (not visible without dismantling)
Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS.Body • Exterior: Signs of spray work done on some body panels. Minor dents stretches stone chips on some body panels.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Trevino Julius


This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.



CONDITION REPORT


Report No: 2016577168

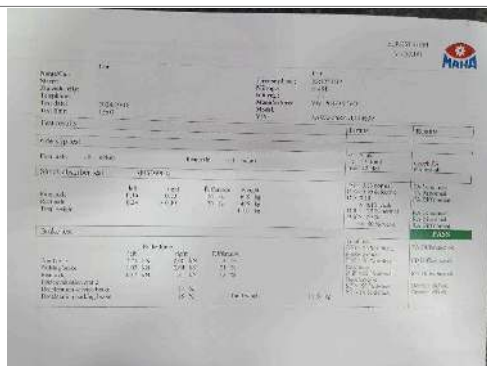DATE
18/10/2024

Shock and brake report



Diagnostics

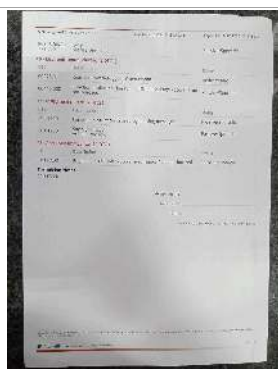

Diagnostics



FRONT RIGHT CORNER



REAR LEFT CORNER



INTERIOR (FRONT DRIVER DOOR)



CONDITION REPORT

Report No: 2016577168

DATE
18/10/2024

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZZ6RZNU014639
4 / 10



CONDITION REPORT

Report No: 2016577168

DATE
18/10/2024

DASHBOARD (W/ ENGINE RUNNING)



ODOMETER



Manual



90 DEGREE FRONT



90 DEGREE RIGHT



90 DEGREE REAR



CONDITION REPORT

Report No: 2016577168

DATE
18/10/2024

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZZ6RZNU014639
6 / 10



CONDITION REPORT


Report No: 2016577168

DATE
18/10/2024

90 DEGREE LEFT




LF TYRE TREAD

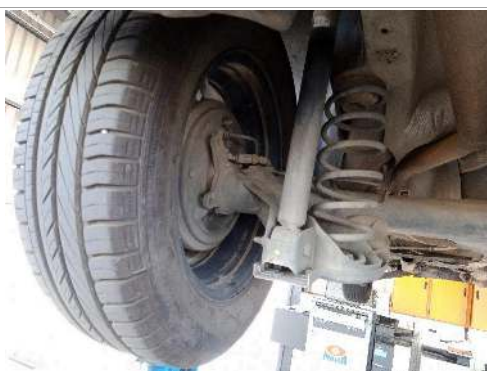

LR TYRE TREAD



RR TYRE TREAD

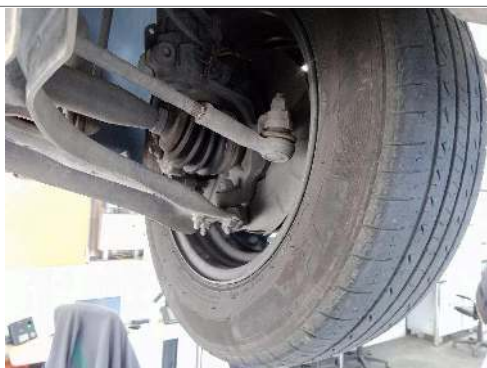

RF TYRE TREAD



Sparewheel



CONDITION REPORT

Report No: 2016577168

DATE
18/10/2024

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZZ6RZNU014639
8 / 10



CONDITION REPORT

Report No: 2016577168

DATE
18/10/2024



LICENSE DISC



VIN PLATE OR STICKER



ENGINE 1



ENGINE 2



CHASSIS



Rear end



CONDITION REPORT

Report No: 2016577168

DATE
18/10/2024



CONDITION REPORT

Report No: 2016577168

DATE
18/10/2024

L/F brake sensor damage



Expansion bottle



Oil cap and dipstick



Spare Tyre



Spare Tyre



Side Mirror Right



CONDITION REPORT

Report No: 2016577168

DATE
18/10/2024

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT


Report No: 2016577168

DATE
18/10/2024

Windscreen



Windscreen

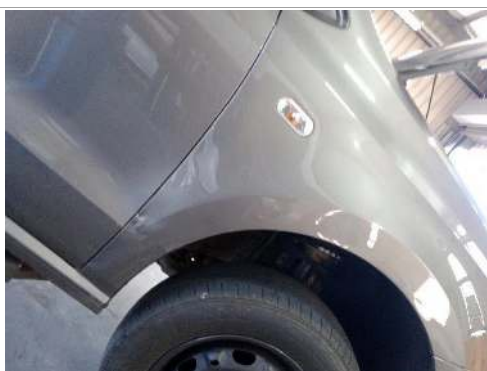

Front Fender Right



Front Bumper



Front Bumper



Front Bumper



CONDITION REPORT

Report No: 2016577168

DATE
18/10/2024

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016577168

DATE
18/10/2024

Fuel Flap



Fuel Flap



Door Rear Right



C • Pillar Right



Door Front Right



Sill Panel Left



CONDITION REPORT

Report No: 2016577168

DATE
18/10/2024

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016577168

DATE
18/10/2024

Engine to silencer pipe



Engine to silencer pipe



CONDITION REPORT

Report No: 2016577168

DATE
18/10/2024

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za