



CONDITION REPORT

Report No: 2016585339

DATE
25/10/2024

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	25/10/2024		M57 Pretoria Road - 1619
Inspection Date	25/10/2024		Kempton Park - GT

Vehicle Data

Vehicle Type	LIGHT LOAD VEHICLE	Registered Owner	
Manufacturer	ISUZU	Registration Number	FN54NNGP
Model	KB250 HO HR D-CAB DSL PU [2016-2018]	Register Number	
VIN	ADMNRCHR0G4790454	Date Of First Licensing	
Engine Number		Last COR	
Doors	4	License Expiry Date	31/10/2024
Color	WHITE	Power / Displacement	
Year Model	2016	Paint Finish	TWO COAT METALLIC
Km Reading	188,626 KM	Fuel	DIESEL
Cab / Body Type	DOUBLE CAB	Transmission	MANUAL

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

Damage	Repair Way
Central Air Vent Damaged	Repair
Seat Front Left Damaged	Repair
Seat Front Right Damaged	Repair
Seat Rear Damaged	Repair
Front Bumper Damaged	Repair
Bonnet Damaged	Repair
Front Fender Left Damaged	Repair
Front Fender Right Damaged	Repair
Rear Fender Left Damaged	Repair
Rear Fender Right Damaged	Repair
Door Front Left Damaged	Repair
Door Front Right Damaged	Repair
Door Rear Left Damaged	Repair
Tailgate Damaged	Repair
Rear bumper Damaged	Repair
Gearbox Oil Leak	Repair
Differential Oil Leak	Repair
Center Prop Shaft Rubber(s) Damaged	Replace

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: ADMNRCHR0G4790454

1 / 10



CONDITION REPORT

Report No: 2016585339

DATE
25/10/2024

Brakes

Brake Test Results

	Left	Right	Axle Weight [KG]	Deceleration [m/s ²]
	Braking Force [KN]	Braking Force [KN]		
Front	4.21	4.56	-	
Rear	2.51	2.91	-	
Emergency / Parking	3.1	3.05	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	245/70R16	109T	Goodyear	Wrangler	V	2720	1 mm
Front Right	245/70R16	109T	Goodyear	Wrangler	V	2720	1 mm
Rear Left	245/70R16	109T	Goodyear	Wrangler	V	2322	3 mm
Rear Right	245/70R16	109T	Goodyear	Wrangler	V	2322	3 mm

* Tyre Legend: V=Virgin, R=Recap

Diagnostic

During the diagnostic no active error messages were detected. (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

Inspection Conditions

No Test Drive
Battery Flat
Engine number – not possible to verify engine number (not visible without dismantling)
Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Werner Laubscher


This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.




CONDITION REPORT


Report No: 2016585339

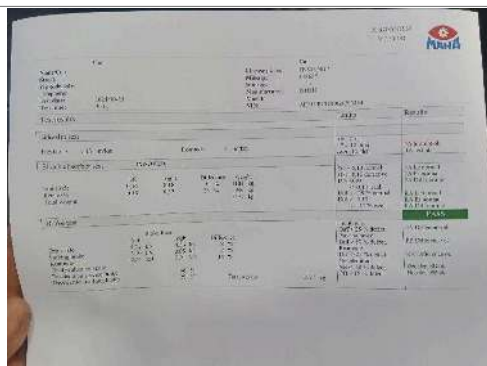DATE
25/10/2024

Brake and shock test

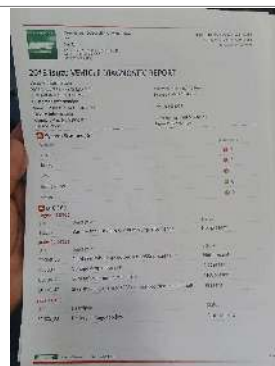

diagnostics.

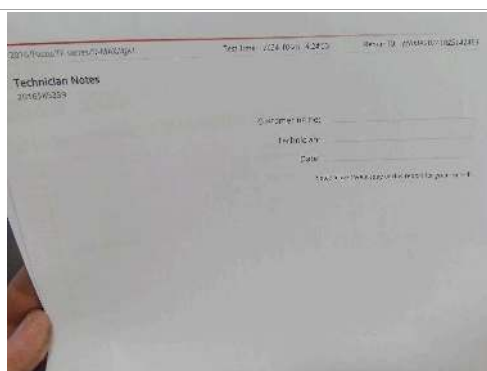

diagnostics.



FRONT RIGHT CORNER



REAR LEFT CORNER



INTERIOR (FRONT DRIVER DOOR)



CONDITION REPORT

Report No: 2016585339

DATE
25/10/2024

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: ADMNRCHR0G4790454
4 / 10



CONDITION REPORT

Report No: 2016585339

DATE
25/10/2024

DASHBOARD (W/ ENGINE RUNNING)



ODOMETER



manual.



90 DEGREE FRONT



90 DEGREE RIGHT



90 DEGREE REAR

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: ADMNRCHR0G4790454

5 / 10



CONDITION REPORT

Report No: 2016585339

DATE
25/10/2024

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: ADMNRCHR0G4790454
6 / 10



CONDITION REPORT


Report No: 2016585339

DATE
25/10/2024

90 DEGREE LEFT



LF TYRE TREAD

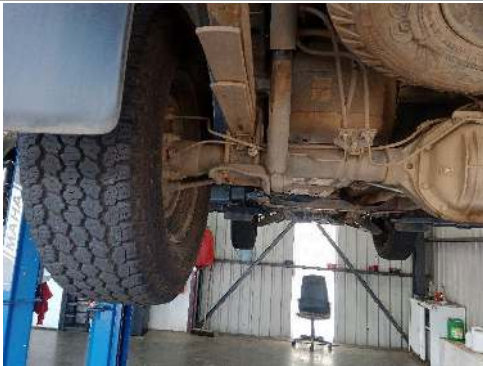

LR TYRE TREAD



RR TYRE TREAD



RF TYRE TREAD



LICENSE DISC



CONDITION REPORT

Report No: 2016585339

DATE
25/10/2024



CONDITION REPORT


Report No: 2016585339

DATE
25/10/2024

VIN PLATE OR STICKER



ENGINE 1

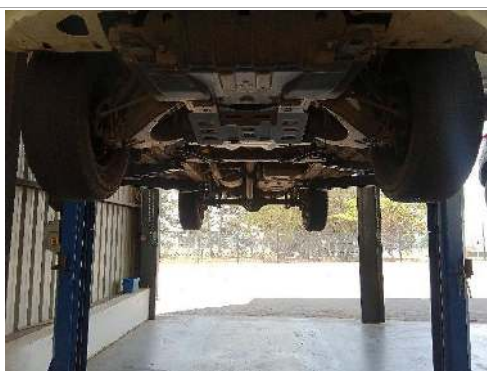

undercarriage front.



undercarriage rear.



oil cap and dipstick.



Water level



CONDITION REPORT

Report No: 2016585339

DATE
25/10/2024

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: ADMNRCHR0G4790454
10 / 10



CONDITION REPORT

Report No: 2016585339

DATE
25/10/2024

Front Bumper



Front Bumper



Bonnet



Front Fender Left



Door Front Left



Door Rear Left



CONDITION REPORT

Report No: 2016585339

DATE
25/10/2024

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016585339

DATE
25/10/2024

Rear Fender Left



Tailgate



Rear bumper



Rear bumper



Rear Fender Right



Door Front Right



CONDITION REPORT

Report No: 2016585339

DATE
25/10/2024

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016585339

DATE
25/10/2024

Front Fender Right



Seat Front Right



Seat Rear



Seat Front Left



Differential



Center Prop Shaft Rubber(s)



CONDITION REPORT

Report No: 2016585339

DATE
25/10/2024

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016585339

DATE
25/10/2024

Gearbox



Central Air Vent

**CONDITION REPORT****Report No: 2016585339****DATE**
25/10/2024

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za