



CONDITION REPORT

Report No: 2016468770

DATE
26/07/2024

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	26/07/2024		M57 Pretoria Road - 1619
Inspection Date	26/07/2024		Kempton Park - GT

Vehicle Data

Vehicle Type	LIGHT LOAD VEHICLE	Registered Owner	
Manufacturer	NISSAN	Registration Number	DL96BWGP
Model	NP300 HARDBODY	Register Number	
VIN	ADNALGD22ZR072418	Date Of First Licensing	
Engine Number		Last COR	
Doors	2	License Expiry Date	31/07/2024
Color	WHITE	Power / Displacement	
Year Model		Paint Finish	C - COMMON
Km Reading	308,978 KM	Fuel	PETROL
Cab / Body Type	SINGLE CAB	Transmission	MANUAL

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

Damage	Repair Way
Tail Light Left Damaged	Replace
Tail Light Right Damaged	Replace
Headlight Right Damaged	Replace
Seat Front Left Damaged	Repair
Seat Front Right Damaged	Repair
Front Bumper Damaged	Repair
Bonnet Paintwork • Chipmarks	Repair
B • Pillar Left Paintwork • Scratched	Repair
B • Pillar Right Paintwork • Scratched	Repair
Front Fender Left Paintwork • Scratched	Repair
Front Fender Right Paintwork • Scratched	Repair
Rear Fender Left Paintwork • Scratched	Repair
Rear Fender Right Paintwork • Scratched	Repair
Door Front Left Dented	Repair
Door Front Right Paintwork • Scratched	Repair
Tailgate Paintwork • Scratched	Repair
Windscreen Cracked	Replace
Service Brake Performance Rear Axle Left / Right	Repair
Difference out of legal range	
Parking Brake Performance Left / Right Difference out of legal range	Repair
Shock Absorber Front Left Leak	Replace
Shock Absorber Rear Left Leak	Replace
Shock Absorber Rear Right Leak	Replace
Stabilizer Mounting Front Left Defective	Replace
Stabilizer Mounting Front Right Defective	Replace
Ball Joint(s) Front Axle Left Cracked	Replace
Ball Joint(s) Front Axle Right Cracked	Replace
Tyre Rear Right Smooth	Replace

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: ADNALGD22ZR072418

1 / 13



CONDITION REPORT

Report No: 2016468770

 DATE
26/07/2024

Damage

 Differential Oil Leak
Vehicle not starting

Repair Way

 Repair
Repair

Brakes

Brake Test Results

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s ²]
Front	2.8	2.6	-	
Rear	2.1	0.6	-	
Emergency / Parking	2.2	0.6	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	195R15	106/104S	Toyo	Ho7	V	4820	2 mm
Front Right	245/75R15	111S	Goodyear	Wrangler	V	0000	2 mm
Rear Left	245/75R15	109/107S	Firestone	Destination	V	3512	2 mm
Rear Right	205/75R14	109/107S	Yokohama	Radial	V	3619	0 mm

* Tyre Legend: V=Virgin, R=Recap

Diagnostic

During the diagnostic no active error messages were detected. (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

Inspection Conditions

No Test Drive
Battery Flat
Engine number – not possible to verify engine number (not visible without dismantling)
Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Andrick Wymers

This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.



CONDITION REPORT


VIN: ADNA1GD23Z073418

Report No: 2016468770


2 / 13

DATE

26/07/2024

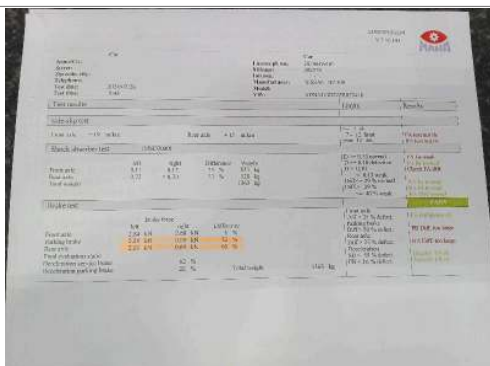

Shock and brake report

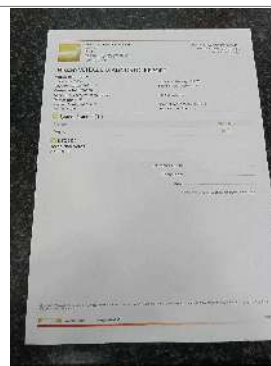

Diagnostic report



FRONT RIGHT CORNER



REAR LEFT CORNER



INTERIOR (FRONT DRIVER DOOR)



DASHBOARD (W/ ENGINE RUNNING)

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016468770
VIN: ADNALGD22ZR072418
DATE
3/7/13
26/07/2024

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016468770

DATE
VIN: ADNALGD22Z072418
26/07/2024
4/13

ODOMETER



Manual



90 DEGREE FRONT



90 DEGREE RIGHT



90 DEGREE REAR



90 DEGREE LEFT



CONDITION REPORT

Report No: 2016468770

DATE

26/07/2024

VIN: ADNALGD22ZR072418

5 / 13

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016468770

DATE
26/07/2024

VIN: ADNALGD22ZR072418


6 / 13



LF TYRE TREAD



LR TYRE TREAD

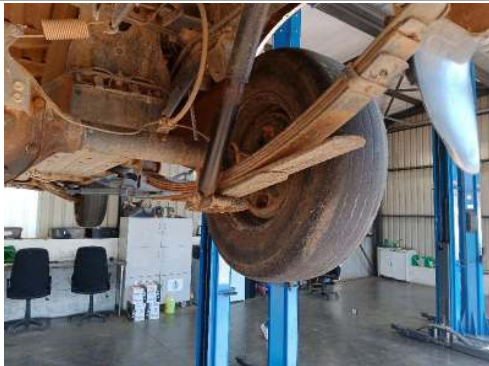

RR TYRE TREAD



RF TYRE TREAD



No spare wheel



LICENSE DISC



CONDITION REPORT

Report No: 2016468770

DATE
26/07/2024

VIN: ADNALGD22ZR072418
7 / 13

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016468770

DATE
26/07/2024

VIN PLATE OR STICKER



ENGINE 1



ENGINE 2



CHASSIS



Coolant bottle



Oil cap and dipstick



CONDITION REPORT

Report No: 2016468770

DATE
26/07/2024

VIN: ADNALGD22ZR072418
9 / 13


DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za




CONDITION REPORT

Report No: 2016468770

DATE
26/07/2024

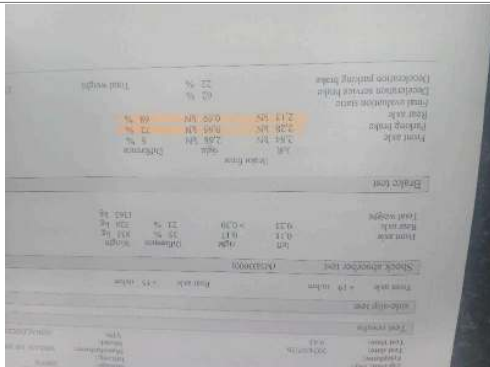

Parking Brake Performance

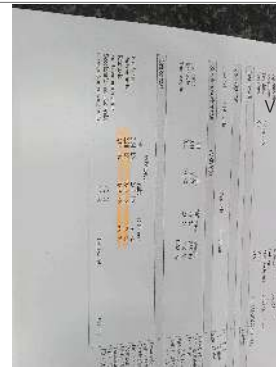

Service Brake Performance Rear Axle

VIN: ADNALGD22ZR072418

10 / 13



Water level



Seat Front Right



Seat Front Left



Windscreen

DEKRA Automotive (PTY) Ltd
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016468770

DATE
26/07/2024

VIN: ADNALGD22ZR072418
11 / 13

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016468770

DATE
26/07/2024

Headlight Right



Bonnet

VIN: ADNALGD22ZR072418

12 / 13



Front Fender Left



Door Front Left



Rear Fender Left



B • Pillar Left



CONDITION REPORT

Report No: 2016468770

DATE
26/07/2024

VIN: ADNALGD22ZR072418
13 / 13

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016468770

DATE
26/07/2024

Tailgate



Tail Light Left



Tail Light Right



Rear Fender Right



Door Front Right



Front Fender Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016468770

DATE
26/07/2024

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016468770

DATE
26/07/2024

B • Pillar Right



Front Bumper



Front Bumper



Front Bumper



Shock Absorber Rear Left



Shock Absorber Rear Right



CONDITION REPORT

Report No: 2016468770

DATE
26/07/2024

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016468770

DATE
26/07/2024

Tyre Rear Right



Differential



Shock Absorber Front Left



Ball Joint(s) Front Axle Left



Ball Joint(s) Front Axle Right



Stabilizer Mounting Front Right



CONDITION REPORT

Report No: 2016468770

DATE
26/07/2024

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

**CONDITION REPORT**

Report No: 2016468770

DATE
26/07/2024

Stabilizer Mounting Front Left



CONDITION REPORT

Report No: 2016468770

DATE
26/07/2024

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za