

MFC Auction House  
M57 Pretoria Rd, Glenmarais, KEMPTON PARK  
Gauteng

DEKRA MFC  
M57 Pretoria Rd - 1619  
KEMPTON PARK - GT  
08610 33572



## Assignment

|                 |                   |                     |                          |
|-----------------|-------------------|---------------------|--------------------------|
| Client          | MFC Auction House | Inspection Location | MFC                      |
| Requested Date  | 07/03/2024        |                     | M57 Pretoria Road - 1619 |
| Inspection Date | 07/03/2024        |                     | Kempton Park - GT        |

## Vehicle Data

|                 |                   |                         |                   |
|-----------------|-------------------|-------------------------|-------------------|
| Vehicle Type    | PASSENGER VEHICLE | Registered Owner        | MFC AUCTION HOUSE |
| Manufacturer    | FORD              | Registration Number     | NO REG            |
| Model           | EVEREST           | Register Number         |                   |
| VIN             | AFAJXXMJWJHC21939 | Date Of First Licensing |                   |
| Engine Number   |                   | Last COR                |                   |
| Doors           | 5                 | License Expiry Date     | 07/03/2024        |
| Color           | WHITE             | Power / Displacement    |                   |
| Year Model      |                   | Paint Finish            | C - COMMON        |
| Km Reading      | 86,931 KM         | Fuel                    | DIESEL            |
| Cab / Body Type | SUV               | Transmission            | AUTOMATIC         |

## Vehicle Options & Accessories

### Items

## VEHICLE INSPECTION

|                                                                                     | Damage                                              | Repair Way                                         |
|-------------------------------------------------------------------------------------|-----------------------------------------------------|----------------------------------------------------|
|  | Engine Wiring Defective                             | Repair                                             |
|                                                                                     | Battery clamps Defective                            | Replace                                            |
|                                                                                     | Bonnet cable Defective                              | Repair                                             |
|                                                                                     | Bonnet safety caps Missing                          | Replace                                            |
|                                                                                     | Seat Rear ( 2. Row) Dirty                           | Replace                                            |
|                                                                                     | Dash Padding Damaged                                | Replace                                            |
|                                                                                     | Front Bumper Damaged                                | Repair                                             |
|                                                                                     | Bonnet slam plate (Shock tower/ Inner tray) Damaged | Repair                                             |
|                                                                                     | C • Pillar Right Paintwork • Flaking                | Repair                                             |
|                                                                                     | Tyre Front Left Smooth                              | Replace                                            |
|                                                                                     | Bolt(s) / Nut(s) Front Wheel Left Missing           | Replace                                            |
|                                                                                     | Bolt(s) / Nut(s) Front Wheel Right Missing          | Replace                                            |
|                                                                                     | Bolt(s) / Nut(s) Rear Wheel Right Missing           | Replace                                            |
|                                                                                     | Main Beam Right Damaged                             | Replace                                            |
|                                                                                     | Gearbox Oil Leak                                    | Repair                                             |
|                                                                                     | Body exterior                                       | Signs of spray work done on some body panels       |
|                                                                                     | Body exterior.                                      | Minor dents scratches and stone chips on some body |
|                                                                                     | Comments                                            | According to the age and mileage of the vehicle    |
|                                                                                     | Undercarriage                                       | entire undercarriage including suspension is rust  |
|                                                                                     | Body                                                | Bonnet and hatchback not closing                   |
|                                                                                     | Electronics                                         | Radio and hooter malfunction.                      |

## Brakes

### Brake Test Results

|                     | Left               | Right              | Axle Weight [KG] | Deceleration [m/s <sup>2</sup> ] |
|---------------------|--------------------|--------------------|------------------|----------------------------------|
|                     | Braking Force [KN] | Braking Force [KN] |                  |                                  |
| Front               | 4.8                | 5.1                | -                |                                  |
| Rear                | 4.5                | 4.2                | -                |                                  |
| Emergency / Parking | 3.5                | 3.7                | -                |                                  |

## Tyres and Rims

### Tyre Specification & Measurement

|             | Size      | Load/Speed Index | Manufacture | Model   | Type* | Production Date | Tread Depth (mm) |
|-------------|-----------|------------------|-------------|---------|-------|-----------------|------------------|
| Front Left  | 265/60R18 | 110T             | Continental | Contact | V     |                 | 0 mm             |
| Front Right | 265/60R18 | 110T             | Continental | Contact | V     |                 | 1 mm             |
| Rear Left   | 265/60R18 | 112T             | Continental | Contact | V     | 3717            | 6 mm             |
| Rear Right  | 265/60R18 | 110T             | Continental | Contact | V     | 3517            | 1 mm             |
| Spare       | 265/60R18 | 110T             | Continental | Contact | V     | /////           | 1 mm             |

\* Tyre Legend: V=Virgin, R=Recap

## Diagnostic

During the diagnostic no active error messages were detected. (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

## Inspection Conditions

No Test Drive

Battery Flat

Engine number – not possible to verify engine number (not visible without dismantling)

Inspection conditions for the vehicle inspection were sufficient

## Comments

General Comments: ACCORDING TO AGE AND MILEAGE OF VEHICLE NORMAL WEAR AND TEAR ON INTEIROR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS.

## Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

## Technician


Trevino Julius

This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.



Automatic

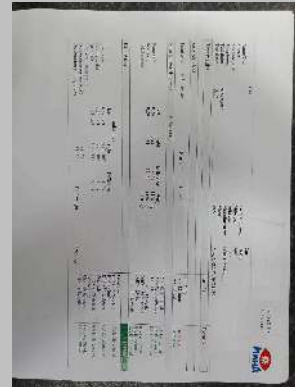

Shock and brake report




Diagnostic test



Diagnostic



Diagnostic test

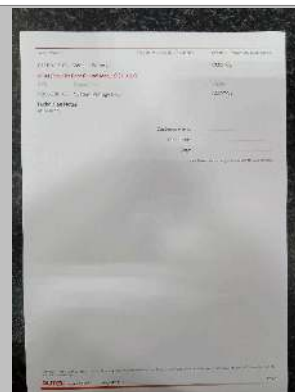

Diagnostic test



## CONDITION REPORT

Report No: 2016296770

VIN: AFAJXXMJWJHC21939

DATE

07/03/2024



Expansion bottle



Oil cap and dipstick



No license disc



Rear end



Sparewheel



FRONT RIGHT CORNER





VIN: AFAJXXMJWJHC21939

6 / 12



REAR LEFT CORNER



INTERIOR (FRONT DRIVER DOOR)



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER



90 DEGREE FRONT



90 DEGREE RIGHT

VIN: AFAJXXMJWJHC21939

7 / 12





90 DEGREE REAR



90 DEGREE LEFT

VIN: AFAJXXMJWJHC21939

8 / 12




LF TYRE TREAD



LR TYRE TREAD



RR TYRE TREAD

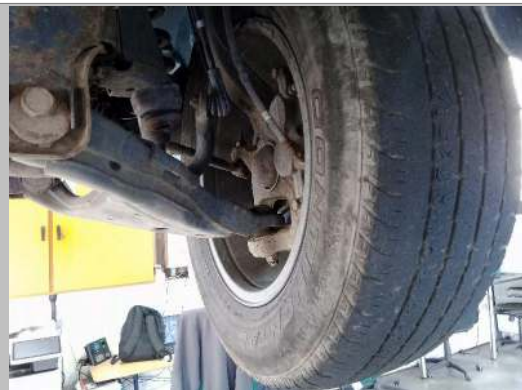

RF TYRE TREAD

VIN: AFAJXXMJWJHC21939

9 / 12



VIN PLATE OR STICKER



CHASSIS

AFAXXJWJHC21939  
10 / 12



ENGINE 2



ENGINE 1



Water level



Bonnet slam plate (Shock tower/ Inner tray)

VIN: AFAJXXMJWJHC21939

11 / 12





Bonnet slam plate (Shock tower/ Inner tray)



Bonnet safety caps



Bonnet cable



Engine Wiring



Front Bumper



Battery clamps







C • Pillar Right



Bolt(s) / Nut(s) Front Wheel Right



Front Bumper



Front Bumper



Front Bumper



Bolt(s) / Nut(s) Front Wheel Left





Tyre Front Left



Front Bumper



Bolt(s) / Nut(s) Rear Wheel Right



Gearbox



Main Beam Right



Main Beam Right





Seat Rear ( 2. Row)



Dash Padding





## CONDITION REPORT

Report No: 2016296770

DATE  
07/03/2024

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
[www.dekraauto.co.za](http://www.dekraauto.co.za)