



CONDITION REPORT



Report No:
2016903793
DATE
05/06/2025

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	05/06/2025		M57 Pretoria Road - 1619
Inspection Date	05/06/2025		Kempton Park - GT

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	
Manufacturer	TOYOTA	Registration Number	KG33HXGP
Model	COROLLA QUEST 1.6 [2016-2021]	Register Number	
VIN	AHTLB52E003146560	Date Of First Licensing	
Engine Number		Last COR	
Doors	4	License Expiry Date	31/10/2025
Color	WHITE	Power / Displacement	
Year Model	2019	Paint Finish	C - COMMON
Km Reading	152,828 KM	Fuel	PETROL
Cab / Body Type	SEDAN	Transmission	MANUAL

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za


VIN: AHTLB52E003146560



CONDITION REPORT



Report No:
2016903793
DATE
05/06/2025

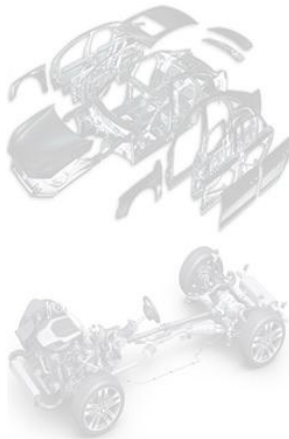

Damage

Repair Way

Interior Mirror Missing	Repair
Gear Lever Dust Boot Damaged	Repair
Side Mirror Left Paintwork • Scratched	Repair
Side Mirror Right Damaged	Repair
Front Bumper Paintwork • Scratched	Repair
Front Fender Left Paintwork • Scratched	Repair
Front Fender Right Paintwork • Dull	Repair
Rear Fender Left Paintwork • Chipmarks	Repair
Rear Fender Right Paintwork • Discoloured	Repair
Door Front Left Dented	Repair
Door Front Right Paintwork • Dull	Repair
Door Rear Left Dented	Repair
Door Rear Right Paintwork • Dull	Repair
Boot Lid / Hatch door Dented	Repair
Rear bumper Residual Traces of Repair	Repair
Tyre Front Left Damaged	Replace
Tyre Rear Left Smooth	Replace
Tyre Rear Right Damaged	Replace
R/F fender liner missing	Replace

Brakes

Brake Test Results

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s ²]
Front	2.7	3.4	-	
Rear	2.5	2.8	-	
Emergency / Parking	1.1	1.2	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	185/60R15	88H	Goodyear	Efficient gr	V	3419	0 mm
Front Right	195/65R15	91H	Goodyear	Excellence	V	2821	3 mm
Rear Left	185/60R15	88H	Firestone	Touring	V	3622	0 mm
Rear Right	195/65R15	91V	Sumitomo	Htr	V	2820	0 mm
Spare	185/60R15	84H	Continental	Contact	V	2316	3 mm

* Tyre Legend: V=Virgin, R=Recap

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AHTLB52E003146560



CONDITION REPORT



Report No:
2016903793
DATE
05/06/2025

Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

No	System	Code	Description	Status
1	CURRENT	C1241	LOW OR HIGH POWER SUPPLY VOLTAGE	

Inspection Conditions

No Test Drive
Battery Flat
Engine number – not possible to verify engine number (not visible without dismantling)
Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS. Body • Exterior: Vehicle got minor scratches, stone chips and dents. Signs of spray work done on some body panels.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Andrick Wymers

This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za


VIN: AHTLB52E003146560



CONDITION REPORT




Report No:
2016903793
DATE
05/06/2025

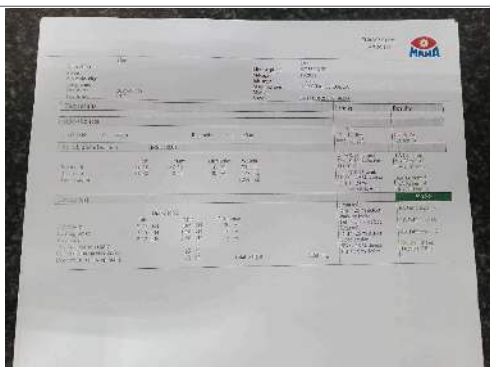

Shock and brake report



Diagnostic report

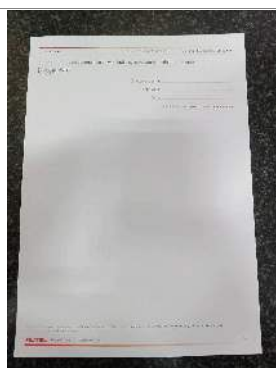

Diagnostic report



FRONT RIGHT CORNER



REAR LEFT CORNER



INTERIOR (FRONT DRIVER DOOR)

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AHTLB52E003146560



CONDITION REPORT



Report No:
2016903793
DATE
05/06/2025



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER



Manual



90 DEGREE FRONT



90 DEGREE RIGHT



90 DEGREE REAR

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AHTLB52E003146560




CONDITION REPORT




Report No:
2016903793
DATE
05/06/2025



90 DEGREE LEFT

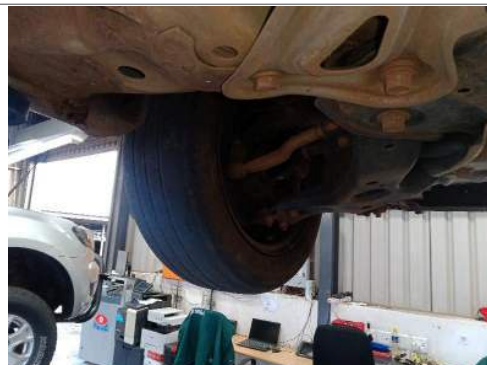


LF TYRE TREAD

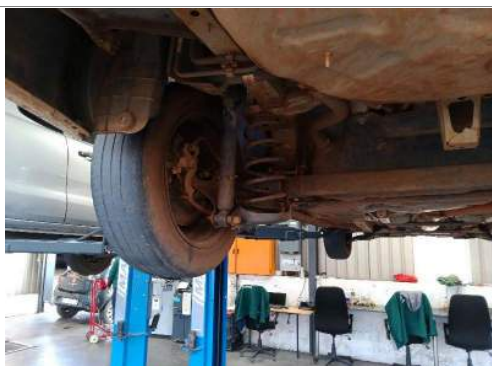

LR TYRE TREAD



RR TYRE TREAD

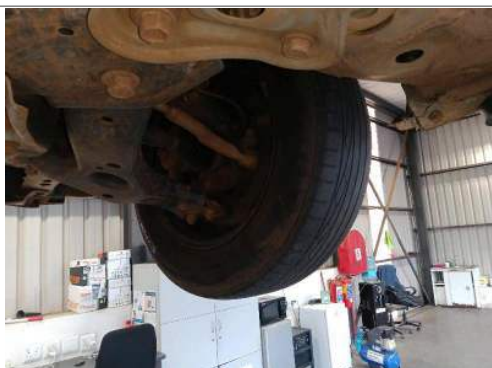

RF TYRE TREAD



Spare wheel

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AHTLB52E003146560



CONDITION REPORT



Report No:
2016903793
DATE
05/06/2025



LICENSE DISC



VIN PLATE OR STICKER



ENGINE 1



ENGINE 2



CHASSIS



Oil cap and dipstick

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AHTLB52E003146560



CONDITION REPORT



Report No:
2016903793
DATE
05/06/2025



Exhaustion bottle



Water level



Rear bumper



Rear Fender Right



Door Rear Right



Door Front Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AHTLB52E003146560



CONDITION REPORT



Report No:
2016903793
DATE
05/06/2025



Front Fender Right



Front Bumper



Front Bumper



Side Mirror Left



Front Fender Left



Door Front Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AHTLB52E003146560



CONDITION REPORT



Report No:
2016903793
DATE
05/06/2025




Door Rear Left



Rear Fender Left



Boot Lid / Hatch door

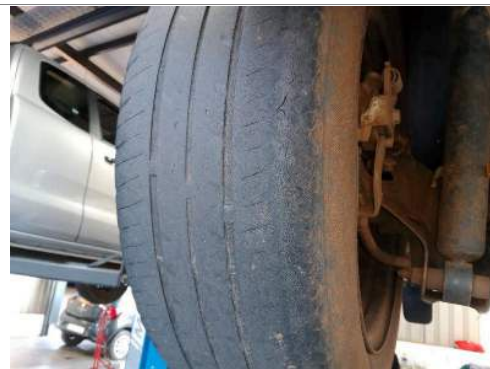

Tyre Rear Left



Tyre Rear Right



Tyre Front Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AHTLB52E003146560



CONDITION REPORT



Report No:
2016903793
DATE
05/06/2025



Interior Mirror



Side Mirror Right



Gear Lever Dust Boot

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AHTLB52E003146560