



CONDITION REPORT

Report No: 2016211814

DATE
27/12/2023

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	27/12/2023		M57 Pretoria Road - 1619
Inspection Date	27/12/2023		Kempton Park - GT

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	MFC
Manufacturer	TOYOTA	Registration Number	FLT661L
Model	COROLLA	Register Number	
VIN	AHTLB52E903134634	Date Of First Licensing	
Engine Number		Last COR	
Doors	4	License Expiry Date	27/12/2023
Color	BROWN	Power / Displacement	
Year Model		Paint Finish	TWO COAT METALLIC
Km Reading	85,548 KM	Fuel	PETROL
Cab / Body Type	SEDAN	Transmission	MANUAL

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

Damage	Repair Way
Windscreen Wiper Damaged	Replace
Tail Light Right Damaged	Repair
Seat Front Right Worn	Repair
Seat Rear Dirty	Repair
Front Bumper Damaged	Repair
Bonnet Damaged	Repair
Front Fender Left Damaged	Repair
Front Fender Right Damaged	Repair
Rear Fender Right Damaged	Repair
Door Front Left Damaged	Repair
Door Front Right Damaged	Repair
Door Rear Left Damaged	Repair
Door Rear Right Damaged	Repair
Boot Lid / Hatch door Damaged	Repair
Rear bumper Damaged	Repair
Windscreen Damaged	Replace
Tyre Rear Right Worn	Replace

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AHTLB52E903134634

1 / 9



CONDITION REPORT

Report No: 2016211814

 DATE
27/12/2023

Brakes

Brake Test Results

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s ²]
Front	3.31	3.14	-	
Rear	2.26	2.33	-	
Emergency / Parking	1.59	1.61	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	195/65R15	91H	Royalblack	Radial	V	2922	2 mm
Front Right	195/65R15	91H	Royalblack	Radial	V	2822	1 mm
Rear Left	195/65R15	91H	Autogrip	Radial	V	2419	1 mm
Rear Right	195/65R15	91H	Continental	Contipremium	V	2918	0 mm

* Tyre Legend: V=Virgin, R=Recap

Diagnostic

During the diagnostic no active error messages were detected. (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

Inspection Conditions

No Test Drive

Battery Flat

Engine number – not possible to verify engine number (not visible without dismantling)

Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: GEAR KNOB DAMAGED. SHOCK ABSORBER TEST NOT PERFORMED.

Body • Exterior: Minor dents and scratches and stone chips to some body panels. Signs of repair work done to some body panels. Poor alignment to some body panels. Vehicle body in poor condition. Shock absorber test not performed.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS.

Technician

Werner Laubscher

This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.




CONDITION REPORT

Report No: 201621814


2 / 9

DATE

27/12/2023

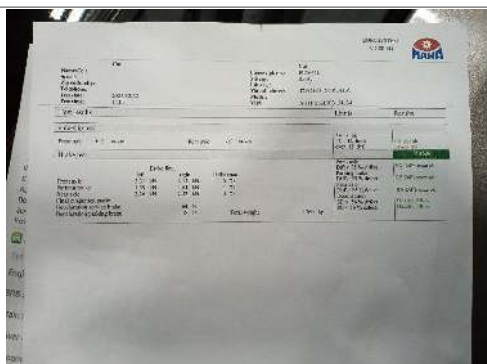

Brake test

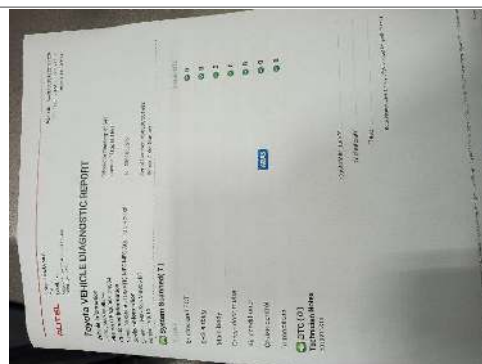

Diagnostic report



FRONT RIGHT CORNER



REAR LEFT CORNER



INTERIOR (FRONT DRIVER DOOR)



DASHBOARD (W/ ENGINE RUNNING)

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016211814

VIN: AHTLB52E903134634

DATE

27/12/2023

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016211814

DATE
20/12/2023
VIN: AHTLB522903172623
4/9



ODOMETER



90 DEGREE FRONT



90 DEGREE RIGHT



90 DEGREE REAR



90 DEGREE LEFT



LF TYRE TREAD

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016211814

DATE
27/12/2023

VIN: AHTLB52E903134634

5 / 9

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016211814

DATE
27/12/2023

VIN: AHTLB52E903134634

6 / 9



LR TYRE TREAD



RR TYRE TREAD



RF TYRE TREAD



LICENSE DISC



VIN PLATE OR STICKER



ENGINE 1



CONDITION REPORT

Report No: 2016211814

DATE
27/12/2023

VIN: AHTLB52E903134634
7 / 9

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016211814

DATE
27/12/2023

ADDITIONAL 3



ADDITIONAL 4

VIN: AHTLB52E903134634

8 / 9



ADDITIONAL 10



ADDITIONAL 11



Water level



Front Bumper



CONDITION REPORT

Report No: 2016211814

DATE
27/12/2023

VIN: AHTLB52E903134634
9 / 9

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016211814

DATE
27/12/2023

Front Bumper



Bonnet



Front Fender Left



Door Front Left



Door Rear Left



Rear bumper



CONDITION REPORT

Report No: 2016211814

DATE
27/12/2023

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016211814

DATE
27/12/2023

Rear bumper



Boot Lid / Hatch door



Rear Fender Right



Front Fender Right



Door Front Right



Door Rear Right



CONDITION REPORT

Report No: 2016211814


DATE
27/12/2023

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016211814

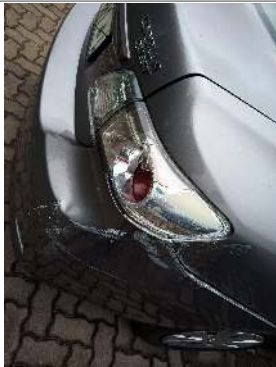DATE
27/12/2023

Tail Light Right



Seat Front Right



Seat Rear



Tyre Rear Right



Windscreen



Windscreen Wiper



CONDITION REPORT

Report No: 2016211814

DATE
27/12/2023

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za