



CONDITION REPORT



Report No:
2017010405
DATE
12/09/2025

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	12/09/2025		M57 Pretoria Road - 1619
Inspection Date	12/09/2025		Kempton Park - GT

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	MFC
Manufacturer	TOYOTA	Registration Number	KBR229MP
Model	COROLLA QUEST 1.6 AT [2016-2021]	Register Number	
VIN	AHTLB52E903137971	Date Of First Licensing	
Engine Number		Last COR	
Doors	4	License Expiry Date	
Color	WHITE	Power / Displacement	
Year Model	2019	Paint Finish	C - COMMON
Km Reading	156,231 KM	Fuel	PETROL
Cab / Body Type	SEDAN	Transmission	AUTOMATIC

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za


VIN: AHTLB52E903137971



CONDITION REPORT



Report No:
2017010405
DATE
12/09/2025

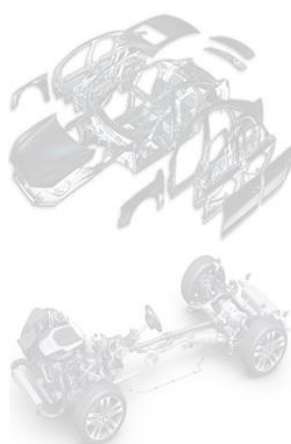

Damage	Repair Way
Engine Oil Sweat	Repair
Seat Front Left Torn / Cut	Repair
Seat Front Right Torn / Cut	Repair
Seat Rear Torn / Cut	Repair
Front Bumper Paintwork • Scratched	Repair
Front Fender Right Paintwork • Flaking	Repair
Rear Fender Left Residual Traces of Repair	Repair
Rear bumper Residual Traces of Repair	Repair
Windscreen Chipped	Replace
Shock Absorber Front Right Sweat	Replace
Tyre Front Left Excessive Wear & Tear	Replace
Tyre Rear Left Smooth	Replace
Tyre Rear Right Excessive Wear & Tear	Replace
Rim Spare Wheel Deformed	Repair
Francis pension excessive knocking noise	Repair
Body exterior	Signs of spray work done on some body panels
Body exterior	Minor dents scratches stone chips on some body pan
Body exterior	Residual traces of repair work done on some body p

Brakes

Brake Test Results

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s ²]
Front	3.4	2.8	-	
Rear	2.3	2.3	-	
Emergency / Parking	1.2	0.9	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	185/60R15	92T	Barum	Brillantis	V		0 mm
Front Right	195/65R15	91H	Autogrip	P308	V	3318	1 mm
Rear Left	195/65R15	91V	Dunlop	Sport	V	1022	0 mm
Rear Right	195/65R15	91H	Zextour	Comfort	V	2722	0 mm
Spare	195/55R15	85V	Dunlop	Sport	V	////////	2 mm

* Tyre Legend: V=Virgin, R=Recap

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AHTLB52E903137971



CONDITION REPORT



Report No:
2017010405
DATE
12/09/2025

Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

No	System	Code	Description	Status
1	ABS	C1214	LOW OR HIGH POWER SUPPLY VOLTAGE	

Inspection Conditions

No Test Drive

Battery Flat

Engine number – not possible to verify engine number (not visible without dismantling)

Inspection conditions for the vehicle inspection were sufficient

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Trevino Julius

This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AHTLB52E903137971



CONDITION REPORT



Report No:
2017010405
DATE
12/09/2025



Automatic



Bootlid lever not working.




Oil cap and dipstick



Expansion bottle



Sparewheel

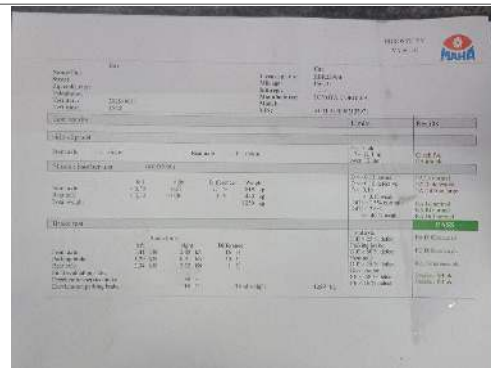

Shock and brake report

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za


VIN: AHTLB52E903137971



CONDITION REPORT



Report No:
2017010405
DATE
12/09/2025

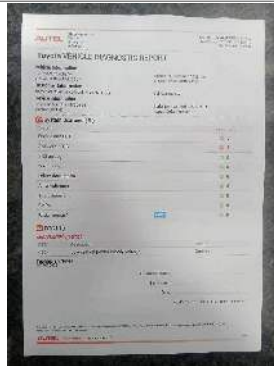

Diagnostic test



Rear end



FRONT RIGHT CORNER



REAR LEFT CORNER



INTERIOR (FRONT DRIVER DOOR)



DASHBOARD (W/ ENGINE RUNNING)

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AHTLB52E903137971



CONDITION REPORT



Report No:
2017010405
DATE
12/09/2025



ODOMETER



90 DEGREE FRONT



90 DEGREE RIGHT



90 DEGREE REAR



90 DEGREE LEFT



LF TYRE TREAD

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za


VIN: AHTLB52E903137971



CONDITION REPORT




Report No:
2017010405
DATE
12/09/2025

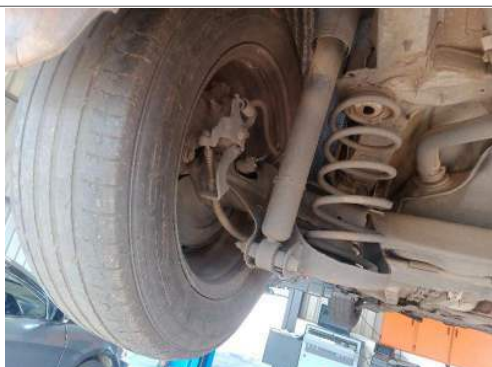

LR TYRE TREAD



RR TYRE TREAD

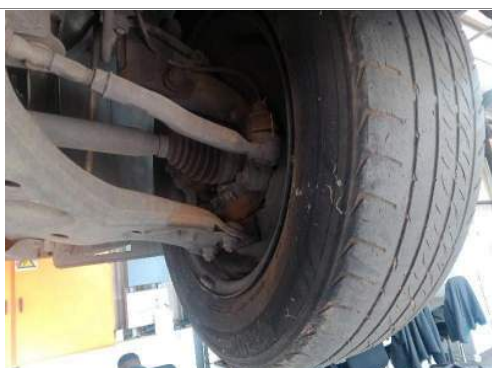

RF TYRE TREAD



LICENSE DISC



VIN PLATE OR STICKER



CHASSIS

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AHTLB52E903137971



CONDITION REPORT



Report No:
2017010405
DATE
12/09/2025



ENGINE 2



ENGINE 1




Front Fender Right



Seat Front Right



Seat Rear

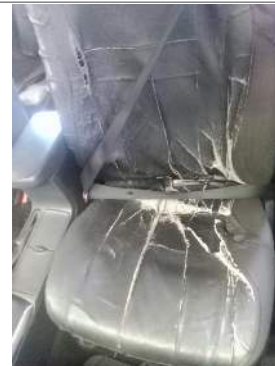

Seat Front Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AHTLB52E903137971



CONDITION REPORT



Report No:
2017010405
DATE
12/09/2025



Rim Spare Wheel



Rim Spare Wheel



Rear Fender Left



Windscreen



Windscreen



Water level

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AHTLB52E903137971



CONDITION REPORT



Report No:
2017010405
DATE
12/09/2025



Shock Absorber Front Right



Front Bumper



Front Bumper



Front Bumper



Front Bumper



Rear bumper

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AHTLB52E903137971



CONDITION REPORT



Report No:
2017010405
DATE
12/09/2025



Tyre Front Left



Tyre Rear Left



Tyre Rear Right



Engine

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AHTLB52E903137971