



CONDITION REPORT



Report No:
2016919327
DATE
20/06/2025

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	20/06/2025		M57 Pretoria Road - 1619
Inspection Date	20/06/2025		Kempton Park - GT

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	
Manufacturer	TOYOTA	Registration Number	HCN956L
Model	HI-ACE 2.5 SESFIKILE 16-S DSL MINIBUS [2021-2024]	Register Number	
VIN	AHTSS22P507157266	Date Of First Licensing	
Engine Number		Last COR	
Doors	4	License Expiry Date	30/11/2025
Color	WHITE	Power / Displacement	
Year Model	2023	Paint Finish	TWO COAT METALLIC
Km Reading	186,631 KM	Fuel	DIESEL
Cab / Body Type	STATION WAGON	Transmission	MANUAL

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za


VIN: AHTSS22P507157266



CONDITION REPORT



Report No:
2016919327
DATE
20/06/2025

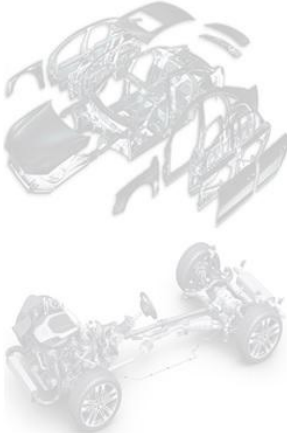	Damage	Repair Way
	Front Bumper Damaged	Repair
	Bonnet Damaged	Repair
	Rear Fender Left Damaged	Repair
	Rear Fender Right Damaged	Repair
	Door Front Left Damaged	Repair
	Door Front Right Damaged	Repair
	Door Rear Left Damaged	Repair
	Boot Lid / Hatch door Damaged	Repair
	Rear bumper Damaged	Repair
	Roof Damaged	Repair
	Windscreen Damaged	Replace
	Service Brake Performance Front Axle Left / Right	Repair
	Difference out of legal range	
	Service Brake Performance Rear Axle Left / Right	Repair
	Difference out of legal range	
	Tyre Front Left Worn	Replace
	Tyre Front Right Worn	Replace
	Tyre Rear Left Worn	Replace
	Tyre Rear Right Worn	Replace

Brakes

Brake Test Results

	Left	Right	Axle Weight [KG]	Deceleration [m/s ²]
	Braking Force [KN]	Braking Force [KN]		
Front	5.46	3.77	-	
Rear	3.05	4.64	-	
Emergency / Parking	2.24	3.13	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	195R15C	104R	Fullrun	Radial	V	1424	0 mm
Front Right	195R15C	104R	Fullrun	Radial		1424	0 mm
Rear Left	195R15C	104S	Toyo	Radial	V	3623	0 mm
Rear Right	195R15C	104R	Fullrun	Radial	V	1424	0 mm

* Tyre Legend: V=Virgin, R=Recap

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AHTSS22P507157266

**CONDITION REPORT**

Report No:
2016919327
DATE
20/06/2025

Diagnostic

During the diagnostic no active error messages were detected. (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

Inspection Conditions

No Test Drive
Battery Flat
Engine number – not possible to verify engine number (not visible without dismantling)
Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: Body • Exterior: Minor dents and scratches and stone chips to some body panels. Signs of repair work done to somebody panels. Poor alignment to somebody panels.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Werner Laubscher

This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za


VIN: AHTSS22P507157266




CONDITION REPORT



Report No:
2016919327
DATE
20/06/2025

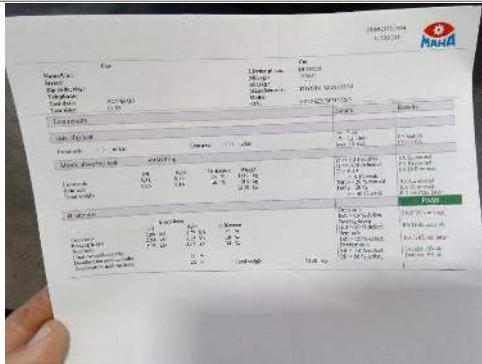

Brake test.

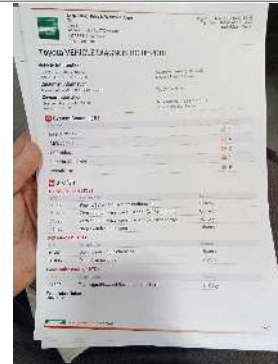

Diagnostic.



FRONT RIGHT CORNER



REAR LEFT CORNER



INTERIOR (FRONT DRIVER DOOR)



DASHBOARD (W/ ENGINE RUNNING)

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AHTSS22P507157266



CONDITION REPORT



Report No:
2016919327
DATE
20/06/2025



ODOMETER



Manual.



90 DEGREE FRONT



90 DEGREE RIGHT



90 DEGREE REAR



90 DEGREE LEFT

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AHTSS22P507157266



CONDITION REPORT



Report No:
2016919327
DATE
20/06/2025



LF TYRE TREAD



LR TYRE TREAD



RR TYRE TREAD



RF TYRE TREAD



LICENSE DISC



VIN PLATE OR STICKER

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AHTSS22P507157266



CONDITION REPORT



Report No:
2016919327
DATE
20/06/2025



ENGINE 1



Undercarriage front.



Undercarriage rear.



Oil cap and dipstick.



Water level



Front Bumper

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AHTSS22P507157266



CONDITION REPORT



Report No:
2016919327
DATE
20/06/2025



Front Bumper



Bonnet



Door Front Left



Door Rear Left



Rear Fender Left



Boot Lid / Hatch door

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AHTSS22P507157266



CONDITION REPORT



Report No:
2016919327
DATE
20/06/2025



Rear bumper



Rear Fender Right



Roof



Door Front Right



Windscreen



Tyre Rear Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AHTSS22P507157266



CONDITION REPORT



Report No:
2016919327
DATE
20/06/2025



Tyre Rear Right



Tyre Front Left



Tyre Front Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AHTSS22P507157266