

MFC Auction House  
M57 Pretoria Rd, Glenmarais, KEMPTON PARK  
Gauteng

DEKRA MFC  
M57 Pretoria Rd - 1619  
KEMPTON PARK - GT  
08610 33572



## Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	21/12/2023		M57 Pretoria Road - 1619
Inspection Date	21/12/2023		Kempton Park - GT

## Vehicle Data


Vehicle Type	MINI BUS	Registered Owner	MFC
Manufacturer	TOYOTA	Registration Number	DCH510NC
Model	QUANTUM	Register Number	
VIN	AHTSS22P907150062	Date Of First Licensing	
Engine Number		Last COR	
Doors	5	License Expiry Date	30/09/2024
Color	WHITE	Power / Displacement	
Year Model		Paint Finish	C - COMMON
Km Reading	25,419 KM	Fuel	DIESEL
Cab / Body Type	OTHERS	Transmission	MANUAL

## Vehicle Options & Accessories

### Items

## VEHICLE INSPECTION

Damage	Repair Way
Load Body Paintwork • Scratched	Repair
Service Brake Performance Front Axle Left / Right	Repair
Difference out of legal range	

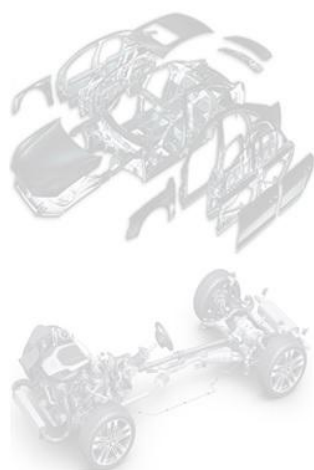

## Brakes

### Brake Test Results

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s <sup>2</sup> ]
Front	0.7	0.3	-	
Rear	3.8	4.1	-	
Emergency / Parking	2.7	3.3	-	

## Tyres and Rims

### Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	195R15	106/104S	Toyo	H07	V	1523	5 mm
Front Right	195R15	106/104S	Toyo	H07	V	1323	5 mm
Rear Left	195R15	106/104S	Toyo	H07	V	1323	2 mm
Rear Right	195R15	106/104S	Toyo	H07	V	1323	3 mm
Spare	195R15	106/104S	Toyo	H07	V	0000	6 mm

\* Tyre Legend: V=Virgin, R=Recap

## Diagnostic

During the diagnostic no active error messages were detected. (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

## Inspection Conditions

No Test Drive  
Battery Flat  
Engine number – not possible to verify engine number (not visible without dismantling)  
Inspection conditions for the vehicle inspection were sufficient

## Comments

General Comments: ACCORDING TO AGE AND MILEAGE OF VEHICLE NORMAL WEAR AND TEAR ON INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS. SHOCK TEST NOT PERFORMED DUE TO SHOCK MACHINE NOT WORKING.  
Body • Exterior: Minor dents scratches and stone chips on some body panels. Signs of spray work done on some body panels.  
Axle and Suspension: Shock test not performed.

## Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

## Technician


Trevino Julius

This document was created electronically and is valid without signature.


General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.



Shock and brake report

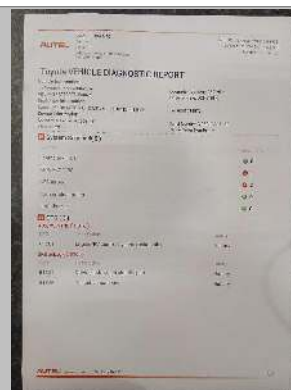


Diagnostic test

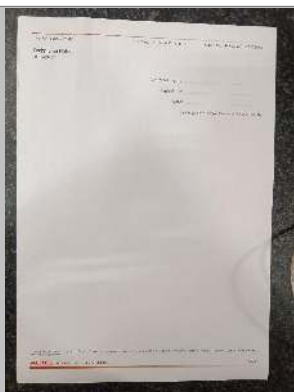

Diagnostic



Sparewheel

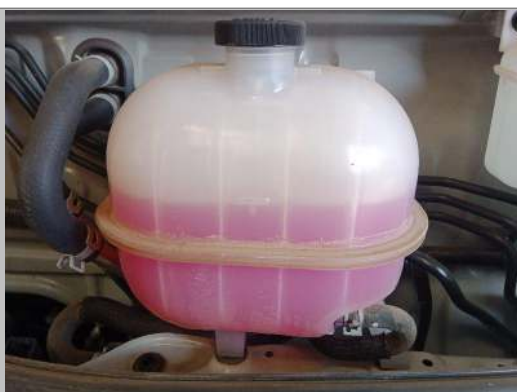

Expansion bottle



Oil cap and dipstick





Manual



Rear end



FRONT RIGHT CORNER



REAR LEFT CORNER



INTERIOR (FRONT DRIVER DOOR)



DASHBOARD (W/ ENGINE RUNNING)







ODOMETER



90 DEGREE FRONT



90 DEGREE RIGHT



90 DEGREE REAR



90 DEGREE LEFT



LF TYRE TREAD

VIN: AHTSS22P907150062

7 / 7






LR TYRE TREAD



RR TYRE TREAD

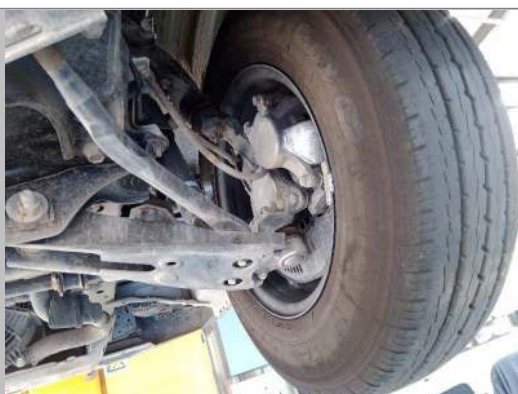

LF TYRE TREAD



LICENSE DISC



VIN PLATE OR STICKER




ENGINE 1






ENGINE 2

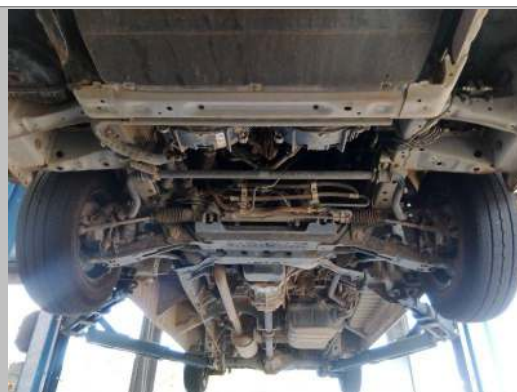

## CHASSIS

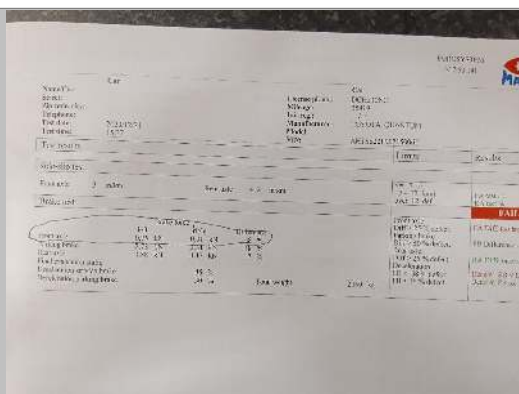

### Service Brake Performance Front Axle



Load Body



## CONDITION REPORT

Report No: 2016209474

DATE  
21/12/2023

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
[www.dekraauto.co.za](http://www.dekraauto.co.za)