



CONDITION REPORT



Report No:
2017219023
DATE
15/04/2026

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	15/04/2026		M57 Pretoria Road - 1619
Inspection Date	15/04/2026		Kempton Park - GT

Vehicle Data

Vehicle Type	LIGHT LOAD VEHICLE	Registered Owner	MFC
Manufacturer	HYUNDAI	Registration Number	FYS419L
Model	H-100 BAKKIE 2.6 EURO II DECK AC DSL PU [2020-ON]	Register Number	
VIN	KMFZBX7BLPU019805	Date Of First Licensing	
Engine Number		Last COR	
Doors	2	License Expiry Date	31/10/2026
Color	WHITE	Power / Displacement	
Year Model	2023	Paint Finish	C - COMMON
Km Reading	118,383 KM	Fuel	DIESEL
Cab / Body Type	SINGLE CAB	Transmission	MANUAL

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za


VIN: KMFZBX7BLPU019805



CONDITION REPORT



Report No:
2017219023
DATE
15/04/2026

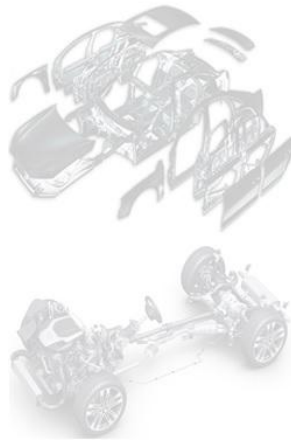

Damage	Repair Way
Seat Front Right Torn / Cut	Repair
Bonnet Paintwork • Chipmarks	Repair
Front Fender Left Dented	Repair
Door Front Right Dented	Repair
Rear bumper Paintwork • Scratched	Repair
Windscreen Cracked	Replace
Parking Brake Performance Left / Right Difference out of legal range	Repair

Brakes

Brake Test Results

	Left	Right	Axle Weight [KG]	Deceleration [m/s ²]
	Braking Force [KN]	Braking Force [KN]		
Front	3.4	3.1	-	
Rear	0.8	0.7	-	
Emergency / Parking	0.1	0.6	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	195/70R15	104/102R	Autogrip	Vanax	V	3224	1 mm
Front Right	195/70R15	104/102S	Nexen	CP321	V	4722	1 mm
Rear Left	195/70R15	104/102R	Autogrip	Vanmax	V	4324	2 mm
Rear Right	195/70R15	104/102R	Autogrip	Vanmax	V	3224	2 mm

* Tyre Legend: V=Virgin, R=Recap

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: KMFZBX7BLPU019805



CONDITION REPORT



Report No:
2017219023
DATE
15/04/2026

Diagnostic

During the diagnostic no active error messages were detected. (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

Inspection Conditions

No Test Drive
Battery Flat
Engine number – not possible to verify engine number (not visible without dismantling)
Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Trevino Julius

This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za


VIN: KMFZBX7BLPU019805




CONDITION REPORT



Report No: 2017219023
DATE 15/04/2026

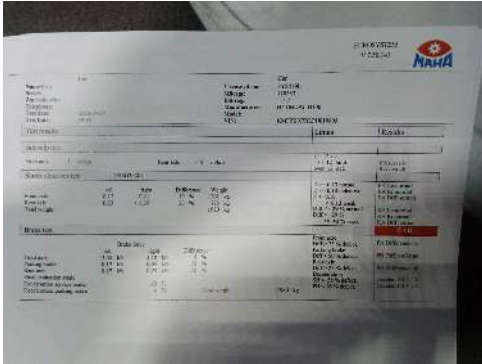

Shock and brake report

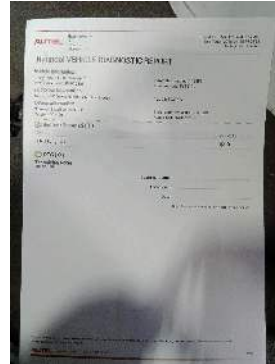

Diagnostic report



FRONT RIGHT CORNER



REAR LEFT CORNER



INTERIOR (FRONT DRIVER DOOR)



DASHBOARD (W/ ENGINE RUNNING)

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: KMFZBX7BLPU019805



CONDITION REPORT



Report No:
2017219023
DATE
15/04/2026



ODOMETER



Manual



90 DEGREE FRONT



90 DEGREE RIGHT



90 DEGREE REAR



90 DEGREE LEFT

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za


VIN: KMFZBX7BLPU019805



CONDITION REPORT



Report No: 2017219023
DATE 15/04/2026

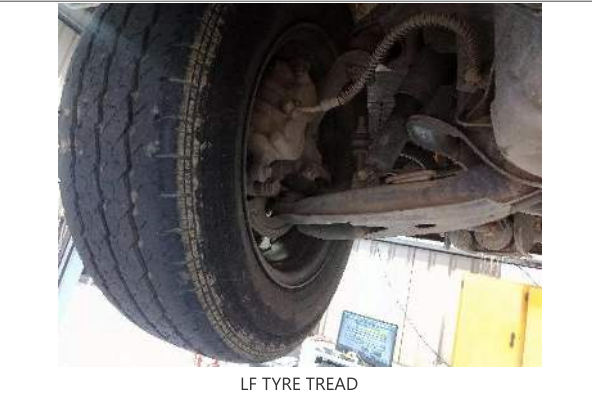


LF TYRE TREAD



LR TYRE TREAD



RR TYRE TREAD

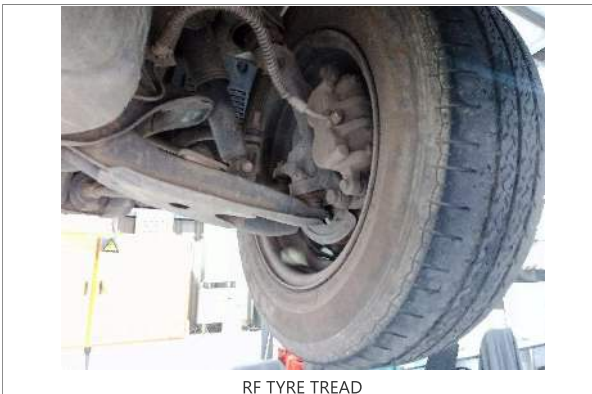

RF TYRE TREAD



LICENSE DISC



VIN PLATE OR STICKER

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: KMFZBX7BLPU019805



CONDITION REPORT



Report No:
2017219023
DATE
15/04/2026




ENGINE 1



CHASSIS



Rear end

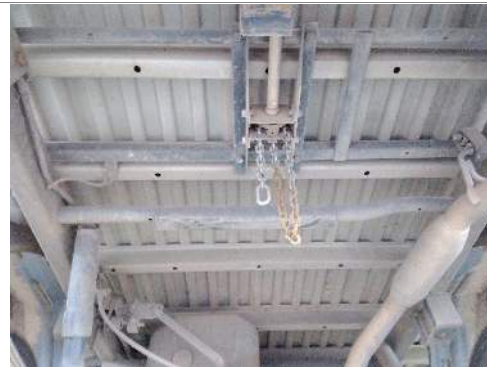

No sparewheel



Oil cap and dipstick



Coolant reservoir

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: KMFZBX7BLPU019805



CONDITION REPORT



Report No:
2017219023
DATE
15/04/2026



ENGINE 2



Seat Front Right



Door Front Right



Front Fender Left



Rear bumper



Rear bumper

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: KMFZBX7BLPU019805



CONDITION REPORT



Report No:
2017219023
DATE
15/04/2026




Bonnet



Windscreen



Water level

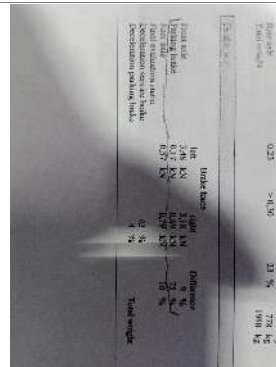

Parking Brake Performance

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: KMFZBX7BLPU019805