



CONDITION REPORT



Report No:
2016994513
DATE
28/08/2025

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	29/08/2025		M57 Pretoria Road - 1619
Inspection Date	28/08/2025		Kempton Park - GT

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	MFC AUCTION HOUSE
Manufacturer	HYUNDAI	Registration Number	FR27YNGP
Model	ACCENT 1.6 MOTION 6-SP [2013-2021]	Register Number	
VIN	KMHCT41DLHU240223	Date Of First Licensing	
Engine Number		Last COR	
Doors	5	License Expiry Date	
Color	GREY	Power / Displacement	
Year Model	2017	Paint Finish	TWO COAT METALLIC
Km Reading	212,837 KM	Fuel	PETROL
Cab / Body Type	SEDAN	Transmission	MANUAL

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za


VIN: KMHCT41DLHU240223



CONDITION REPORT



Report No:
2016994513
DATE
28/08/2025

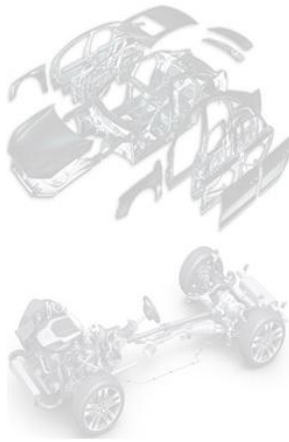

Damage	Repair Way
Engine Oil Leak	Repair
Switch Electrical Window Winder front left Defective	Repair
Switch Electrical Window Winder front right Damaged	Repair
Tail Light Right Damaged	Repair
Front Bumper Damaged	Repair
Bonnet Damaged	Repair
Front Fender Left Damaged	Repair
Front Fender Right Damaged	Repair
Rear Fender Left Damaged	Repair
Rear Fender Right Damaged	Repair
Door Front Left Damaged	Repair
Door Front Right Damaged	Repair
Door Rear Left Damaged	Repair
Door Rear Right Damaged	Repair
Boot Lid / Hatch door Damaged	Repair
Rear bumper Damaged	Repair
Roof Damaged	Repair
Tyre Front Left Worn	Replace
Tyre Front Right Worn	Replace
Tyre Rear Left Worn	Replace
Tyre Rear Right Worn	Replace
Main Beam Right Damaged	Replace

Brakes

Brake Test Results

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s ²]
Front	3.11	2.15	-	
Rear	2.3	2.42	-	
Emergency / Parking	2.3	2.42	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	175/65R14	82H	Firestone	Radial	V	1721	0 mm
Front Right	175/65R14	82T	Hankook	Radial	V	2417	0 mm
Rear Left	185/60R14	82H	Landgema	Radial	V	1423	0 mm
Rear Right	175/65R14	82T	Hankook	Radial	V	2815	0 mm

* Tyre Legend: V=Virgin, R=Recap

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: KMHCT41DLHU240223



CONDITION REPORT



Report No:
2016994513
DATE
28/08/2025

Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

No	System	Code	Description	Status
1	ENG	P0122	THROTTLE POSITION SENSOR.	

Inspection Conditions

No Test Drive

Battery Flat

Engine number – not possible to verify engine number (not visible without dismantling)

Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: 5 DTC'S AT TIME OF TESTING SEE DTC REPORT.ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS.Engine Compartment: Battery loose.

Electrical Components and Instruments: driver side window and passionate side window opens with left front driver side electric window switch.

Body • Exterior: Minor dents and scratches and stone chips to some body panels. Signs of repair work done to somebody panels. Poor alignment to somebody panels. Vehicle body in poor condition. Repair work done to vehicle below standard. Signs of impact damage to front of vehicle. Signs of hail damage to some body panels.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Werner Laubscher

This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: KMHCT41DLHU240223



CONDITION REPORT



Report No:
2016994513
DATE
28/08/2025



FRONT RIGHT CORNER



REAR LEFT CORNER



90 DEGREE RIGHT



90 DEGREE LEFT



90 DEGREE FRONT



90 DEGREE REAR

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: KMHCT41DLHU240223



CONDITION REPORT



Report No:
2016994513
DATE
28/08/2025



ODOMETER



DASHBOARD (W/ ENGINE RUNNING)



INTERIOR (FRONT DRIVER DOOR)



Manual.



LR TYRE TREAD



LF TYRE TREAD

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: KMHCT41DLHU240223



CONDITION REPORT



Report No:
2016994513
DATE
28/08/2025



RR TYRE TREAD



RF TYRE TREAD



Undercarriage front.



Undercarriage rear.



Oil cap and dipstick.



ENGINE 1

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: KMHCT41DLHU240223



CONDITION REPORT




Report No:
2016994513
DATE
28/08/2025




VIN PLATE OR STICKER



LICENSE DISC

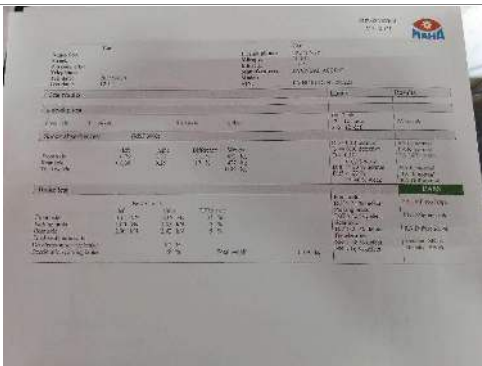

BRAKE TEST REPORT

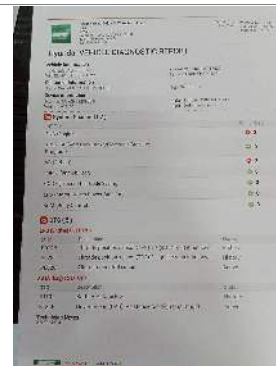

DIAGNOSTIC REPORT



Water level



Front Bumper

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: KMHCT41DLHU240223



CONDITION REPORT



Report No:
2016994513
DATE
28/08/2025



Front Bumper



Bonnet



Front Fender Left



Rear Fender Left



Door Front Left



Door Rear Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: KMHCT41DLHU240223



CONDITION REPORT



Report No:
2016994513
DATE
28/08/2025



Rear bumper



Rear bumper



Boot Lid / Hatch door



Door Front Right



Door Rear Right



Front Fender Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: KMHCT41DLHU240223



CONDITION REPORT



Report No:
2016994513
DATE
28/08/2025



Rear Fender Right




Switch Electrical Window Winder front right



Switch Electrical Window Winder front left



Roof

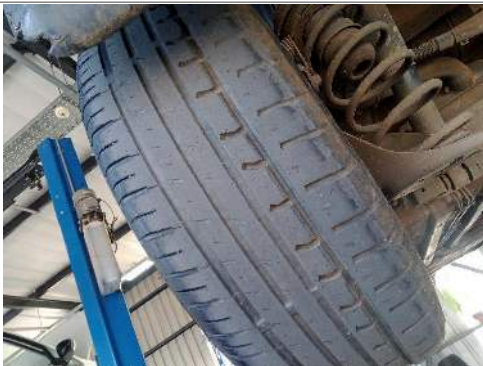

Tyre Rear Left



Tyre Rear Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: KMHCT41DLHU240223



CONDITION REPORT



Report No:
2016994513
DATE
28/08/2025



Tyre Front Left



Tyre Front Right



Engine



Main Beam Right



Tail Light Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: KMHCT41DLHU240223