



CONDITION REPORT

Report No: 2016866320

DATE
06/05/2025

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	06/05/2025		M57 Pretoria Road - 1619
Inspection Date	06/05/2025		Kempton Park - GT

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	
Manufacturer	HYUNDAI	Registration Number	KYB411NW
Model	VELOSTER 1.6 GDI 3-DR EXECUTIVE DCT [2011-2017]	Register Number	
VIN	KMHTC61DLDU143015	Date Of First Licensing	
Engine Number		Last COR	
Doors	4	License Expiry Date	30/09/2025
Color	GREY	Power / Displacement	
Year Model	2013	Paint Finish	M - METALLIC
Km Reading	150,842 KM	Fuel	PETROL
Cab / Body Type	HATCHBACK	Transmission	MANUAL

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

Damage	Repair Way
Seat Rear Defective	Repair
Side Mirror Right Paintwork • Scratched	Repair
Front Bumper Paintwork • Scratched	Repair
Bonnet Dented	Repair
Front Fender Right Paintwork • Scratched	Repair
Rear Fender Right Paintwork • Scratched	Repair
Door Front Right Dented	Repair
Door Rear Left Dented	Repair
Rear bumper Damaged	Repair
Windscreen Cracked	Replace
Tyre Front Right Damaged	Replace
Tyre Rear Right Damaged	Replace
Spare Tyre Smooth	Replace
Body exterior	Vehicle has minor scratches, stone chips and dents

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: KMHTC61DLDU143015



CONDITION REPORT

Report No: 2016866320

DATE
06/05/2025

Brakes

Brake Test Results

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s ²]
Front	2.9	3.8	-	
Rear	2.0	2.0	-	
Emergency / Parking	1.6	1.9	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	225/45R18	95W	Dunlop	Lemans	V	1617	2 mm
Front Right	225/40R18	92Y	Dunlop	Sp sport	V	1421	0 mm
Rear Left	225/40R18	92W	Three-A	P606	V	3920	3 mm
Rear Right	235/40R18	95Y	Continental	Contact	V	4422	0 mm
Spare	T125/80D15	95M	Hankook	S400	V	0313	0 mm

* Tyre Legend: V=Virgin, R=Recap

Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

No	System	Code	Description	Status
1	PENDING	P0326	KNOCK SENSOR 1 CIRCUIT RANGE/ PERFORMANCE (BANK 1)	

Inspection Conditions

No Test Drive
 Battery Flat
 Engine number – not possible to verify engine number (not visible without dismantling)
 Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL, AND MECHANICAL PARTS.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Andrick Wymers

This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.


DEKRA Automotive (PTY) Ltd.
 97 Willem Cruywagen Ave
 Klerksoord, Pretoria, 0200
 Phone: 012 542 4867
 www.dekraauto.co.za

VIN: KMHTC61DLDU143015



CONDITION REPORT


Report No: 2016866320

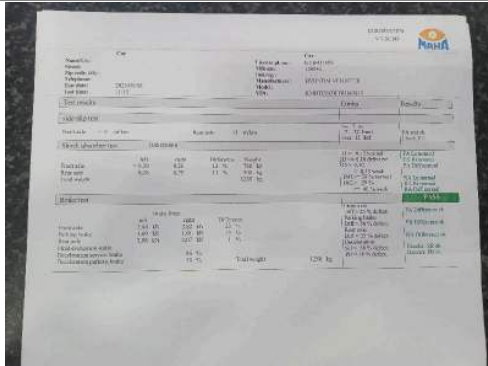DATE
06/05/2025

Shock and brake report



Diagnostic report

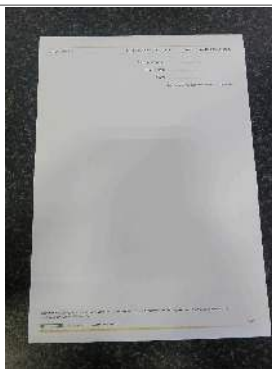

Diagnostic report



Manual



Spare wheel



Coolant bottle

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: KMHTC61DLDU143015



CONDITION REPORT

Report No: 2016866320

DATE
06/05/2025

Oil cap and dipstick



FRONT RIGHT CORNER



REAR LEFT CORNER



INTERIOR (FRONT DRIVER DOOR)



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: KMHTC61DLDU143015



CONDITION REPORT


Report No: 2016866320

DATE
06/05/2025

90 DEGREE FRONT




90 DEGREE RIGHT

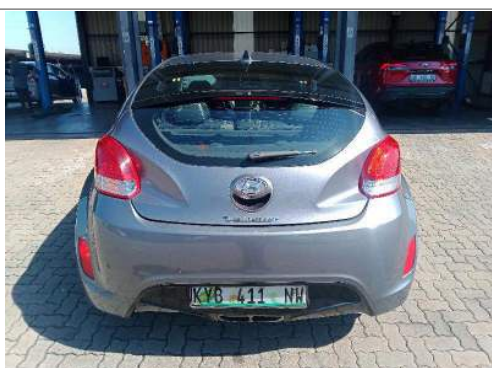

90 DEGREE REAR



90 DEGREE LEFT

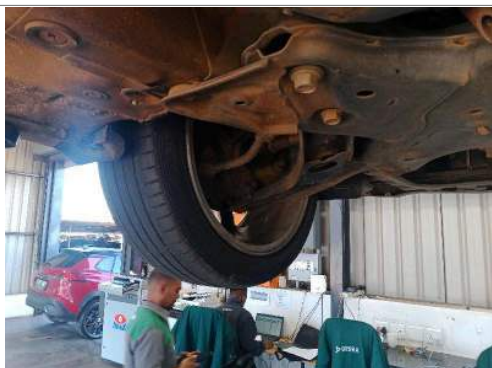

LF TYRE TREAD



LR TYRE TREAD

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: KMHTC61DLDU143015



CONDITION REPORT

Report No: 2016866320

DATE
06/05/2025

RR TYRE TREAD



RF TYRE TREAD



LICENSE DISC



VIN PLATE OR STICKER



ENGINE 1



ENGINE 2

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: KMHTC61DLDU143015



CONDITION REPORT

Report No: 2016866320

DATE
06/05/2025

CHASSIS



Seat Rear



Windscreen



Spare Tyre



Water level



Bonnet

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: KMHTC61DLDU143015



CONDITION REPORT

Report No: 2016866320

DATE
06/05/2025

Side Mirror Right



Rear Fender Right



Door Front Right



Front Fender Right



Front Bumper



Door Rear Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: KMHTC61DLDU143015



CONDITION REPORT

Report No: 2016866320

DATE
06/05/2025

Rear bumper



Tyre Rear Right



Tyre Front Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: KMHTC61DLDU143015