



CONDITION REPORT



Report No:
2016903345
DATE
05/06/2025

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	05/06/2025		M57 Pretoria Road - 1619
Inspection Date	05/06/2025		Kempton Park - GT

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	
Manufacturer	KIA	Registration Number	JP32ZSGP
Model	PICANTO	Register Number	
VIN	KNAB2511LKT401009	Date Of First Licensing	
Engine Number		Last COR	
Doors	5	License Expiry Date	31/08/2025
Color	YELLOW	Power / Displacement	
Year Model		Paint Finish	TWO COAT METALLIC
Km Reading	118,048 KM	Fuel	PETROL
Cab / Body Type	HATCHBACK	Transmission	MANUAL

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za


VIN: KNAB2511LKT401009



CONDITION REPORT



Report No:
2016903345
DATE
05/06/2025

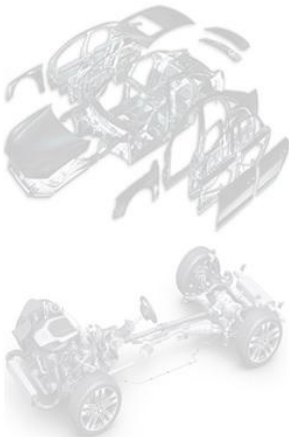	Damage	Repair Way
	Tail Light Right Damaged	Replace
	Front Bumper Damaged	Repair
	Bonnet Damaged	Repair
	Front Fender Left Damaged	Repair
	Front Fender Right Damaged	Repair
	Rear Fender Left Damaged	Repair
	Rear Fender Right Damaged	Repair
	Door Front Left Damaged	Repair
	Door Front Right Damaged	Repair
	Door Rear Left Damaged	Repair
	Door Rear Right Damaged	Repair
	Boot Lid / Hatch door Damaged	Repair
	Rear bumper Damaged	Repair
	Radiator Cradle Damaged	Replace

Brakes
Brake Test Results

	Left	Right	Axle Weight [KG]	Deceleration [m/s²]
	Braking Force [KN]	Braking Force [KN]		
Front	2.24	2.38	-	
Rear	1.29	1.28	-	
Emergency / Parking	1.13	1.21	-	

Tyres and Rims
Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	175/70R13	82T	Durun	Radial		4723	2 mm
Front Right	175/70R13	82T	Durun	Rad	V	4723	2 mm
Rear Left	175/70R13	82T	Durun	Radial	V	4323	2 mm
Rear Right	175/70R13	82T	Durun	Radial	V	4723	2 mm

* Tyre Legend: V=Virgin, R=Recap

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: KNAB2511LKT401009

**CONDITION REPORT**

Report No:
2016903345
DATE
05/06/2025

Diagnostic

During the diagnostic no active error messages were detected. (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

Inspection Conditions

No Test Drive
Battery Flat
Engine number – not possible to verify engine number (not visible without dismantling)
Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS. Body • Exterior: Minor dents and scratches and stone chips to some body panels. Signs of repair work done to somebody panels. Poor alignment to somebody panels.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Werner Laubscher

This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za


VIN: KNAB2511LKT401009




CONDITION REPORT



Report No:
2016903345
DATE
05/06/2025

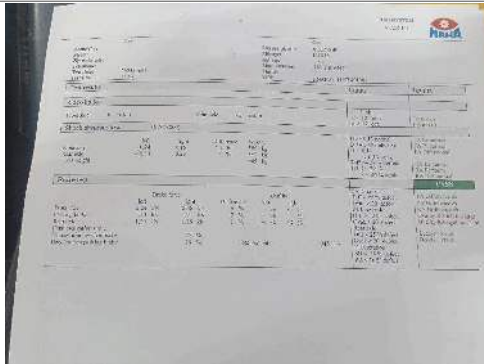

Brake test.

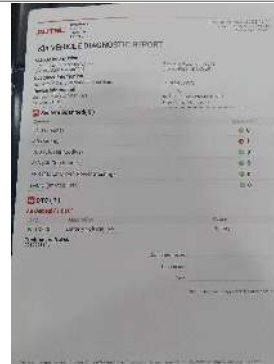

Diagnostic.



FRONT RIGHT CORNER



REAR LEFT CORNER



INTERIOR (FRONT DRIVER DOOR)



DASHBOARD (W/ ENGINE RUNNING)

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: KNAB2511LKT401009



CONDITION REPORT



Report No:
2016903345
DATE
05/06/2025



ODOMETER



Manual.



90 DEGREE FRONT



90 DEGREE RIGHT



90 DEGREE REAR



90 DEGREE LEFT

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: KNAB2511LKT401009



CONDITION REPORT



Report No:
2016903345
DATE
05/06/2025



LF TYRE TREAD



LR TYRE TREAD



RR TYRE TREAD



RF TYRE TREAD



LICENSE DISC



VIN PLATE OR STICKER

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: KNAB2511LKT401009



CONDITION REPORT



Report No:
2016903345
DATE
05/06/2025



ENGINE 1



Undercarriage front.




Undercarriage rear.



Oil cap and dipstick.



Water level

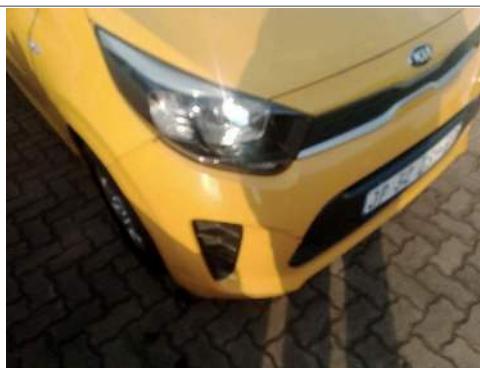

Front Bumper

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za


VIN: KNAB2511LKT401009



CONDITION REPORT




Report No:
2016903345
DATE
05/06/2025

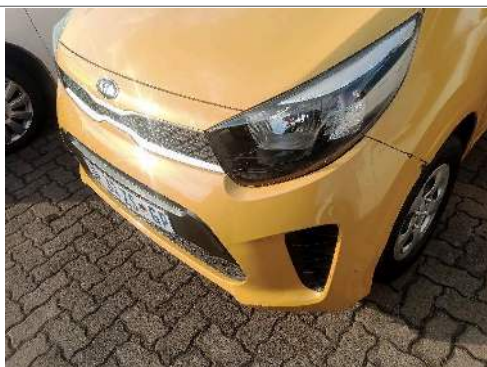

Front Bumper



Bonnet

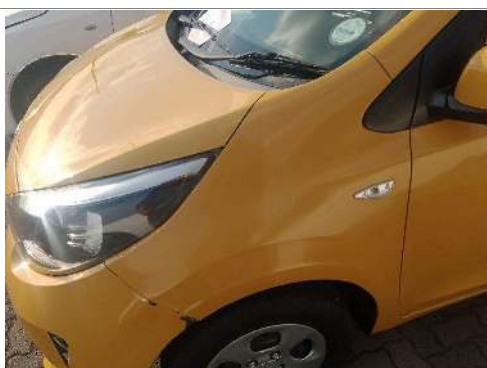

Front Fender Left



Door Front Left



Door Rear Left



Rear Fender Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: KNAB2511LKT401009



CONDITION REPORT



Report No:
2016903345
DATE
05/06/2025



Rear bumper



Rear bumper



Boot Lid / Hatch door



Door Rear Right



Door Front Right



Front Fender Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: KNAB2511LKT401009



CONDITION REPORT



Report No:
2016903345
DATE
05/06/2025



Rear Fender Right



Tail Light Right



Radiator Cradle

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: KNAB2511LKT401009