



CONDITION REPORT



Report No:
2016991004
DATE
26/08/2025

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	29/08/2025		M57 Pretoria Road - 1619
Inspection Date	26/08/2025		Kempton Park - GT

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	
Manufacturer	HYUNDAI	Registration Number	LS22HGGP
Model	GRAND CRETA	Register Number	
VIN	MALPC815LPM836458	Date Of First Licensing	
Engine Number		Last COR	
Doors	5	License Expiry Date	31/03/2025
Color	BLUE	Power / Displacement	
Year Model		Paint Finish	M - METALLIC
Km Reading	29,668 KM	Fuel	PETROL
Cab / Body Type	STATION WAGON	Transmission	MANUAL

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za


VIN: MALPC815LPM836458



CONDITION REPORT



Report No:
2016991004
DATE
26/08/2025

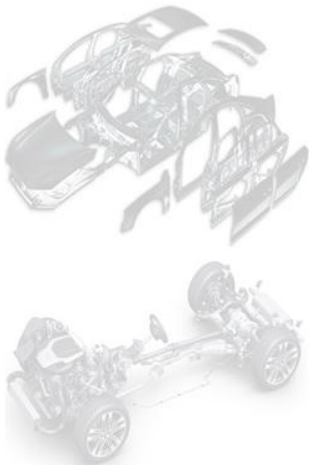

Damage	Repair Way
Door Rear Left Dented	Repair
Warning lights illuminated	Repair

Brakes

Brake Test Results

	Left	Right	Axle Weight [KG]	Deceleration [m/s ²]
	Braking Force [KN]	Braking Force [KN]		
Front	2.2	2.3	-	
Rear	1.9	2.2	-	
Emergency / Parking	1.9	2.1	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	215/60R17	96H	Jk tyre	Royale	V	4622	5 mm
Front Right	215/60R17	96H	Jk tyre	Royale	V	4622	5 mm
Rear Left	215/60R17	96H	Jk tyre	Royale	V	4622	5 mm
Rear Right	215/60R17	96H	Jk tyre	Royale	V	4622	5 mm
Spare	215/60R17	96H	Jk tyre	Royale	V	///////	6 mm

* Tyre Legend: V=Virgin, R=Recap

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MALPC815LPM836458

**CONDITION REPORT**

Report No:
2016991004
DATE
26/08/2025

Diagnostic

During the diagnostic no active error messages were detected. (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

Inspection Conditions

No Test Drive
Battery Flat
Engine number – not possible to verify engine number (not visible without dismantling)
Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: SIGNS OF SPRAY WORK DONE ON SOME BODY PANELS. BOTTOM OF ENGINE IS FULLY COVERED. ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Trevino Julius

This document was created electronically and is valid without signature.

General Remarks:

The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MALPC815LPM836458



CONDITION REPORT



Report No:

2016991004

DATE

26/08/2025



FRONT RIGHT CORNER



90 DEGREE FRONT



90 DEGREE LEFT



REAR LEFT CORNER



90 DEGREE REAR



90 DEGREE RIGHT

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MALPC815LPM836458



CONDITION REPORT



Report No:
2016991004
DATE
26/08/2025



INTERIOR (FRONT DRIVER DOOR)



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER



Manual



LICENSE DISC



VIN PLATE OR STICKER

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MALPC815LPM836458



CONDITION REPORT



Report No:
2016991004
DATE
26/08/2025



Sparewheel




ENGINE 1



Oil cap and dipstick



Coolant reservoir

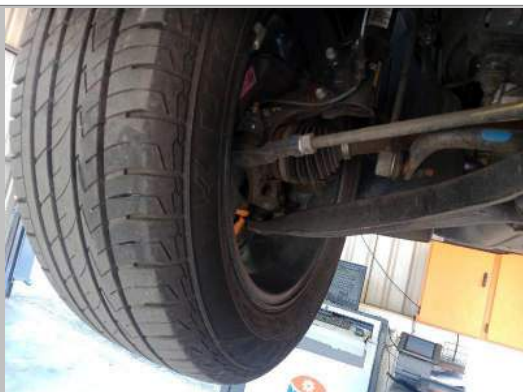

LF TYRE TREAD



LR TYRE TREAD

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za


VIN: MALPC815LPM836458




CONDITION REPORT



Report No:
2016991004
DATE
26/08/2025

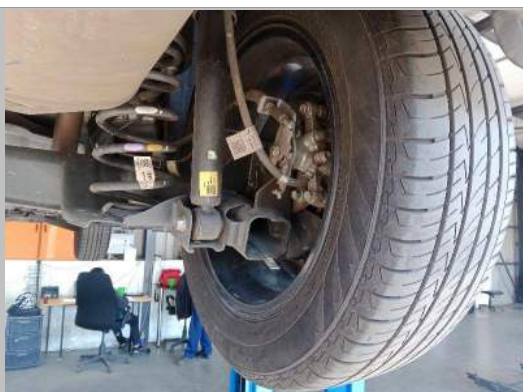

RR TYRE TREAD

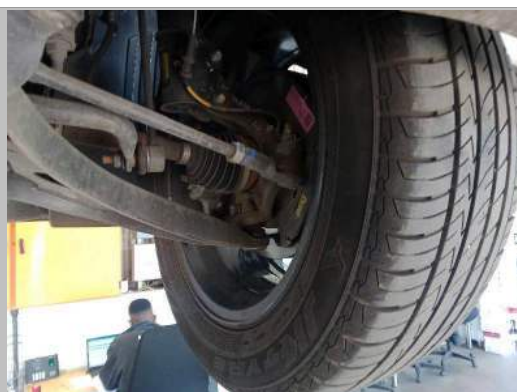

RF TYRE TREAD



Sparewheel



ENGINE 2



CHASSIS



Warning lights

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za


VIN: MALPC815LPM836458



CONDITION REPORT




Report No:
2016991004
DATE
26/08/2025

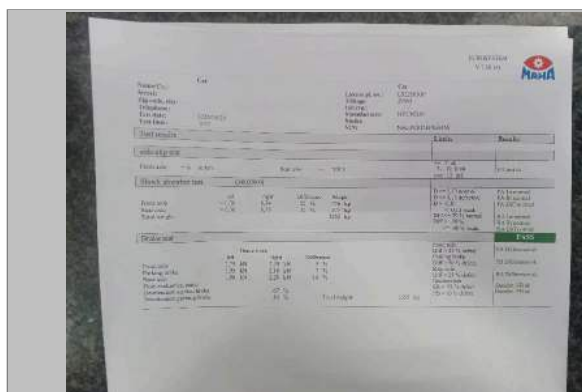

Shock and



Diagnostic test

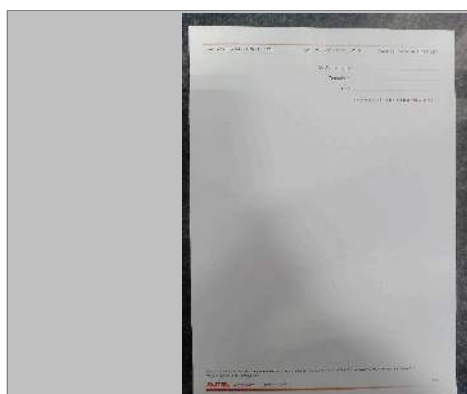

Diagnostic test



Water level



Water level




Door Rear Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MALPC815LPM836458

**CONDITION REPORT**

Report No:
2016991004
DATE
26/08/2025

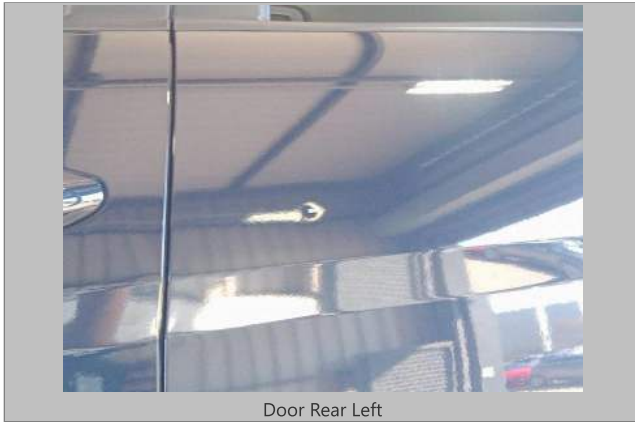

Door Rear Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MALPC815LPM836458