



## CONDITION REPORT



Report No:  
2016994659  
DATE  
28/08/2025

MFC Auction House  
M57 Pretoria Rd, Glenmarais, KEMPTON PARK  
Gauteng

DEKRA MFC  
M57 Pretoria Rd - 1619  
KEMPTON PARK - GT  
08610 33572



## Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	29/08/2025		M57 Pretoria Road - 1619
Inspection Date	28/08/2025		Kempton Park - GT

## Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	MFC AUCTION HOUSE
Manufacturer	SUZUKI	Registration Number	LF55CZGP
Model	DZIRE 1.2 GL MC AMT [2020-ON]	Register Number	
VIN	MBHCZF63S00370234	Date Of First Licensing	
Engine Number		Last COR	
Doors	4	License Expiry Date	
Color	WHITE	Power / Displacement	
Year Model	2023	Paint Finish	TWO COAT UNI
Km Reading	62,398 KM	Fuel	PETROL
Cab / Body Type	SEDAN	Transmission	AUTOMATIC

## Vehicle Options &amp; Accessories

## Items

## VEHICLE INSPECTION

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za

VIN: MBHCZF63S00370234



CONDITION REPORT



Report No:  
2016994659  
DATE  
28/08/2025

Damage	Repair Way
Front Bumper Damaged	Repair
Bonnet Damaged	Repair
Front Fender Left Damaged	Repair
Rear Fender Left Damaged	Repair
Rear Fender Right Damaged	Repair
Door Front Left Damaged	Repair
Door Rear Left Damaged	Repair
Boot Lid / Hatch door Damaged	Repair
Rear bumper Damaged	Repair



Brakes  
Brake Test Results

	Left	Right	Axle Weight [KG]	Deceleration [m/s²]
	Braking Force [KN]	Braking Force [KN]		
Front	2.0	1.79	-	
Rear	1.32	1.54	-	
Emergency / Parking	1.06	1.02	-	

Tyres and Rims  
Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	185/65R15	88H	Apollo	Radial	V	4922	4 mm
Front Right	185/65R15	88H	Apollo	Radial	V	4922	5 mm
Rear Left	185/65R15	88H	Apollo	Radial	V	4922	4 mm
Rear Right	185/65R15	88H	Apollo	Radial	V	4922	4 mm

\* Tyre Legend: V=Virgin, R=Recap

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za

VIN: MBHCZF63S00370234



## CONDITION REPORT



Report No:  
2016994659  
DATE  
28/08/2025

## Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

No	System	Code	Description	Status
1	ABS/ESP	U0126	LAST COMMUNICATION WITH STEERING ANGLE SENSOR MODE	

## Inspection Conditions

No Test Drive  
Battery Flat  
Engine number – not possible to verify engine number (not visible without dismantling)  
Inspection conditions for the vehicle inspection were sufficient

## Comments

General Comments: 5 DTC'S AT TIME OF TESTING SEE DTC REPORT.ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS.Body • Exterior: Minor dents and scratches and stone chips to some body panels. Signs of repair work done to somebody panels. Poor alignment to somebody panels.

## Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

## Technician

Werner Laubscher

This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za

VIN: MBHCZF63S00370234



## CONDITION REPORT



Report No:  
2016994659  
DATE  
28/08/2025



FRONT RIGHT CORNER



REAR LEFT CORNER



90 DEGREE RIGHT



90 DEGREE FRONT



90 DEGREE LEFT



90 DEGREE REAR

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksord, Pretoria, 0200  
Phone: 012 542 4867  
[www.dekraauto.co.za](http://www.dekraauto.co.za)

VIN: MBHCZF63S00370234





## CONDITION REPORT



Report No:  
2016994659  
DATE  
28/08/2025



ODOMETER



DASHBOARD (W/ ENGINE RUNNING)




INTERIOR (FRONT DRIVER DOOR)



Automatic.



LF TYRE TREAD

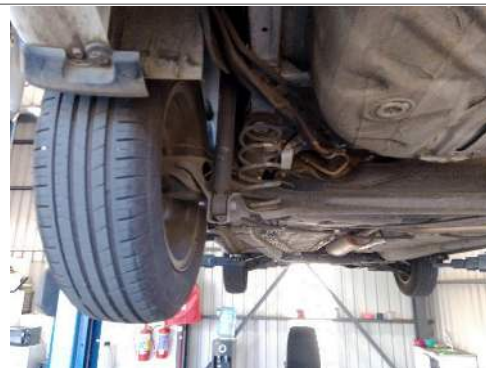

LR TYRE TREAD

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za

VIN: MBHCZF63S00370234



## CONDITION REPORT



Report No:  
2016994659  
DATE  
28/08/2025



RR TYRE TREAD



RF TYRE TREAD



Oil cap and dipstick.



Undercarriage front.



Undercarriage rear.



ENGINE 1

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksord, Pretoria, 0200  
Phone: 012 542 4867  
[www.dekraauto.co.za](http://www.dekraauto.co.za)

VIN: MBHCZF63S00370234





## CONDITION REPORT




Report No:  
2016994659  
DATE  
28/08/2025




VIN PLATE OR STICKER




LICENSE DISC

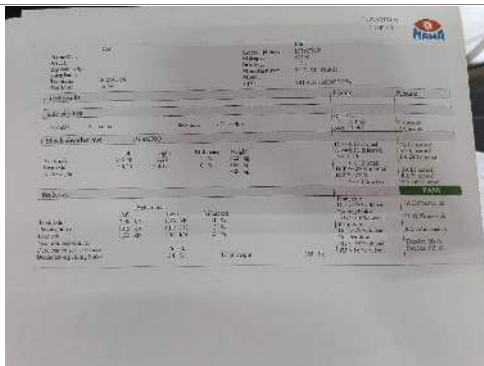

BRAKE TEST REPORT

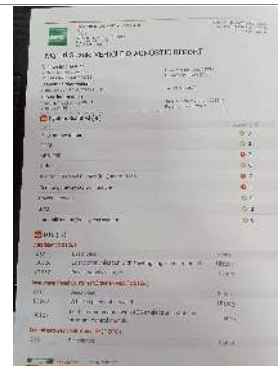

DIAGNOSTIC REPORT PAGE 1

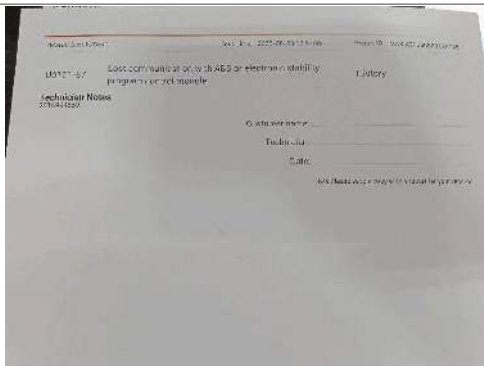

DIAGNOSTIC REPORT PAGE 2



Water level

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za

VIN: MBHCZF63S00370234



## CONDITION REPORT



Report No:  
2016994659  
DATE  
28/08/2025



Front Bumper



Front Bumper




Bonnet



Front Fender Left



Rear Fender Left

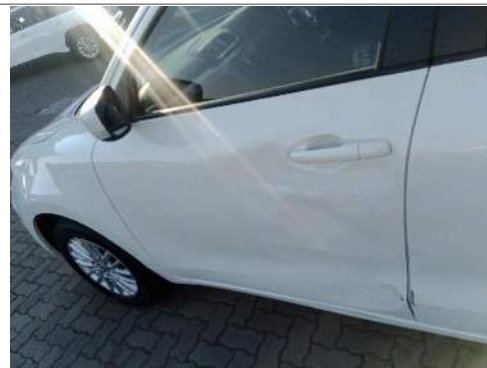

Door Front Left

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
[www.dekraauto.co.za](http://www.dekraauto.co.za)

VIN: MBHCZF63S00370234





## CONDITION REPORT



Report No:  
2016994659  
DATE  
28/08/2025



Door Rear Left




Rear bumper



Rear bumper



Boot Lid / Hatch door

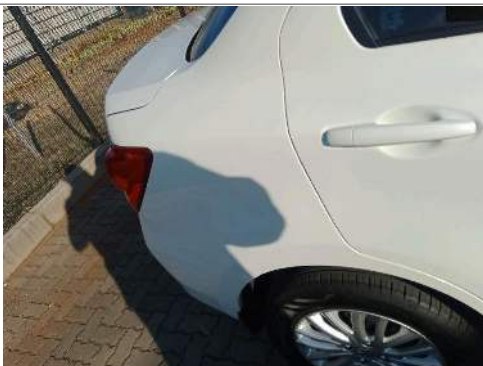

Rear Fender Right

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za

VIN: MBHCZF63S00370234