



CONDITION REPORT



Report No:
2016931175
DATE
01/07/2025

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	01/07/2025		M57 Pretoria Road - 1619
Inspection Date	01/07/2025		Kempton Park - GT

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	MFC
Manufacturer	NISSAN	Registration Number	ND870289
Model	ALMERA 1.5 ACENTA AT [2016-2024]	Register Number	
VIN	MDHBBAN17Z0733091	Date Of First Licensing	
Engine Number		Last COR	
Doors	4	License Expiry Date	31/07/2024
Color	SILVER	Power / Displacement	
Year Model	2021	Paint Finish	TWO COAT METALLIC
Km Reading	67,553 KM	Fuel	PETROL
Cab / Body Type	SEDAN	Transmission	AUTOMATIC

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za


VIN: MDHBBAN17Z0733091



CONDITION REPORT



Report No:
2016931175
DATE
01/07/2025

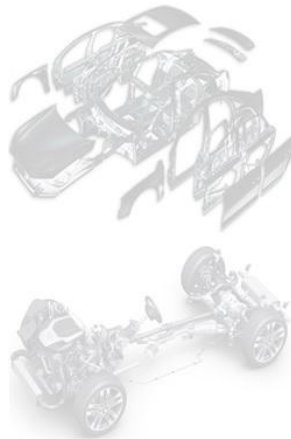

Damage

Repair Way

Engine Management Lights Set	Repair
Front Bumper Damaged	Repair
Bonnet Damaged	Repair
Front Fender Left Damaged	Repair
Front Fender Right Damaged	Repair
Rear Fender Left Damaged	Repair
Rear Fender Right Damaged	Repair
Door Front Left Damaged	Repair
Door Front Right Damaged	Repair
Door Rear Left Damaged	Repair
Door Rear Right Damaged	Repair
Boot Lid / Hatch door Damaged	Repair
Rear bumper Damaged	Repair
Windscreen Damaged	Repair
Shock Absorber Rear Left Leak	Replace
Shock Absorber Rear Right Worn	Replace

Brakes

Brake Test Results

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s ²]
Front	2.63	2.34	-	
Rear	2.17	1.87	-	
Emergency / Parking	1.24	0.95	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	185/65R15	88H	Goodyear	Efficient	V	3923	2 mm
Front Right	185/65R15	88H	Goodyear	Efficient	V	3923	2 mm
Rear Left	185/65R15	88H	Goodyear	Efficient	V	3923	2 mm
Rear Right	185/65R15	88H	Goodyear	Efficient	V	3723	3 mm

* Tyre Legend: V=Virgin, R=Recap

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MDHBBAN17Z0733091

**CONDITION REPORT**

Report No:
2016931175
DATE
01/07/2025

Diagnostic

During the diagnostic no active error messages were detected. (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

Inspection Conditions

No Test Drive
Battery Flat
Engine number – not possible to verify engine number (not visible without dismantling)
Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS. Body • Exterior: Minor dents and scratches and stone chips to some body panels. Signs of repair work done to somebody panels. Poor alignment to somebody panels.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Werner Laubscher

This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za


VIN: MDHBBAN17Z0733091




CONDITION REPORT




Report No:
2016931175
DATE
01/07/2025

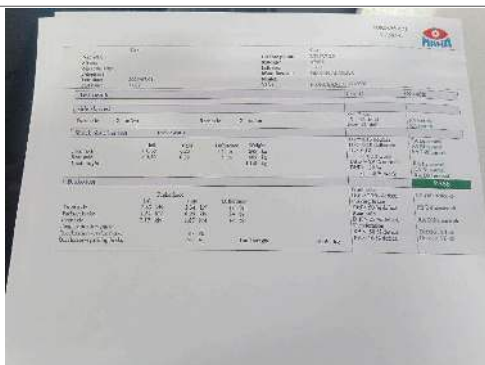

Brake and shock absorber

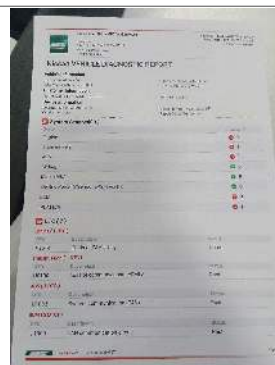

Diagnostic.

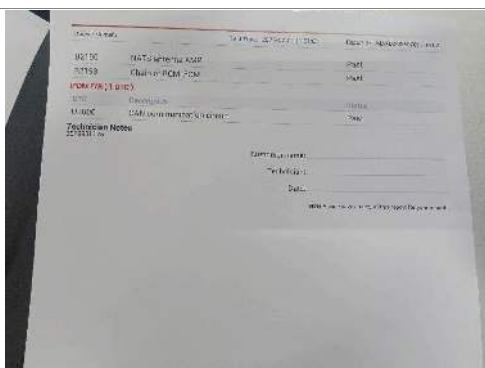

Diagnostic.



FRONT RIGHT CORNER



REAR LEFT CORNER



INTERIOR (FRONT DRIVER DOOR)

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MDHBBAN17Z0733091



CONDITION REPORT



Report No:
2016931175
DATE
01/07/2025



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER



Automatic.



90 DEGREE FRONT



90 DEGREE RIGHT



90 DEGREE REAR

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MDHBBAN17Z0733091



CONDITION REPORT



Report No:
2016931175
DATE
01/07/2025



90 DEGREE LEFT



LF TYRE TREAD



LR TYRE TREAD



RR TYRE TREAD



RF TYRE TREAD



LICENSE DISC

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MDHBBAN17Z0733091



CONDITION REPORT



Report No:
2016931175
DATE
01/07/2025



VIN PLATE OR STICKER




ENGINE 1



Undercarriage front.



Undercarriage rear.

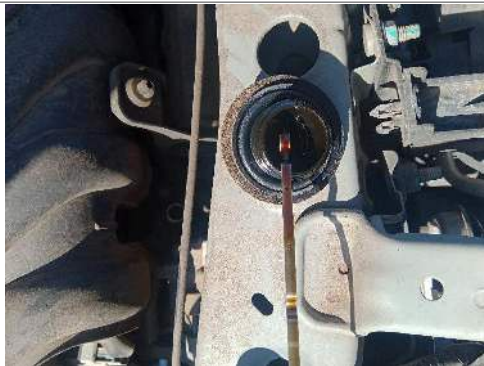

Oil cap and dipstick.



Water level

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MDHBBAN17Z0733091



CONDITION REPORT



Report No:
2016931175
DATE
01/07/2025



Front Bumper



Front Bumper



Bonnet



Front Fender Left



Rear Fender Left



Door Front Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MDHBBAN17Z0733091



CONDITION REPORT



Report No:
2016931175
DATE
01/07/2025



Door Rear Left



Rear bumper



Rear bumper



Boot Lid / Hatch door



Front Fender Right



Rear Fender Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MDHBBAN17Z0733091



CONDITION REPORT



Report No:
2016931175
DATE
01/07/2025



Door Front Right



Door Rear Right



Windscreen



Shock Absorber Rear Left



Shock Absorber Rear Right



Engine Management Lights

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MDHBBAN17Z0733091