



CONDITION REPORT

Report No: 2016261473

DATE
09/02/2024

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	09/02/2024		M57 Pretoria Road - 1619
Inspection Date	09/02/2024		Kempton Park - GT

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	MFC AUCTION HOUSE
Manufacturer	RENAULT	Registration Number	JR85ZMGP
Model	KWID	Register Number	
VIN	MEEBBA00100722859	Date Of First Licensing	
Engine Number		Last COR	
Doors	5	License Expiry Date	31/05/2023
Color	WHITE	Power / Displacement	
Year Model		Paint Finish	C - COMMON
Km Reading	94,688 KM	Fuel	PETROL
Cab / Body Type	HATCHBACK	Transmission	MANUAL

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

Damage	Repair Way
Engine Oil Leak	Repair
Dim Light Left Defective	Replace
Side Mirror Right Damaged	Replace
Front Bumper Damaged	Repair
Bonnet Dented	Repair
Front Fender Left Dented	Repair
Front Fender Right Dented	Repair
Door Front Left Dented	Repair
Windscreen Cracked	Replace
Tyre Rear Left Smooth	Replace
Tyre Rear Right Excessive Wear & Tear	Replace
Rim Rear Left Dented	Repair
Engine to silencer pipe Welded	Replace
Gearbox Oil Leak	Repair

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MEEBBA00100722859

1 / 10



CONDITION REPORT

Report No: 2016261473

DATE
09/02/2024

Brakes

Brake Test Results

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s ²]
Front	1.5	1.5	-	
Rear	1.0	0.9	-	
Emergency / Parking	1	0.7	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	165/70R14	81T	Ceat	Fuelsmart	V	0920	6 mm
Front Right	165/70R14	81T	Ceat	Fuelsmart	V	0920	6 mm
Rear Left	165/70R14	81T	Ceat	Fuelsmart	V	0920	0 mm
Rear Right	165/70R14	81T	Ceat	Fuelsmart	V	0920	0 mm
Spare	175/65R14	82H	Catchfors	Windforce	V	///////	6 mm

* Tyre Legend: V=Virgin, R=Recap

Diagnostic

During the diagnostic no active error messages were detected. (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

Inspection Conditions

No Test Drive

Battery Flat

Engine number – not possible to verify engine number (not visible without dismantling)

Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS. Body • Exterior: Minor dents scratches and stone chips on some body panels. Signs of spray work done on

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Trevino Julius

This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.



CONDITION REPORT

Report No: 2016261473

DATE
09/02/2024

Shock and brake report



Diagnostic test



Diagnostic test



FRONT RIGHT CORNER



REAR LEFT CORNER



INTERIOR (FRONT DRIVER DOOR)

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MEEBBA00100722859

3 / 10



CONDITION REPORT

Report No: 2016261473

DATE
09/02/2024

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MEEBBA00100722859
4 / 10



CONDITION REPORT

Report No: 2016261473

DATE
09/02/2024

DASHBOARD (W/ ENGINE RUNNING)



ODOMETER



90 DEGREE FRONT



90 DEGREE RIGHT



90 DEGREE REAR



90 DEGREE LEFT



CONDITION REPORT

Report No: 2016261473

DATE
09/02/2024


DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MEEBBA00100722859
6 / 10



CONDITION REPORT


Report No: 2016261473

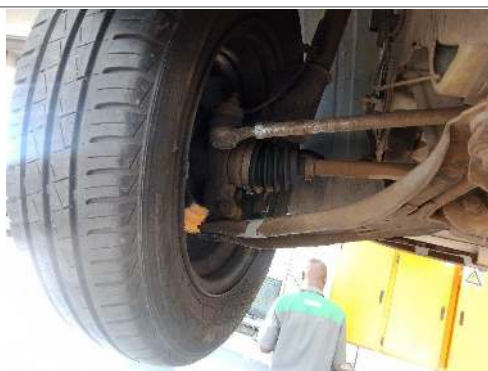DATE
09/02/2024


LF TYRE TREAD



LR TYRE TREAD

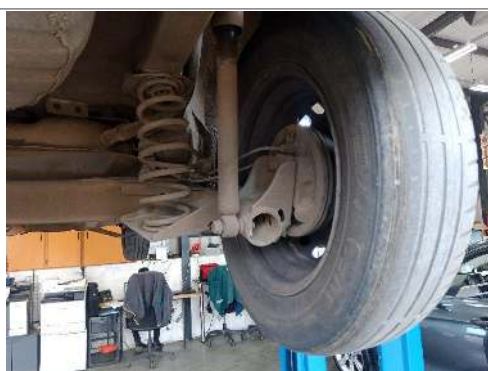

RR TYRE TREAD

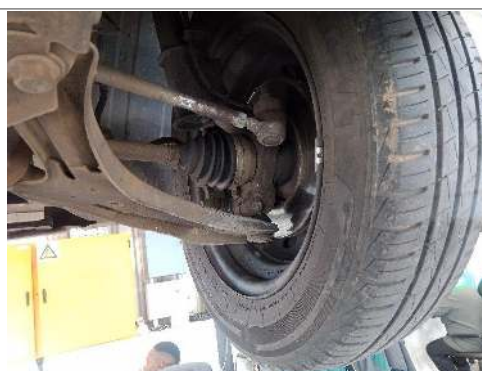

RF TYRE TREAD



Sparewheel



LICENSE DISC



CONDITION REPORT

Report No: 2016261473

DATE
09/02/2024

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MEEBBA00100722859
8 / 10



CONDITION REPORT

Report No: 2016261473

DATE
09/02/2024

VIN PLATE OR STICKER



ENGINE 1



ENGINE 2



CHASSIS



Manual



Coolant reservoir



CONDITION REPORT

Report No: 2016261473

DATE
09/02/2024

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MEEBBA00100722859

10 / 10



CONDITION REPORT

Report No: 2016261473

DATE
09/02/2024

Dipstick



Oil cap



Dim Light Left



Gearbox



Gearbox



Windscreen



CONDITION REPORT

Report No: 2016261473

DATE
09/02/2024

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016261473

DATE
09/02/2024

Side Mirror Right



Front Fender Right



Front Bumper



Front Bumper



Front Bumper



Tyre Rear Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016261473

DATE
09/02/2024

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016261473

DATE
09/02/2024

Tyre Rear Right



Gearbox



Gearbox



Engine



Engine



Engine to silencer pipe



CONDITION REPORT

Report No: 2016261473

DATE
09/02/2024

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016261473

DATE
09/02/2024

Engine to silencer pipe



Rim Rear Left



Door Front Left



Front Fender Left



Bonnet

**CONDITION REPORT****Report No: 2016261473****DATE**
09/02/2024

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za