



CONDITION REPORT



Report No:
2016998150
DATE
01/09/2025

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	01/09/2025		M57 Pretoria Road - 1619
Inspection Date	01/09/2025		Kempton Park - GT

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	MFC
Manufacturer	RENAULT	Registration Number	N/A
Model	KWID	Register Number	
VIN	MEEBBA00600731959	Date Of First Licensing	
Engine Number		Last COR	
Doors	5	License Expiry Date	
Color	SILVER	Power / Displacement	
Year Model		Paint Finish	M - METALLIC
Km Reading	71,667 KM	Fuel	PETROL
Cab / Body Type	HATCHBACK	Transmission	MANUAL

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

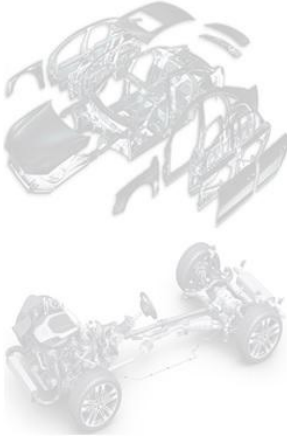
VIN: MEEBBA00600731959



CONDITION REPORT



Report No:
2016998150
DATE
01/09/2025

	Damage	Repair Way
	Engine Oil Leak Parcel Tray Missing Bonnet Dented Front Fender Left Dented Front Fender Right Dented Door Front Left Dented Door Front Right Dented Door Rear Right Dented Boot Lid / Hatch door Dented Roof Dented No license disc Both number plates missing	Repair Replace Repair Repair Repair Repair Repair Repair Repair Repair Replace Replace

Brakes

Brake Test Results

	Left	Right	Axle Weight [KG]	Deceleration [m/s ²]
	Braking Force [KN]	Braking Force [KN]		
Front	1.4	1.4	-	
Rear	1.1	1.1	-	
Emergency / Parking	0.7	0.5	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	165/65R14	79H	Westlake	Zupereco	V	4724	3 mm
Front Right	165/65R14	79H	Westlake	Zupereco	V	4724	3 mm
Rear Left	165/65R14	79H	Westlake	Zupereco	V	4724	3 mm
Rear Right	165/65R14	79H	Westlake	Zupereco	V	4724	4 mm
Spare	165/65R14	79H	Westlake	Zupereco	V	0000	5 mm

* Tyre Legend: V=Virgin, R=Recap

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MEEBBA00600731959



CONDITION REPORT



Report No:
2016998150
DATE
01/09/2025

Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

No	System	Code	Description	Status
1	MEMORY	DTC903617	POWER SUPPLY VOLTAGE CIRCUIT VOLTAGE ABOVE THRESHO	

Inspection Conditions

No Test Drive
Battery Flat
Engine number – not possible to verify engine number (not visible without dismantling)
Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Andrick Wymers

This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MEEBBA00600731959



CONDITION REPORT



Report No:
2016998150
DATE
01/09/2025

[illegible]

Shock and brake report



Diagnostic report



Diagnostic report



FRONT RIGHT CORNER



REAR LEFT CORNER



INTERIOR (FRONT DRIVER DOOR)

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MEEBBA00600731959



CONDITION REPORT



Report No:
2016998150
DATE
01/09/2025



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER



Manual



90 DEGREE FRONT



90 DEGREE RIGHT



90 DEGREE REAR

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MEEBBA00600731959



CONDITION REPORT



Report No:
2016998150
DATE
01/09/2025



90 DEGREE LEFT



LF TYRE TREAD



LR TYRE TREAD



RR TYRE TREAD



RF TYRE TREAD



Spare wheel

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MEEBBA00600731959



CONDITION REPORT



Report No:
2016998150
DATE
01/09/2025



No license disc



VIN PLATE OR STICKER



ENGINE 1



ENGINE 2



CHASSIS



Oil cap and dipstick

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MEEBBA00600731959



CONDITION REPORT



Report No:
2016998150
DATE
01/09/2025



Coolant bottle



Parcel Tray



Water level



Bonnet



Boot Lid / Hatch door



Roof

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MEEBBA00600731959



CONDITION REPORT



Report No:
2016998150
DATE
01/09/2025



Door Rear Right



Door Front Right



Front Fender Right



Front Fender Left



Door Front Left



Engine

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MEEBBA00600731959