



CONDITION REPORT



Report No:
2016996137
DATE
29/08/2025

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	29/08/2025		M57 Pretoria Road - 1619
Inspection Date	29/08/2025		Kempton Park - GT

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	MFC
Manufacturer	RENAULT	Registration Number	LL41RBGP
Model	KIGER	Register Number	
VIN	MEEHBC00100101465	Date Of First Licensing	
Engine Number		Last COR	
Doors	5	License Expiry Date	
Color	BLUE	Power / Displacement	
Year Model		Paint Finish	M - METALLIC
Km Reading	5,530 KM	Fuel	PETROL
Cab / Body Type	HATCHBACK	Transmission	MANUAL

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MEEHBC00100101465



CONDITION REPORT



Report No:
2016996137
DATE
29/08/2025

	Damage	Repair Way
	Bonnet Paintwork • Chipmarks	Repair
	Door Rear Left Residual Traces of Repair	Repair
	Wheel bearing Front Left Noisy	Repair
	Wheel bearing Front Right Noisy	Repair
	Body exterior	Signs of spray work done on some body panels
	Body exterior	Minor dents scratches stone chips on some body pan
	Body exterior	Residual traces of repair work done on some body p
	Fuse box cover missing	Repair
	Fuse box cover missing	Repair
	Front suspension excessive noise	Repair

Brakes
Brake Test Results

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s²]
Front	2.1	2.3	-	
Rear	1.3	1.4	-	
Emergency / Parking	1.1	1.2	-	

Tyres and Rims
Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	195/60R16	89V	Ceat	Securadrive	V	2521	5 mm
Front Right	195/60R16	89V	Ceat	Secura drive	V	2523	6 mm
Rear Left	195/60R16	89V	Ceat	Securadrive	V	2521	6 mm
Rear Right	195/60R16	89V	Ceat	Securadrive	V	2523	6 mm
Spare	165/80R14	85R	Ceat	Temporary	V	///////	2 mm

* Tyre Legend: V=Virgin, R=Recap

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MEEHBC00100101465



CONDITION REPORT



Report No:
2016996137
DATE
29/08/2025

Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

No	System	Code	Description	Status
1	INJECTION	DTC065711	MAIN RELAY CONTROL CIRCUIT SHORT CIRCUIT TO EARTH	

Inspection Conditions

No Test Drive

Battery Flat

Engine number – not possible to verify engine number (not visible without dismantling)

Inspection conditions for the vehicle inspection were sufficient

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Trevino Julius

This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MEEHBC00100101465



CONDITION REPORT



Report No:
2016996137
DATE
29/08/2025



Manual



Sparewheel



Expansion bottle



Dipstick



Oil cap



Rear end

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MEEHBC00100101465




CONDITION REPORT




Report No:
2016996137
DATE
29/08/2025




Fuse box cover missing

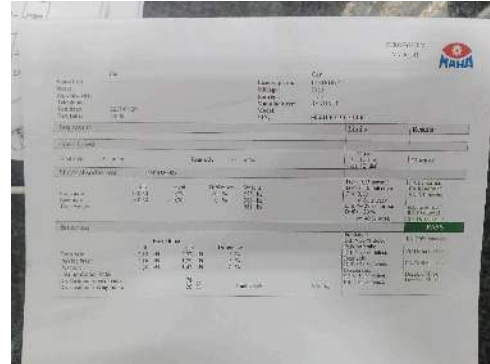

Shock and brake report

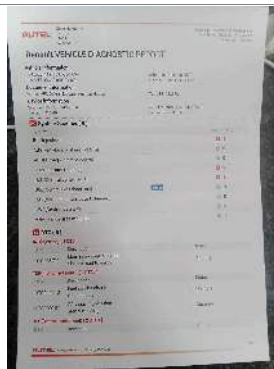

Diagnostic test

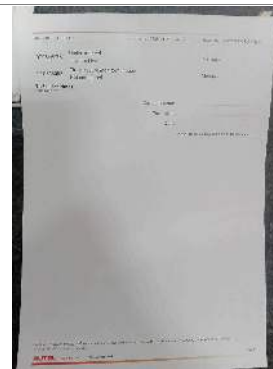

Diagnostic test



FRONT RIGHT CORNER



REAR LEFT CORNER

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MEEHBC00100101465



CONDITION REPORT



Report No:
2016996137
DATE
29/08/2025



INTERIOR (FRONT DRIVER DOOR)



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER



90 DEGREE FRONT



90 DEGREE RIGHT



90 DEGREE REAR

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MEEHBC00100101465



CONDITION REPORT




Report No:
2016996137
DATE
29/08/2025



90 DEGREE LEFT



LF TYRE TREAD

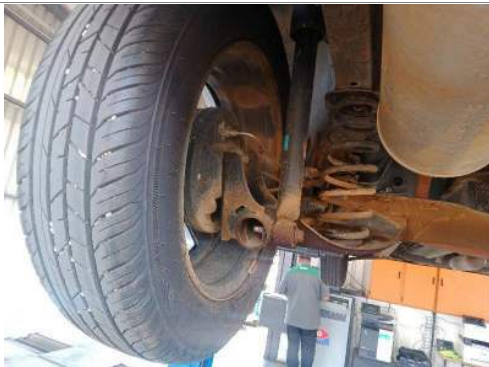

LR TYRE TREAD



RR TYRE TREAD



RF TYRE TREAD



LICENSE DISC

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MEEHBC00100101465



CONDITION REPORT



Report No:
2016996137
DATE
29/08/2025



VIN PLATE OR STICKER




ENGINE 1



CHASSIS



ENGINE 2

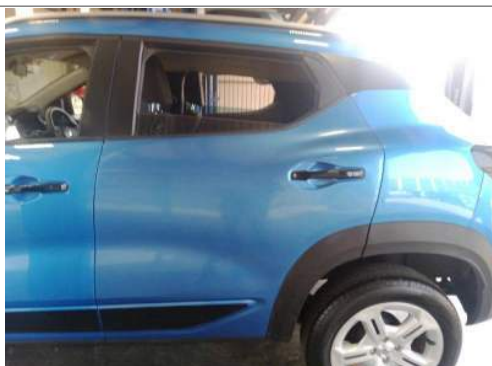

Door Rear Left



Bonnet

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MEEHBC00100101465



CONDITION REPORT



Report No:
2016996137
DATE
29/08/2025



Bonnet

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MEEHBC00100101465