



CONDITION REPORT

Report No: 2016416853

DATE
13/06/2024

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	13/06/2024		M57 Pretoria Road - 1619
Inspection Date	13/06/2024		Kempton Park - GT

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	MFC AUCTION HOUSE
Manufacturer	TOYOTA	Registration Number	NN17896
Model	AVANZA	Register Number	
VIN	MHKM1CA2NBK008171	Date Of First Licensing	
Engine Number		Last COR	
Doors	5	License Expiry Date	30/04/2025
Color	WHITE	Power / Displacement	
Year Model		Paint Finish	C - COMMON
Km Reading	121,014 KM	Fuel	PETROL
Cab / Body Type	HATCHBACK	Transmission	MANUAL

Vehicle Options & Accessories

Items

VEHICLE INSPECTION



Damage	Repair Way
Seat Rear Torn / Cut	Repair
Hood Lining Excessive Wear & Tear	Repair
Dash Padding Damaged	Repair
Carpet Front Torn / Cut	Replace
Carpet Rear Excessive Wear & Tear	Repair
Bonnet Paintwork • Scratched	Repair
Rear bumper Paintwork • Scratched	Repair
Stabilizer Mounting Front Left Damaged	Replace
Stabilizer Mounting Front Right Damaged	Replace
Trailing Arm Rear Axle Right Damaged	Replace
Body exterior	Signs of spray work done on some body panels
Engine.	Bottom of engine is fully covered

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MHKM1CA2NBK008171

1 / 9



CONDITION REPORT

Report No: 2016416853

 DATE
13/06/2024

Brakes

Brake Test Results

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s ²]
Front	2.2	1.9	-	
Rear	1.9	2.0	-	
Emergency / Parking	1.5	2	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	185/70R14	88T	Dunlop	Sport	V	4920	2 mm
Front Right	185/70R14	88T	Dunlop	Sport	V	4920	1 mm
Rear Left	185/70R14	88T	Dunlop	Sport	V	4920	3 mm
Rear Right	185/70R14	88T	Dunlop	Sport	V	4920	3 mm
Spare	185/70R14	88S	Dunlop	Sport	V	0000	5 mm

* Tyre Legend: V=Virgin, R=Recap

Diagnostic

During the diagnostic no active error messages were detected. (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

Inspection Conditions

No Test Drive
 Battery Flat
 Engine number – not possible to verify engine number (not visible without dismantling)
 Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Trevino Julius

This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.



CONDITION REPORT


VIN: MFKM1CA2NR6098173

Report No: 2016416853


2 / 9

DATE

13/06/2024

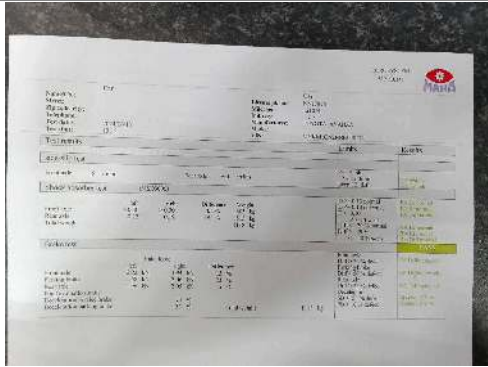

Shock and brake report

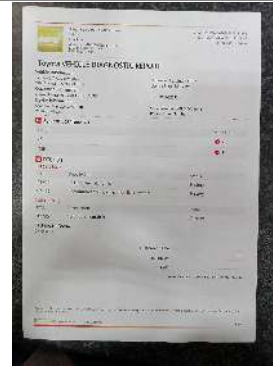

Diagnostic test



FRONT RIGHT CORNER



REAR LEFT CORNER



INTERIOR (FRONT DRIVER DOOR)



DASHBOARD (W/ ENGINE RUNNING)



CONDITION REPORT

Report No: 2016416853

VIN: MHKM1CA2NBK008171

DATE

13/06/2024

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016416853

DATE
VIN: MHKM1CA2NBK008171
13/06/2024
4/9



ODOMETER



Manual



90 DEGREE FRONT



90 DEGREE RIGHT



90 DEGREE REAR



90 DEGREE LEFT



CONDITION REPORT

Report No: 2016416853

DATE

13/06/2024

VIN: MHKM1CA2NBK008171

5 / 9



CONDITION REPORT

Report No: 2016416853

DATE
13/06/2024

VIN: MHKM1CA2NBK008171

6 / 9




LF TYRE TREAD



LR TYRE TREAD



RR TYRE TREAD

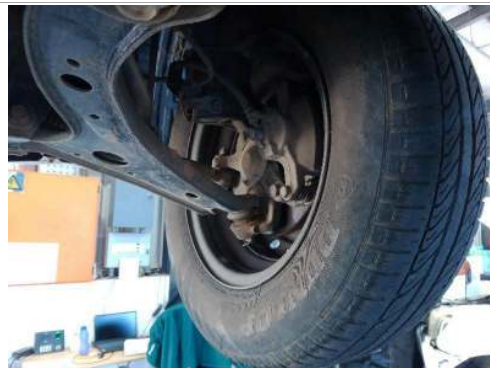

RF TYRE TREAD



Sparewheel



Sparewheel



CONDITION REPORT

Report No: 2016416853

DATE
13/06/2024

VIN: MHKM1CA2NBK008171

7 / 9

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016416853

DATE
13/06/2024



LICENSE DISC



VIN PLATE OR STICKER



ENGINE 1



ENGINE 2



CHASSIS



Oil cap and dipstick

**CONDITION REPORT****Report No: 2016416853****DATE**
13/06/2024

VIN: MHKM1CA2NBK008171

9 / 9



CONDITION REPORT

Report No: 2016416853

DATE
13/06/2024

Coolant reservoir



Carpet Front



Bonnet



Water level



Water level



Hood Lining



CONDITION REPORT

Report No: 2016416853

DATE
13/06/2024

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016416853

DATE
13/06/2024

Seat Rear



Carpet Rear



Stabilizer Mounting Front Right



Stabilizer Mounting Front Left



Rear bumper



Rear bumper



CONDITION REPORT

Report No: 2016416853

DATE
13/06/2024

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016416853

DATE
13/06/2024

Trailing Arm Rear Axle Right



Trailing Arm Rear Axle Right



Dash Padding

**CONDITION REPORT****Report No: 2016416853****DATE**
13/06/2024

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za