



CONDITION REPORT

Report No: 2016448200

DATE
10/07/2024

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	10/07/2024		M57 Pretoria Road - 1619
Inspection Date	10/07/2024		Kempton Park - GT

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	MFC AUCTION HOUSE
Manufacturer	TOYOTA	Registration Number	JL89XPGP
Model	AVANZA	Register Number	
VIN	MHKM5EA1N0K003328	Date Of First Licensing	
Engine Number		Last COR	
Doors	5	License Expiry Date	31/08/2023
Color	GOLDEN	Power / Displacement	
Year Model		Paint Finish	M - METALLIC
Km Reading	313,983 KM	Fuel	PETROL
Cab / Body Type	STATION WAGON	Transmission	MANUAL

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

Damage	Repair Way
Engine Wiring Defective	Repair
Air cleaner Defective	Repair
Bonnet hinges Defective	Repair
Bonnet stay and shocks Missing	Replace
Tail Light Left Cracked	Repair
Tail Light Right Damaged	Replace
Headlight Left Damaged	Repair
Headlight Right Damaged	Replace
Seat Front Left Damaged	Repair
Seat Front Right Damaged	Repair
Seat Rear Damaged	Repair
Seat Belt Front Left Defective	Repair
Seat Belt Front Right Defective	Repair
Dash Padding Damaged	Repair
Carpet Front Damaged	Repair
Carpet Rear Damaged	Replace
Gear Lever Dust Boot Damaged	Repair
Steering Wheel Trim Damaged	Repair
Number Plate Rear Missing	Repair
Front Bumper Damaged	Repair
Grill Damaged	Repair
Bonnet Dented	Repair
Bonnet slam plate (Shock tower/ Inner tray) Welded	Repair
Front Fender Left Damaged	Repair
Front Fender Right Damaged	Repair
Rear Fender Left Dented	Repair
Rear Fender Right Paintwork • Scratched	Repair
Front Fender Left / Inner Tray Damaged	Repair
Front Fender Right / Inner Tray Dented	Repair

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MHKM5EA1N0K003328

1 / 20



CONDITION REPORT

Report No: 2016448200

DATE
10/07/2024

Damage	Repair Way
Door Front Left Paintwork • Scratched	Repair
Door Front Right Dented	Repair
Door Rear Left Paintwork • Scratched	Repair
Door Rear Right Paintwork • Scratched	Repair
Boot Lid / Hatch door Dented	Repair
Rear bumper Paintwork • Scratched	Repair
Sill Panel Left Dented	Repair
Roof Dented	Repair
Windscreen Cracked	Replace
Window Front Door Right Defective	Repair
Brake Piping Damaged	Repair
Service Brake Performance Rear Axle Left / Right	Repair
Difference out of legal range	
Parking Brake Performance Left / Right Difference out of legal range	Repair
Tie Rod End right Damaged	Replace
Stabilizer Mounting Front Left Damaged	Replace
Stabilizer Mounting Front Right Damaged	Replace
Ball Joint(s) Front Axle Right Damaged	Replace
Bolt(s) / Nut(s) Front Wheel Left Missing	Replace
Bolt(s) / Nut(s) Front Wheel Right Missing	Replace
Bolt(s) / Nut(s) Rear Wheel Left Missing	Replace
Bolt(s) / Nut(s) Rear Wheel Right Missing	Replace
Tyre Rear Left Smooth	Replace
Main Beam Left Damaged	Repair
Main Beam Right Dented	Repair
Gearbox Oil Leak	Repair
Radiator Cradle Damaged	Repair
Road test	Vehicle unsafe to drive
Road test	Vehicle safety integrity compromised
Body exterior	Vehicle got scratches, stone chips and dents
Body exterior	Signs of spray work done on some body panels
Body exterior	Signs of repair work done on some body panels
Body exterior	Impact damage in front of vehicle
Windscreen washers not working	Repair
Battery loose	Repair
Engine management lights illuminated	Repair
Both front fender liner missing	Replace
Windscreen sealing rubber missing	Replace
Wiper grill valence damage	Replace

Brakes

Brake Test Results

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s ²]
Front	2.3	2.3	-	
Rear	2.4	0.1	-	
Emergency / Parking	0.1	2.5	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	185/70R14	88H	Cruiser	Radial	V	3522	3 mm
Front Right	185/70R14	88H	Hockenheim	Vanza	V	1523	3 mm
Rear Left	185/70R14	88T	Ling long	L676	V	3022	1 mm
Rear Right	185/70R14	88T	Ling long	L676	V	3022	2 mm

* Tyre Legend: V=Virgin, R=Recap

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

VIN: WHKMFEA1N0K003328
Report No: 2016448200
2 / 20
DATE
10/07/2024

Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

No	System	Code	Description	Status
1	ABS	C0200	FR WHEEL OPEN WIRE/SHORTED	

Inspection Conditions

No Test Drive
Battery Flat
Engine number – not possible to verify engine number (not visible without dismantling)
Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Andrick Wymers


This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.



CONDITION REPORT

Report No: 2016448200
VIN: MHKM5EA1N0K003328
DATE
10/07/2024

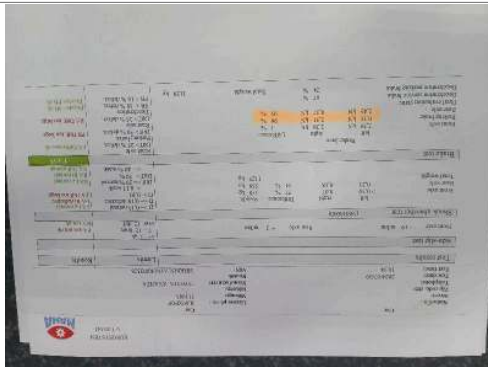


Shock and brake report



Diagnostic report



Diagnostic report

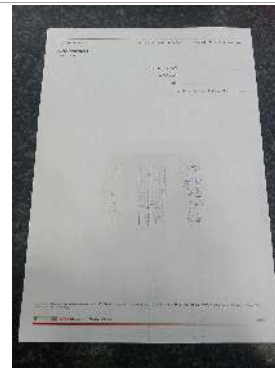

Diagnostic report



FRONT RIGHT CORNER



REAR LEFT CORNER

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016448200

VIN: MHKM5EA1N0K003328
DATE 10/07/2024
4 / 20

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016448200

DATE

10/07/2024

VIN: MHKM5EA1N0K003328

5 / 20



INTERIOR (FRONT DRIVER DOOR)



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER



Manual



90 DEGREE FRONT



90 DEGREE RIGHT



CONDITION REPORT

Report No: 2016448200

DATE
10/07/2024

VIN: MHKM5EA1N0K003328
6 / 20

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016448200

DATE
10/07/2024

VIN: MHKM5EA1N0K003328


7 / 20



90 DEGREE REAR



90 DEGREE LEFT

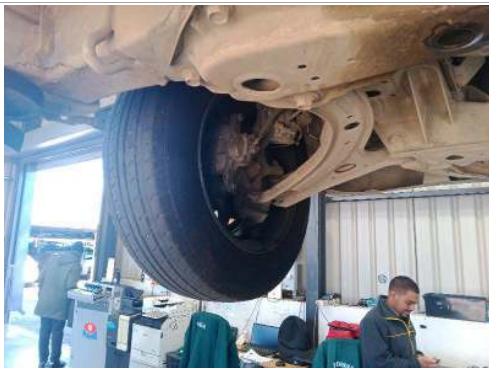

LF TYRE TREAD



LR TYRE TREAD



RR TYRE TREAD



RF TYRE TREAD



CONDITION REPORT

Report No: 2016448200

DATE
10/07/2024

VIN: MHKM5EA1N0K003328
8 / 20

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016448200

DATE
10/07/2024



No spare wheel



LICENSE DISC



VIN PLATE OR STICKER



ENGINE 1



ENGINE 2



CHASSIS



CONDITION REPORT

Report No: 2016448200

DATE
10/07/2024

VIN: MHKM5EA1N0K003328
10 / 20

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016448200

DATE
10/07/2024



Oil cap and dipstick



Coolant bottle



Battery loose

Test results		Test mass		VFA	
Front axle	+ 10	in kg		Front axle	+ 3
Side-slip test				Weight	in kg
Shock absorber test	(MSD500)			Difference	
Front axle	- 0.30	right	0.07	Weight	550 kg
Rear axle	0.21	right	0.18	Weight	1150 kg
Front axle				Difference	
Rear axle				Weight	550 kg
Total weight				Weight	1150 kg

Parking Brake Performance

[illegible]

Service Brake Performance Rear Axle



Air cleaner



CONDITION REPORT

Report No: 2016448200

DATE
10/07/2024

VIN: MHKM5EA1N0K003328
12 / 20



CONDITION REPORT

Report No: 2016448200

DATE
10/07/2024

Bonnet stay and shocks



Bonnet hinges

VIN: MBKM5EA1N0K003328

13 / 20



Bonnet hinges



Water level



Engine Wiring



Bonnet slam plate (Shock tower/ Inner tray)



CONDITION REPORT

Report No: 2016448200

DATE
10/07/2024

VIN: MHKM5EA1N0K003328
14 / 20

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016448200

DATE
10/07/2024

Bonnet slam plate (Shock tower/ Inner tray)



Bonnet slam plate (Shock tower/ Inner tray)

VIN: MHKM5EA1N0K003328

15 / 20



Headlight Left



Headlight Right



Main Beam Left



Main Beam Right



CONDITION REPORT

Report No: 2016448200

DATE
10/07/2024

VIN: MHKM5EA1N0K003328
16 / 20

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016448200

DATE
10/07/2024



Grill



Bonnet

17 / 20



Windscreen



Window Front Door Right



Roof



Seat Front Left



CONDITION REPORT

Report No: 2016448200

DATE
10/07/2024

VIN: MHKM5EA1N0K003328
18 / 20

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016448200

DATE
10/07/2024

Seat Front Right



Seat Rear



Dash Padding



Gear Lever Dust Boot



Steering Wheel Trim



Carpet Rear

VIN: MHKM5EA1N0K003328

19 / 20



CONDITION REPORT

Report No: 2016448200

DATE
10/07/2024

VIN: MHKM5EA1N0K003328
20 / 20

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT


Report No: 2016448200

DATE
10/07/2024

Carpet Front



Number Plate Rear

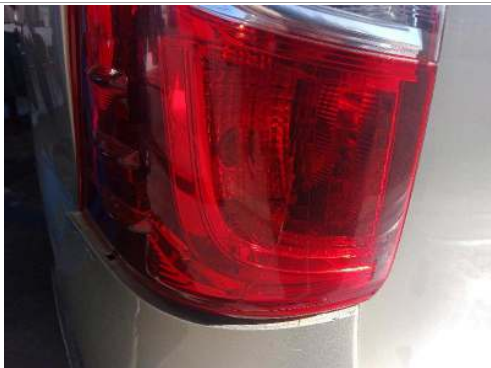

Tail Light Left



Tail Light Right



Rear Fender Right



Door Rear Right



CONDITION REPORT

Report No: 2016448200

DATE
10/07/2024

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016448200

DATE
10/07/2024

Door Front Right



Front Fender Right



Front Bumper



Front Bumper



Front Bumper



Front Fender Left



CONDITION REPORT

Report No: 2016448200

DATE
10/07/2024

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016448200

DATE
10/07/2024

Door Front Left



Door Rear Left



Sill Panel Left



Rear Fender Left



Rear bumper



Rear bumper



CONDITION REPORT

Report No: 2016448200

DATE
10/07/2024

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016448200

DATE
10/07/2024

Boot Lid / Hatch door



Bolt(s) / Nut(s) Rear Wheel Right



Bolt(s) / Nut(s) Rear Wheel Left



Bolt(s) / Nut(s) Front Wheel Left



Bolt(s) / Nut(s) Front Wheel Right



Main Beam Left



CONDITION REPORT

Report No: 2016448200

DATE
10/07/2024

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016448200

DATE
10/07/2024

Main Beam Right



Radiator Cradle



Radiator Cradle



Front Bumper



Front Fender Right / Inner Tray



Front Fender Left / Inner Tray



CONDITION REPORT

Report No: 2016448200

DATE
10/07/2024

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016448200

DATE
10/07/2024

Ball Joint(s) Front Axle Right



Stabilizer Mounting Front Left



Stabilizer Mounting Front Right



Tie Rod End right



Gearbox



Gearbox



CONDITION REPORT

Report No: 2016448200

DATE
10/07/2024

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016448200

DATE
10/07/2024

Tyre Rear Left



Brake Piping



Seat Belt Front Left



Seat Belt Front Right



CONDITION REPORT

Report No: 2016448200

DATE
10/07/2024

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za