



CONDITION REPORT

Report No: 2016591430

DATE
30/10/2024

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	30/10/2024		M57 Pretoria Road - 1619
Inspection Date	30/10/2024		Kempton Park - GT

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	
Manufacturer	TOYOTA	Registration Number	KBC808MP
Model	AVANZA 1.5 SX MPV [2019-2022]	Register Number	
VIN	MHKM5FA2N0K013108	Date Of First Licensing	
Engine Number		Last COR	
Doors	5	License Expiry Date	31/03/2024
Color	SILVER	Power / Displacement	
Year Model	2020	Paint Finish	M - METALLIC
Km Reading	164,094 KM	Fuel	PETROL
Cab / Body Type	HATCHBACK	Transmission	MANUAL

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

Damage	Repair Way
Engine Oil Leak	Repair
Seat Front Right Torn / Cut	Repair
Seat Rear Torn / Cut	Repair
Side Mirror Left Damaged	Replace
Front Bumper Residual Traces of Repair	Repair
Bonnet Residual Traces of Repair	Repair
Front Fender Left Residual Traces of Repair	Repair
Front Fender Right Residual Traces of Repair	Repair
Rear Fender Right Residual Traces of Repair	Repair
Boot Lid / Hatch door Damaged	Repair
Windscreen Cracked	Replace
Rim Rear Left Dented	Repair
Both front headlights clips are broken headlights	Repair.
Exhaust leak	Repair.

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MHKM5FA2N0K013108

1 / 9

Brakes

Brake Test Results

	Left	Right	Axle Weight [KG]	Deceleration [m/s ²]
	Braking Force [KN]	Braking Force [KN]		
Front	2.3	2.7	-	
Rear	1.9	2.0	-	
Emergency / Parking	1.9	1.8	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	185/70R14	88T	Sumitomo	HTR	V	1822	5 mm
Front Right	185/70R14	88T	Sumitomo	HTR	V	1822	5 mm
Rear Left	185/70R14	88T	Sumitomo	HTR	V	1822	5 mm
Rear Right	185/70R14	88T	Sumitomo	HTR	V	1822	5 mm
Spare	185/70R14	88T	Dunlop	Sport	V	0000	3 mm

* Tyre Legend: V=Virgin, R=Recap

Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

No	System	Code	Description	Status
1	ABS	C1233	YAW RATE SENSOR YRS OPEN SHOT	

Inspection Conditions

No Test Drive
Battery Flat
Engine number – not possible to verify engine number (not visible without dismantling)
Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS.Engine Compartment: Bottom of engine is covered.
Body • Exterior: Residual traces of repair work done on some body panels. Signs of spray work done on some body panels. Minor dents scratches stone chips on some body panels.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Trevino Julius

This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.



CONDITION REPORT


VIN: MHKMF6A2N0K03108

Report No: 2016591430

2 / 9

DATE


30/10/2024

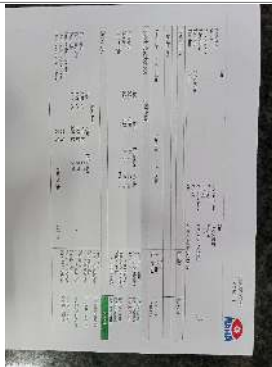

Shock and brake report



Diagnostic test

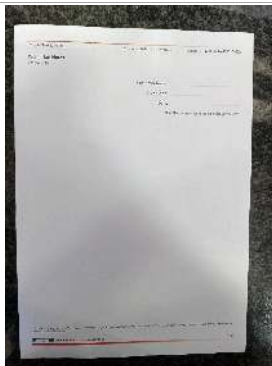

Diagnostic test



FRONT RIGHT CORNER



REAR LEFT CORNER



INTERIOR (FRONT DRIVER DOOR)



CONDITION REPORT

Report No: 2016591430
VIN: MHKM5FA2N0K013108
DATE
30/10/2024

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016591430

DATE
VIN: MHKM5FA2N0K013108
30/10/2024
4/9



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER



Manual



90 DEGREE FRONT



90 DEGREE RIGHT



90 DEGREE REAR



CONDITION REPORT

Report No: 2016591430

DATE

30/10/2024

VIN: MHKM5FA2N0K013108

5 / 9



CONDITION REPORT

Report No: 2016591430

DATE
30/10/2024

VIN: MHKM5FA2N0K013108

6 / 9



90 DEGREE LEFT



LF TYRE TREAD



LR TYRE TREAD



RR TYRE TREAD



RF TYRE TREAD



Sparewheel



CONDITION REPORT

Report No: 2016591430

DATE
30/10/2024

VIN: MHKM5FA2N0K013108
7 / 9

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016591430

DATE
30/10/2024



LICENSE DISC



VIN PLATE OR STICKER



ENGINE 1



ENGINE 2



CHASSIS



Sparewheel



CONDITION REPORT

Report No: 2016591430

DATE
30/10/2024

VIN: MHKM5FA2N0K013108
9 / 9

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016591430

DATE
30/10/2024

Coolant reservoir



L/F fender liner missing



Oil cap and dipstick



Side Mirror Left



Rear Fender Right



Boot Lid / Hatch door



CONDITION REPORT

Report No: 2016591430

DATE
30/10/2024

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016591430

DATE
30/10/2024

Front Fender Left



Windscreen



Bonnet



Bonnet



Front Fender Right



Front Bumper



CONDITION REPORT

Report No: 2016591430

DATE
30/10/2024

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016591430

DATE
30/10/2024

Front Bumper




Front Bumper



Engine



Rim Rear Left

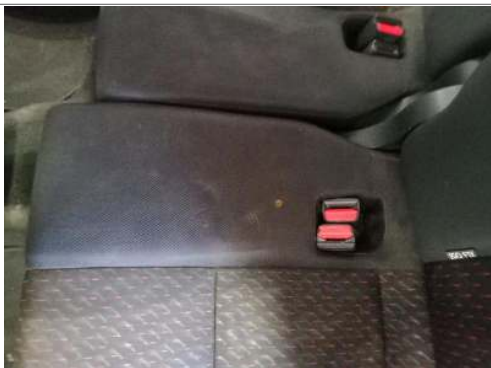

Seat Rear



Seat Front Right

**CONDITION REPORT****Report No: 2016591430****DATE**
30/10/2024

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za