



CONDITION REPORT



Report No:
2016932596
DATE
02/07/2025

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	02/07/2025		M57 Pretoria Road - 1619
Inspection Date	02/07/2025		Kempton Park - GT

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	MFC
Manufacturer	RENAULT	Registration Number	KRW523NW
Model	KADJAR 1.2 EXPRESSION BLAZE 96KW TURBO [2016-2017]	Register Number	
VIN	VF1RFE00553362610	Date Of First Licensing	
Engine Number		Last COR	
Doors	5	License Expiry Date	30/04/2026
Color	RED	Power / Displacement	
Year Model	2016	Paint Finish	M - METALLIC
Km Reading	82,102 KM	Fuel	PETROL
Cab / Body Type	HATCHBACK	Transmission	MANUAL

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za


VIN: VF1RFE00553362610



CONDITION REPORT



Report No:
2016932596
DATE
02/07/2025

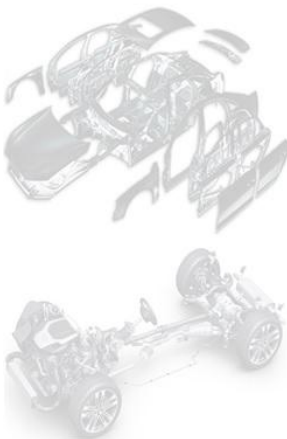

Damage	Repair Way
Front Bumper Paintwork • Scratched	Repair
Bonnet Dented	Repair
Front Fender Left Paintwork • Scratched	Repair
Rear Fender Left Paintwork • Scratched	Repair
Door Front Left Dented	Repair
Door Front Right Dented	Repair
Door Rear Left Dented	Repair
Door Rear Right Dented	Repair
Boot Lid / Hatch door Paintwork • Scratched	Repair
Rear bumper Paintwork • Scratched	Repair
Windscreen Cracked	Repair
Tie Rod End right Cracked	Replace
Ball Joint(s) Front Axle Left Damaged	Replace
Ball Joint(s) Front Axle Right Damaged	Replace

Brakes

Brake Test Results

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s ²]
Front	3.0	3.0	-	
Rear	2.5	2.5	-	
Emergency / Parking	1.8	1.8	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	215/60R17	96H	Max trek	Maximus	V	0121	2 mm
Front Right	215/60R17	96H	Max trek	Maximus	V	0121	2 mm
Rear Left	215/60R17	96H	Max trek	Maximus	V	0121	2 mm
Rear Right	215/60R17	96H	Max trek	Maximus	V	0121	2 mm
Spare	215/65R16	98H	Continental	Contact	V	0000	5 mm

* Tyre Legend: V=Virgin, R=Recap

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: VF1RFE00553362610



CONDITION REPORT



Report No:
2016932596
DATE
02/07/2025

Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

No	System	Code	Description	Status
1	MEMORY	DTC80D229	WARNING LIGHT CIRCUIT FAULT 4	

Inspection Conditions

No Test Drive
Battery Flat
Engine number – not possible to verify engine number (not visible without dismantling)
Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Andrick Wymers

This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za


VIN: VF1RFE00553362610



CONDITION REPORT



Report No:
2016932596
DATE
02/07/2025

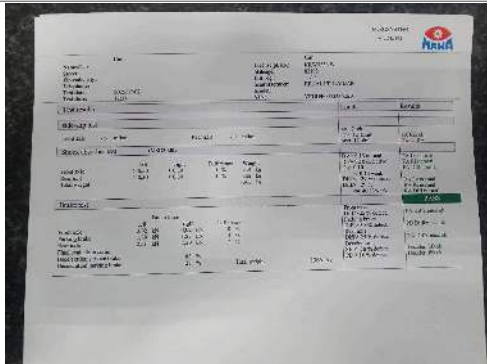

Shock and brake report



Diagnostic report



Diagnostic report



Diagnostic report



Diagnostic report



FRONT RIGHT CORNER

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: VF1RFE00553362610



CONDITION REPORT



Report No:
2016932596
DATE
02/07/2025



REAR LEFT CORNER



INTERIOR (FRONT DRIVER DOOR)



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER



Manual



90 DEGREE FRONT

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: VF1RFE00553362610




CONDITION REPORT



Report No:
2016932596
DATE
02/07/2025



90 DEGREE RIGHT

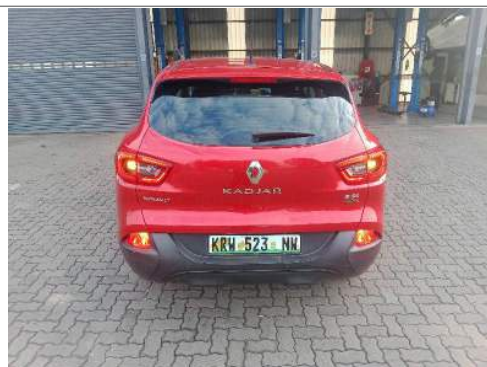

90 DEGREE REAR



90 DEGREE LEFT



LF TYRE TREAD



LR TYRE TREAD



RR TYRE TREAD

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: VF1RFE00553362610



CONDITION REPORT



Report No:
2016932596
DATE
02/07/2025



RF TYRE TREAD



Spare wheel



LICENSE DISC



VIN PLATE OR STICKER



ENGINE 1



ENGINE 2

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: VF1RFE00553362610



CONDITION REPORT



Report No:
2016932596
DATE
02/07/2025



CHASSIS




Expansion bottle



Oil cap and dipstick



Water level

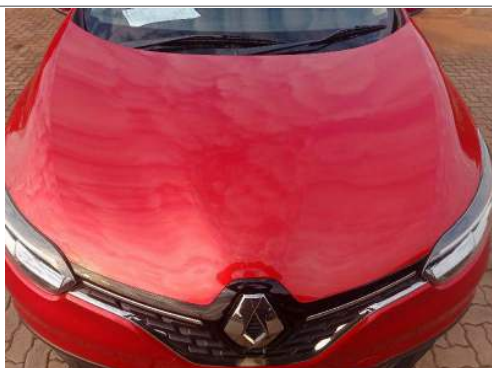

Bonnet



Windscreen

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: VF1RFE00553362610



CONDITION REPORT



Report No:
2016932596
DATE
02/07/2025



Door Rear Right



Door Front Right



Front Bumper



Front Bumper



Front Fender Left



Door Front Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: VF1RFE00553362610




CONDITION REPORT



Report No:
2016932596
DATE
02/07/2025



Door Rear Left

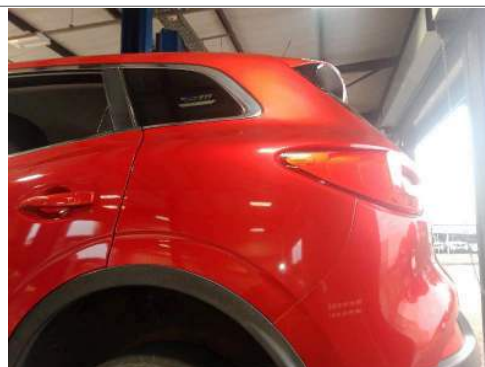

Rear Fender Left



Rear bumper



Boot Lid / Hatch door



Ball Joint(s) Front Axle Left



Ball Joint(s) Front Axle Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: VF1RFE00553362610



CONDITION REPORT



Report No:
2016932596
DATE
02/07/2025



Tie Rod End right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: VF1RFE00553362610