



CONDITION REPORT

Report No: 2016537084

DATE
18/09/2024

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	18/09/2024		M57 Pretoria Road - 1619
Inspection Date	18/09/2024		Kempton Park - GT

Vehicle Data

Vehicle Type	LIGHT LOAD VEHICLE	Registered Owner	
Manufacturer	NISSAN	Registration Number	FP25LNGP
Model	NAVARA	Register Number	
VIN	VSKCVAD40Z0414249	Date Of First Licensing	
Engine Number		Last COR	
Doors	4	License Expiry Date	31/12/2020
Color	WHITE	Power / Displacement	
Year Model		Paint Finish	TWO COAT METALLIC
Km Reading	308,662 KM	Fuel	DIESEL
Cab / Body Type	DOUBLE CAB	Transmission	MANUAL

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

Damage	Repair Way
Engine Oil Leak	Repair
Hoses Oil Sweat	Repair
Radiator Damaged	Replace
Center Console / Cubbyhole + Lid Damaged	Repair
Windscreen Wiper Damaged	Replace
Tail Light Left Damaged	Replace
Tail Light Right Damaged	Replace
Fog Light Front Left Damaged	Replace
Seat Front Right Damaged	Repair
Front Bumper Damaged	Repair
Bonnet Damaged	Repair
C • Pillar Left Damaged	Repair
Front Fender Left Damaged	Repair
Front Fender Right Damaged	Repair
Rear Fender Left Damaged	Repair
Rear Fender Right Damaged	Repair
Door Front Left Damaged	Repair
Door Front Right Damaged	Repair
Door Rear Left Damaged	Repair
Door Rear Right Damaged	Repair
Tailgate Damaged	Repair
Rear bumper Damaged	Repair
Windscreen Damaged	Replace
Bolt(s) / Nut(s) Front Wheel Left Missing	Replace
Bolt(s) / Nut(s) Front Wheel Right Missing	Replace
Bolt(s) / Nut(s) Rear Wheel Left Missing	Replace
Bolt(s) / Nut(s) Rear Wheel Right Missing	Replace
Engine to silencer pipe Welded	Replace
Gearbox Oil Leak	Replace

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: VSKCVAD40Z0414249



CONDITION REPORT

Report No: 2016537084

DATE
18/09/2024

Damage	Repair Way
Differential Oil Leak	Repair

Brakes
Brake Test Results

	Left	Right	Axle Weight [KG]	Deceleration [m/s ²]
	Braking Force [KN]	Braking Force [KN]		
Front	4.16	4.46	-	
Rear	2.61	0.23	-	
Emergency / Parking	2.81	0.73	-	

Tyres and Rims
Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	265/65R17	112S	Bridgestone	Radial	V	4215	1 mm
Front Right	265/65R17	112S	Bridgestone	Radial	V	4115	1 mm
Rear Left	265/65R17	112S	Bridgestone	Radial	V	3315	1 mm
Rear Right	265/65R17	112S	Bridgestone	Radial	V	3415	1 mm

* Tyre Legend: V=Virgin, R=Recap

Diagnostic
During the diagnostic no active error messages were detected. (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

Inspection Conditions
No Test Drive
Battery Flat
Engine number – not possible to verify engine number (not visible without dismantling)
Inspection conditions for the vehicle inspection were sufficient

Comments
General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS.Engine Compartment: Fan counting damaged.
Body • Exterior: Signs of repair work done to somebody panels. Poor alignment to somebody panels.

Concluding Remarks
THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician
Werner Laubscher

This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.



CONDITION REPORT


VIN: VSKCVAD4070414749

Report No: 2016537084


2 / 13

DATE


18/09/2024

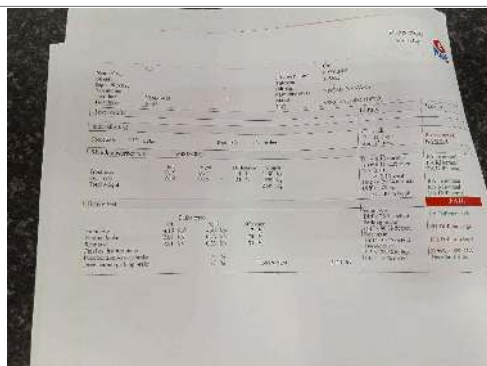

Brake and shock test

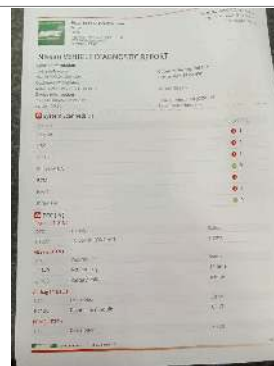

Diagnostic report

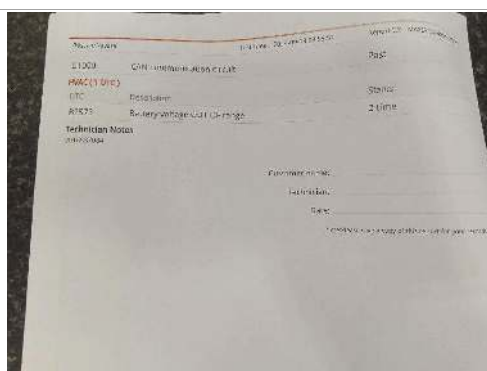

diagnostics.



FRONT RIGHT CORNER



REAR LEFT CORNER



INTERIOR (FRONT DRIVER DOOR)



CONDITION REPORT

Report No: 2016537084
VIN: VSKCVAD40Z0414249
DATE
18/09/2024

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016537084

VIN: VSKCVAD40Z0412249
DATE
18/09/2024
4 / 13

DASHBOARD (W/ ENGINE RUNNING)



ODOMETER



manual.



90 DEGREE FRONT



90 DEGREE RIGHT



90 DEGREE REAR



CONDITION REPORT

Report No: 2016537084

DATE
18/09/2024

VIN: VSKCVAD40Z0414249

5 / 13

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016537084

DATE
18/09/2024

VIN: VSKCVAD40Z0414249


6 / 13



90 DEGREE LEFT



LF TYRE TREAD

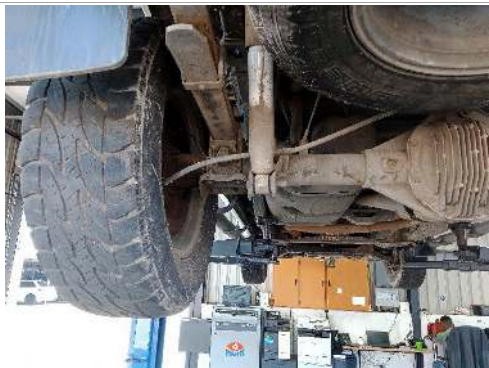

LR TYRE TREAD



RR TYRE TREAD



RF TYRE TREAD



LICENSE DISC

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016537084

DATE
18/09/2024

VIN: VSKCVAD40Z0414249
7 / 13

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016537084

DATE
18/09/2024


VIN PLATE OR STICKER



ENGINE 1



undercarriage front.

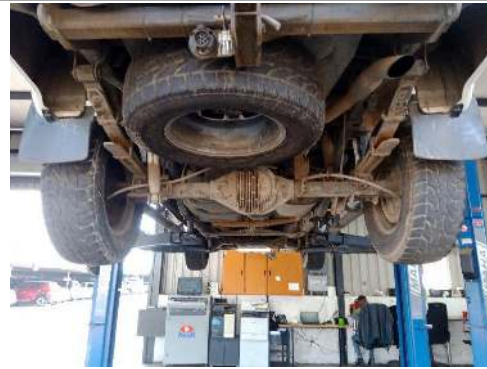

undercarriage rear.



water level



oil cap and dipstick.



CONDITION REPORT

Report No: 2016537084

DATE
18/09/2024

VIN: VSKCVAD40Z0414249
9 / 13

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016537084

DATE
18/09/2024



Radiator



Hoses



Front Bumper



Front Bumper



Bonnet



Front Fender Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016537084

DATE
18/09/2024

VIN: VSKCVAD40Z0414249
11 / 13

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016537084

DATE
18/09/2024



Rear Fender Left



VIN: VSKCVAD40Z0414249
12 / 13

Door Front Left



Door Rear Left



C • Pillar Left



Rear bumper



Rear bumper

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016537084

DATE
18/09/2024

VIN: VSKCVAD40Z0414249
13 / 13

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016537084

DATE
18/09/2024

Tailgate



Door Rear Right



Door Front Right



Rear Fender Right



Front Fender Right



Tail Light Left



CONDITION REPORT

Report No: 2016537084

DATE
18/09/2024

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016537084

DATE
18/09/2024

Tail Light Right



Fog Light Front Left



Front Fender Left



Front Fender Right



Windscreen Wiper



Windscreen



CONDITION REPORT

Report No: 2016537084

DATE
18/09/2024

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016537084

DATE
18/09/2024

Engine



Gearbox



Engine to silencer pipe



Differential



Differential



Bolt(s) / Nut(s) Front Wheel Right



CONDITION REPORT

Report No: 2016537084

DATE
18/09/2024

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016537084

DATE
18/09/2024


Bolt(s) / Nut(s) Front Wheel Left



Bolt(s) / Nut(s) Rear Wheel Left



Bolt(s) / Nut(s) Rear Wheel Right

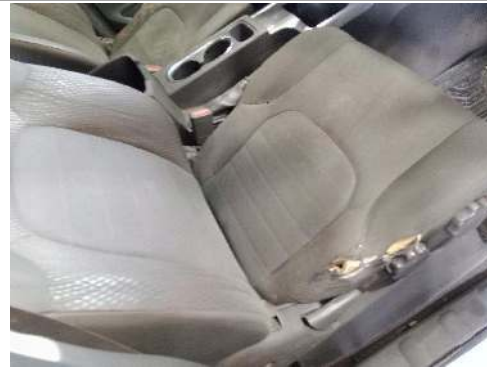

Seat Front Right



Center Console / Cubbyhole + Lid



Center Console / Cubbyhole + Lid



CONDITION REPORT

Report No: 2016537084

DATE
18/09/2024

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za