



CONDITION REPORT

Report No: 2016397011

DATE
28/05/2024

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	28/05/2024		M57 Pretoria Road - 1619
Inspection Date	28/05/2024		Kempton Park - GT

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	MFC AUCTION HOUSE
Manufacturer	OPEL	Registration Number	HTX018MP
Model	CORSA	Register Number	
VIN	W0L0XEP68F4294642	Date Of First Licensing	
Engine Number		Last COR	
Doors	5	License Expiry Date	30/09/2024
Color	WHITE	Power / Displacement	
Year Model		Paint Finish	TWO COAT UNI
Km Reading	199,378 KM	Fuel	PETROL
Cab / Body Type	HATCHBACK	Transmission	MANUAL

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

Damage	Repair Way
Engine Oil Leak	Repair
Engine Wiring Damaged	Replace
Radio/CD/USB Missing	Repair
Center Console / Cubbyhole + Lid Damaged	Replace
Engine Management Lights Set	Repair
Sun Visor Right Damaged	Replace
Front Bumper Damaged	Repair
Bonnet Damaged	Repair
Front Fender Left Damaged	Repair
Front Fender Right Damaged	Repair
Rear Fender Left Damaged	Repair
Rear Fender Right Damaged	Repair
Door Front Left Damaged	Repair
Door Front Right Damaged	Repair
Door Rear Left Damaged	Repair
Door Rear Right Damaged	Repair
Rear bumper Damaged	Repair
Gearbox Mountings Worn	Replace
Gearbox Oil Leak	Repair
Engine Performance Insufficient	Repair
Foreign substance in expansion bottle	Repair
ECU bracket loose	Repair
Engine	Battery loose

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: W0L0XEP68F4294642

1 / 12



CONDITION REPORT

Report No: 2016397011

 DATE
28/05/2024

Brakes

Brake Test Results

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s ²]
Front	3.0	2.97	-	
Rear	1.82	2.13	-	
Emergency / Parking	1.18	1.68	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	185/65R15	88H	Davanti	Radial	V	2823	4 mm
Front Right	185/65R15	88H	Davanti	Radial	V	2823	4 mm
Rear Left	185/65R15	88H	Davanti	Radial	V	2923	4 mm
Rear Right	185/65R15	88H	Davanti	Radial	V	2823	4 mm

* Tyre Legend: V=Virgin, R=Recap

Diagnostic

During the diagnostic no active error messages were detected. (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

Inspection Conditions

No Test Drive
 Battery Flat
 Engine number – not possible to verify engine number (not visible without dismantling)
 Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS.

Concluding Remarks


THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician


Werner Laubscher

This document was created electronically and is valid without signature.


General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

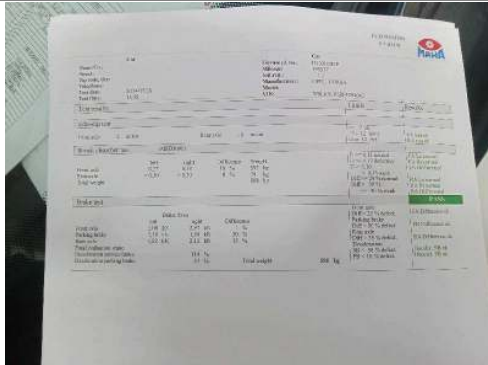


Brake test

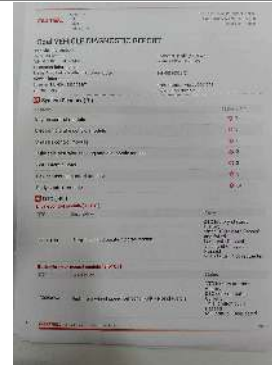


Diagnostic report

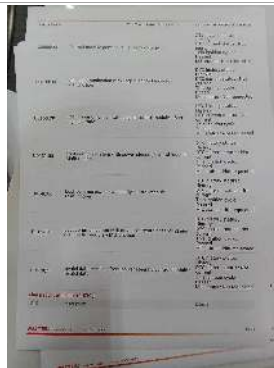


Diagnostic report

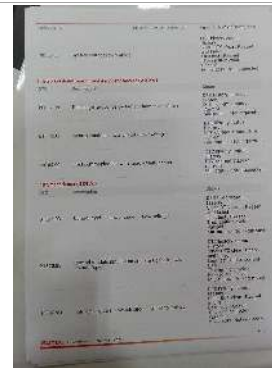

Diagnostic report

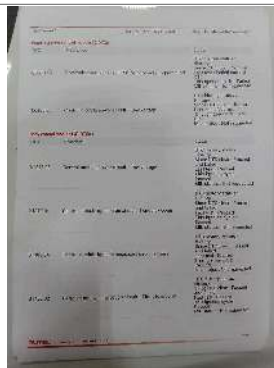

Diagnostic report

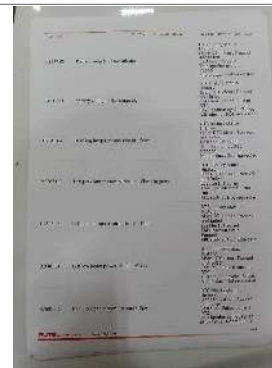

Diagnostic report

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016397011

VIN: W0L0XEP68F4294642

DATE
28/05/2024


DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za




CONDITION REPORT

Report No: 2016397011


DATE
VIN: W0LOXEP68F4294642
28/05/2024
4/12

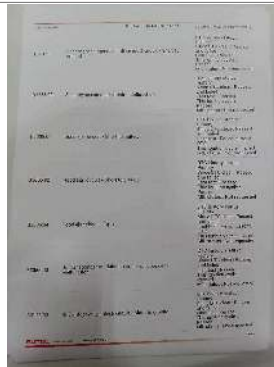


Diagnostic report

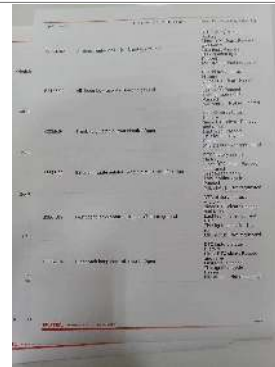

Diagnostic report

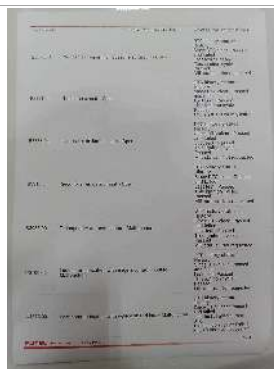


Diagnostic report

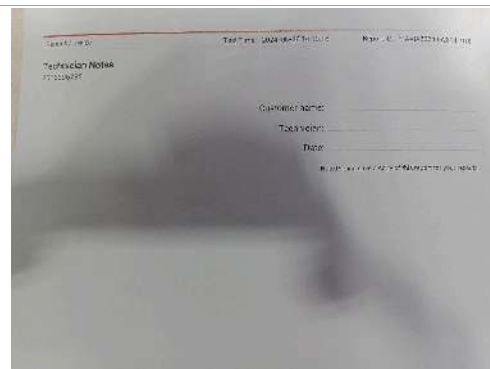

Diagnostic report



FRONT RIGHT CORNER

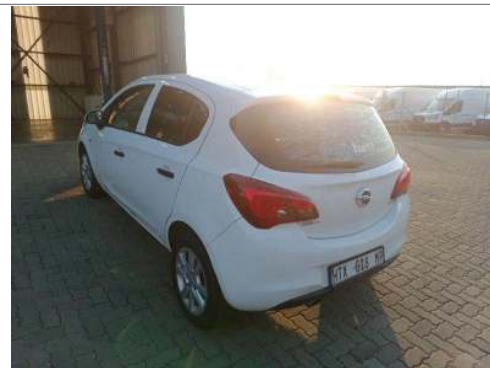

REAR LEFT CORNER



CONDITION REPORT

Report No: 2016397011

DATE
28/05/2024

VIN: W0L0XEP68F4294642

5 / 12

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016397011

DATE
28/05/2024

VIN: W0LOXEP68F4294642

6 / 12



INTERIOR (FRONT DRIVER DOOR)



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER



ADDITIONAL 11



90 DEGREE FRONT



90 DEGREE RIGHT



CONDITION REPORT

Report No: 2016397011

DATE
28/05/2024

VIN: W0L0XEP68F4294642
7 / 12

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016397011

DATE
28/05/2024


90 DEGREE REAR



90 DEGREE LEFT

VIN: W0L0XEP68F4294642

8 / 12

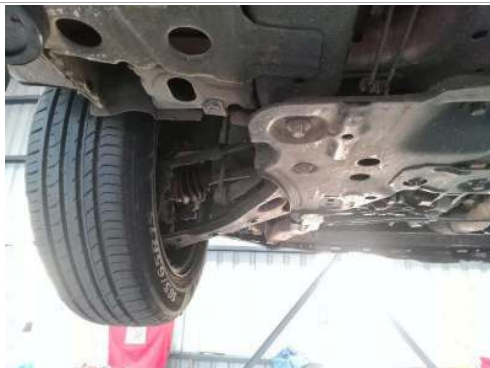

LF TYRE TREAD



LR TYRE TREAD



RR TYRE TREAD



RF TYRE TREAD



CONDITION REPORT

Report No: 2016397011

DATE
28/05/2024

VIN: W0L0XEP68F4294642

9 / 12

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016397011


DATE
28/05/2024



LICENSE DISC



VIN PLATE OR STICKER

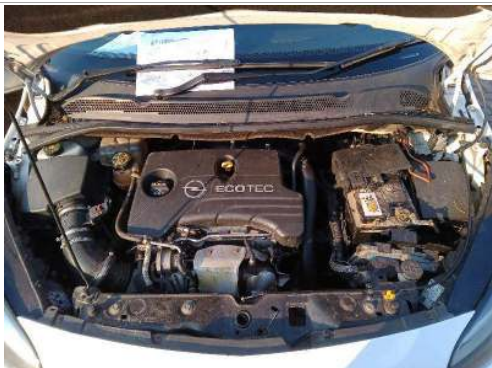

ENGINE 1



ADDITIONAL 14



ADDITIONAL 13



ADDITIONAL 10



CONDITION REPORT

Report No: 2016397011

DATE
28/05/2024

VIN: W0L0XEP68F4294642
11 / 12

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016397011

DATE
28/05/2024

Water level



Engine Wiring

VIN: W802FP68F4294642
12 / 12

Engine Wiring



Engine Wiring



Front Bumper



Front Bumper



CONDITION REPORT

Report No: 2016397011

DATE
28/05/2024

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016397011

DATE
28/05/2024


Bonnet




Front Fender Left



Door Front Left

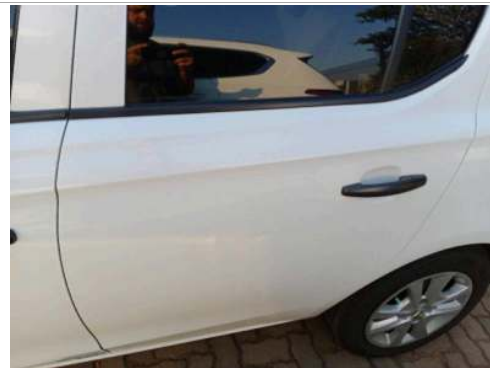

Door Rear Left

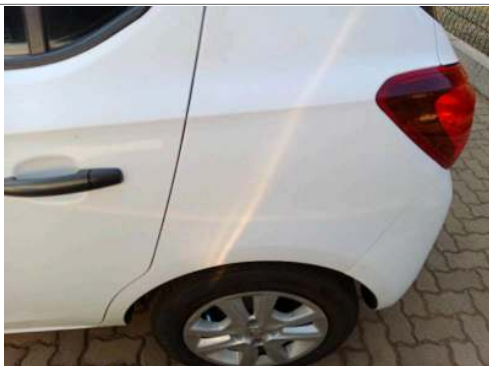

Rear Fender Left



Rear bumper



CONDITION REPORT

Report No: 2016397011

DATE
28/05/2024

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016397011

DATE
28/05/2024

Rear bumper



Door Rear Right



Door Front Right



Rear Fender Right



Front Fender Right



Radio/CD/USB



CONDITION REPORT

Report No: 2016397011

DATE
28/05/2024

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016397011

DATE
28/05/2024

Engine Management Lights



Center Console / Cubbyhole + Lid



Engine



Gearbox



Gearbox Mountings



Sun Visor Right



CONDITION REPORT

Report No: 2016397011

DATE
28/05/2024

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za