



CONDITION REPORT

Report No: 2016738143

DATE
28/01/2025

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	28/01/2025		M57 Pretoria Road - 1619
Inspection Date	28/01/2025		Kempton Park - GT

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	
Manufacturer	OPEL	Registration Number	KL91BVGP
Model	ASTRA 1.4T ESSENTIA 5-DR [2013-2014]	Register Number	
VIN	W0LPD6EC0DG073339	Date Of First Licensing	
Engine Number		Last COR	
Doors	5	License Expiry Date	29/02/2024
Color	SILVER	Power / Displacement	
Year Model	2014	Paint Finish	TWO COAT UNI
Km Reading	143,873 KM	Fuel	PETROL
Cab / Body Type	HATCHBACK	Transmission	MANUAL

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

Damage	Repair Way
Engine Oil Leak	Repair
Engine Wiring Defective	Repair
Head Light Switch Defective	Repair
Center Console / Cubbyhole + Lid Defective	Repair
Air Conditioner Insufficient	Replace
Indicator Light Front Right Defective	Repair
Headlight Left Damaged	Replace
Headlight Right Damaged	
Fog Light Front Left Defective	Repair
Seat Front Left Dirty	Repair
Seat Rear Defective	Repair
Sun Visor Left Damaged	Replace
Sun Visor Right Damaged	Replace
Door Handle Front Right Defective	Repair
Dash Padding Defective	Repair
Steering Wheel Trim Defective	Repair
Front Bumper Damaged	Repair
Grill Cracked	Repair
Bonnet Paintwork • Scratched	Repair
A • Pillar Left Residual Traces of Repair	Repair

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: W0LPD6EC0DG073339

1 / 21



CONDITION REPORT

Report No: 2016738143

DATE
28/01/2025

Damage	Repair Way
A • Pillar Right Damaged	Repair
B • Pillar Right Dented	Repair
Front Fender Left Residual Traces of Repair	Repair
Front Fender Right Damaged	Repair
Rear Fender Left Residual Traces of Repair	Replace
Rear Fender Right Residual Traces of Repair	Repair
Front Fender Left / Inner Tray Damaged	Replace
Door Front Left Dented	Repair
Door Front Right Paintwork • Scratched	Repair
Door Rear Left Damaged	Repair
Door Rear Right Paintwork • Scratched	Repair
Doorstopper Front Right Damaged	Replace
Boot Lid / Hatch door Damaged	Repair
Rear bumper Paintwork • Scratched	Repair
Sill Panel Left Damaged	Repair
Sill Panel Right Damaged	Repair
Roof Paintwork • Scratched	Repair
Shock Absorber Front Right Leak	Replace
Stabilizer Mounting Rear Right Damaged	Replace
Tyre Front Left Damaged	Replace
Tyre Front Right Worn	Replace
Tyre Rear Right Damaged	Replace
Rim Front Left Scratched	Repair
Rim Front Right Scratched	Repair
Rim Rear Left Scratched	Repair
Rim Rear Right Scratched	Repair
Main Beam Left Damaged	Repair
Chassis Damaged	Repair
Cross Member Front Right Damaged	Replace
Sub Frame Damaged	Repair
Engine to silencer pipe Damaged	Repair
Silencer Defective	Repair
Belly plates Damaged	Repair
Gearbox Mountings Damaged	Replace
Gearbox Damaged	Repair
Engine Noise Excessive	Repair
Engine Smoke Excessive	Repair
Gear Selections Malfunction	Repair
Engine management light illuminated on dashboard	Repair
Interior	Vehicle interior dirty and some panels scratched
Tyres and rims	Spare wheel missing
Engine	Engine bay dirty and battery loose
Engine	Fan Cowley damaged
Undercarriage	Signs of surface rust on undercarriage
Undercarriage	Vehicle undercarriage dirty
Body and Exterior	Signs of impact damage to front of vehicle
Body and Exterior	Poor residual traces of repair on some body panels
Body and Exterior	Dents and scratches on some body panels
Body and Exterior	Some body panels misaligned
Body and Exterior	Stone chips and spray work on some body panels
Body and Exterior	Signs of impact damage to front of vehicle
Body and Exterior	Vehicle safety integrity compromised.

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016738143

DATE
28/01/2025

Brakes

Brake Test Results

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s ²]
Front	3.55	3.37	-	
Rear	2.31	2.4	-	
Emergency / Parking	1.72	1.7	-	

Tyres and Rims

Tyre Specification & Measurement

VIN: W0LPD6EC0DG073339

2 / 21

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	225/45Z R17	91W	Timax	EcoSport	V	3520	0 mm
Front Right	225/45Z R17	94Y	Eurovis	Roadstone	V	1222	0 mm
Rear Left	225/45 R17	91W	Continental	Contisport	V	0222	1 mm
Rear Right	225/45 R17	94W	Apollo	Aspire	V	4919	0 mm

* Tyre Legend: V=Virgin, R=Recap

Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

No	System	Code	Description	Status
1	ENGINE CONTROL MODULE	C1221:00	LEFT FRONT WHEEL SPEED SENSOR CIRCUIT MALFUNCTION	

Inspection Conditions

No Test Drive

Battery Flat

Engine number – not possible to verify engine number (not visible without dismantling)

Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Sibusiso Mokase

This document was created electronically and is valid without signature.


General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016738143

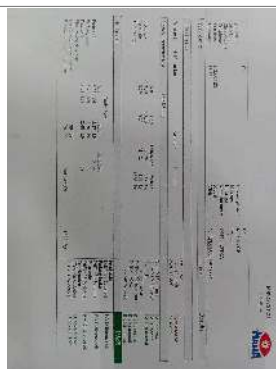DATE
28/01/2025


Brake and shock absorber repor




Diagnostic report page 1




Diagnostic report page 2

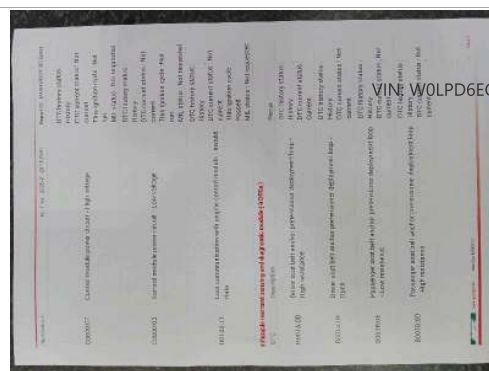

Diagnostic report page 3

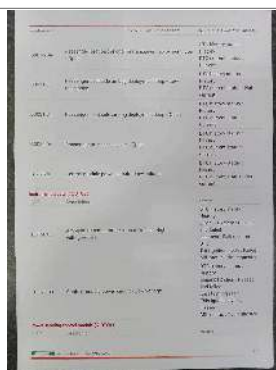

Diagnostic report page 4

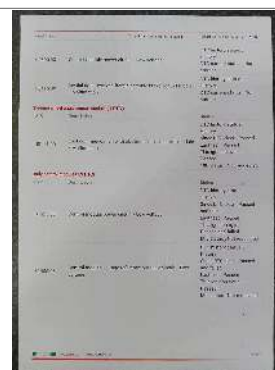

Diagnostic report page 5

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016738143

DATE
28/01/2025

VIN: W0LPD6EC0DG073339


4 / 21

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za




CONDITION REPORT


Report No: 2016738143

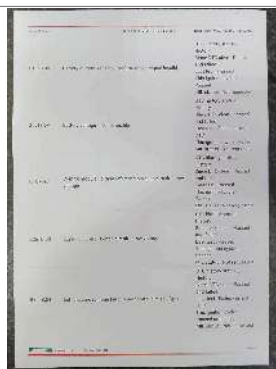DATE
28/01/2025


Diagnostic report page 6

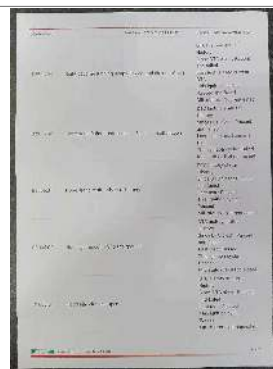


Diagnostic report page 7

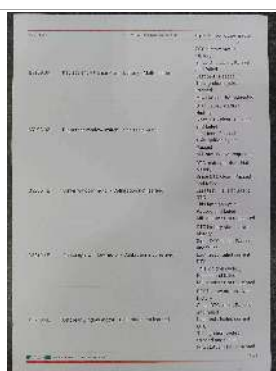


Diagnostic report page 8

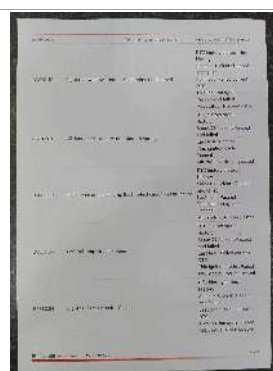

Diagnostic report page 9

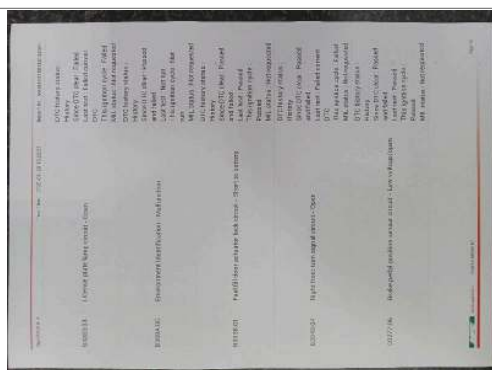

Diagnostic report page 10

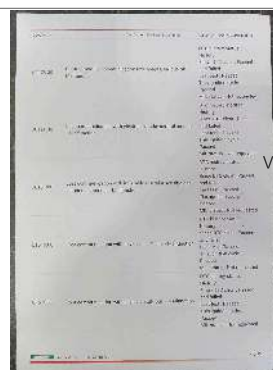

Diagnostic report page 11

VIN: W0LPD6EC0DG073339
5 / 21

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016738143

DATE
28/01/2025

VIN: W0LPD6EC0DG073339


6 / 21

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za




CONDITION REPORT


Report No: 2016738143

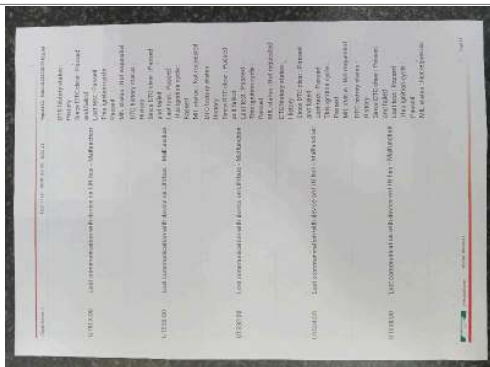DATE
28/01/2025

Diagnostic report page 12

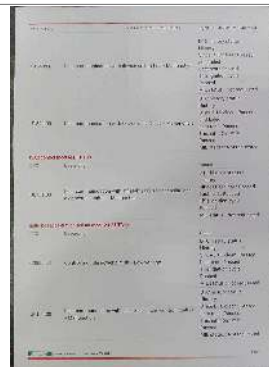

Diagnostic report page 13

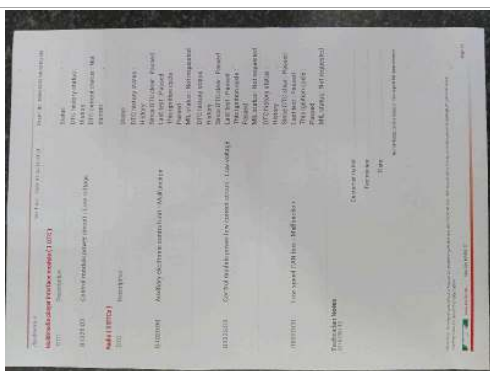

Diagnostic report page 14



FRONT RIGHT CORNER



REAR LEFT CORNER



INTERIOR (FRONT DRIVER DOOR)

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: W0LPD6EC0DG073339

**CONDITION REPORT**

7 / 21
Report No: 2016738143

DATE
28/01/2025

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016738143

DATE
28/01/2025

DASHBOARD (W/ ENGINE RUNNING)



ODOMETER



Manual transmission



90 DEGREE FRONT



90 DEGREE RIGHT



90 DEGREE REAR

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

**CONDITION REPORT****Report No: 2016738143****DATE**
28/01/2025

VIN: W0LPD6EC0DG073339

9 / 21

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016738143

DATE
28/01/2025

90 DEGREE LEFT



LF TYRE TREAD



LR TYRE TREAD



RR TYRE TREAD



RF TYRE TREAD



Triangle

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

**CONDITION REPORT****Report No: 2016738143****DATE**
28/01/2025

VIN: W0LPD6EC0DG073339

11 / 21

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za




CONDITION REPORT


Report No: 2016738143

DATE
28/01/2025

LICENSE DISC

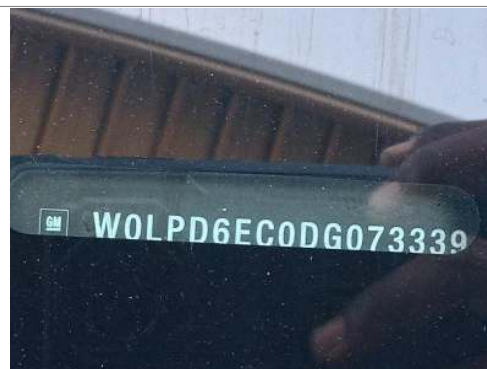

VIN PLATE OR STICKER

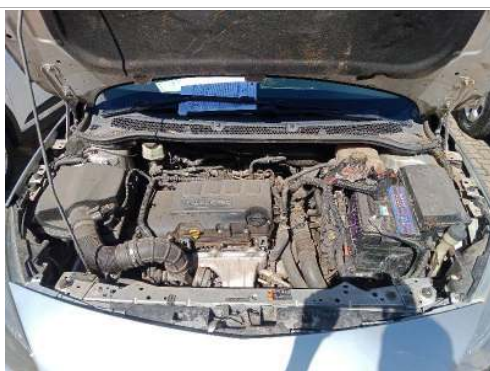

ENGINE 1



Front chassis



Rear chassis



Oil cap and dipstick

VIN: WOLPD6EC0DG073339

12 / 21

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

**CONDITION REPORT****Report No: 2016738143****DATE**
28/01/2025

VIN: W0LPD6EC0DG073339

13 / 21

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016738143

DATE
28/01/2025

Fan Cowley



Engine Wiring



Headlight Left



Headlight Right



Dash Padding



Steering Wheel Trim

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No. 2016738/143

DATE
28/01/2025

DEKRA Automotive (PTY) Ltd
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016738143

DATE
28/01/2025

Center Console / Cubbyhole + Lid



Sun Visor Left

VIN: W0LPD6EC0DG073339
15 / 21

Sun Visor Right



Doorstopper Front Right



Sill Panel Right



B • Pillar Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

**CONDITION REPORT****Report No: 2016738143****DATE**
28/01/2025

VIN: W0LPD6EC0DG073339

16 / 21

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016738143

DATE
28/01/2025

A • Pillar Right



Door Handle Front Right



Seat Rear



Rear Fender Right



Door Rear Right



Door Front Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

**CONDITION REPORT****Report No: 2016738143****DATE**
28/01/2025

VIN: W0LPD6EC0DG073339

18 / 21

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016738143

DATE
28/01/2025

Front Fender Right



Front Bumper



Front Bumper



Bonnet



Grill



Front Fender Left

VIN: W0LPD6EC0DG073339

19 / 21

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016738143

DATE
28/01/2025

VIN: W0LPD6EC0DG073339

20 / 21

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016738143

DATE
28/01/2025

A • Pillar Left



Door Front Left



Door Rear Left



Rear Fender Left



Sill Panel Left



Seat Front Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

**CONDITION REPORT**

VIN: W01R065C000738003

Report No: 2016738143

21 / 21

DATE**28/01/2025**

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016738143

DATE
28/01/2025

Rear bumper



Rear bumper



Boot Lid / Hatch door



Roof



Head Light Switch



Indicator Light Front Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

**CONDITION REPORT****Report No: 2016738143****DATE**
28/01/2025

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016738143

DATE
28/01/2025

Air Conditioner



Engine



Main Beam Left



Sill Panel Right



Rim Front Right



Shock Absorber Front Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

**CONDITION REPORT****Report No: 2016738143****DATE**
28/01/2025

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016738143

DATE
28/01/2025

Rim Rear Right




Rim Rear Left



Sill Panel Left



Rim Front Left

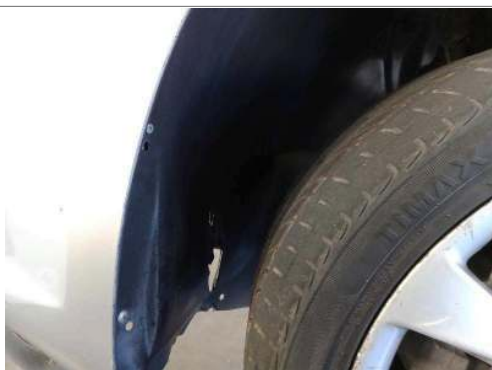

Front Fender Left / Inner Tray



Fog Light Front Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

**CONDITION REPORT****Report No: 2016738143****DATE**
28/01/2025

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016738143

DATE
28/01/2025

Front Bumper



Tyre Front Right



Tyre Front Left



Sub Frame



Engine to silencer pipe



Gearbox

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

**CONDITION REPORT****Report No: 2016738143****DATE**
28/01/2025

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016738143

DATE
28/01/2025

Sub Frame



Gearbox Mountings



Chassis



Cross Member Front Right



Silencer



Belly plates

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

**CONDITION REPORT****Report No: 2016738143****DATE**
28/01/2025

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016738143

DATE
28/01/2025

Tyre Rear Right



Silencer



Stabilizer Mounting Rear Right



Water level

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016738143

DATE
28/01/2025

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za