



CONDITION REPORT



Report No:
2016909977
DATE
11/06/2025

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	11/06/2025		M57 Pretoria Road - 1619
Inspection Date	11/06/2025		Kempton Park - GT

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	
Manufacturer	BMW	Registration Number	KW47WWGP
Model	118i HATCH 5-DR [2011-2016]	Register Number	
VIN	WBA1A32050E590387	Date Of First Licensing	
Engine Number		Last COR	
Doors	5	License Expiry Date	31/10/2025
Color	WHITE	Power / Displacement	
Year Model	2014	Paint Finish	PEARL EFFECT
Km Reading	188,326 KM	Fuel	PETROL
Cab / Body Type	HATCHBACK	Transmission	MANUAL

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za


VIN: WBA1A32050E590387



CONDITION REPORT



Report No:
2016909977
DATE
11/06/2025

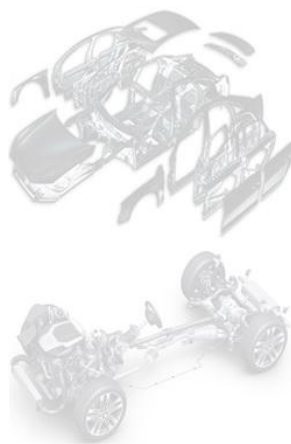

Damage	Repair Way
Engine Oil Leak	Repair
Air cleaner Damaged	Repair
Center Console / Cubbyhole + Lid Damaged	Repair
Seat Front Right Damaged	Repair
Front Bumper Damaged	Repair
Bonnet Damaged	Repair
Front Fender Left Damaged	Repair
Front Fender Right Damaged	Repair
Rear Fender Left Damaged	Repair
Rear Fender Right Damaged	Repair
Door Front Left Damaged	Repair
Door Front Right Damaged	Repair
Door Rear Left Damaged	Repair
Door Rear Right Damaged	Repair
Boot Lid / Hatch door Damaged	Repair
Rear bumper Damaged	Repair
Shock Absorber Front Left Worn	Replace
Shock Absorber Front Right Worn	Replace
Tyre Front Left Worn	Replace
Tyre Front Right Worn	Replace
Tyre Rear Right Worn	Replace
Gearbox Mountings Damaged	Replace
Gearbox Oil Leak	Repair
Engine Performance Idling / Hunting	Repair
Engine Noise Excessive	Repair
Rear tyres size differs	Replace

Brakes

Brake Test Results

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s ²]
Front	2.6	2.44	-	
Rear	2.15	2.07	-	
Emergency / Parking	1.54	1.77	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	225/45R17	94W	Lanvigator	Radial	V	3821	0 mm
Front Right	225/45R17	91Y	General	Radial	V	3920	0 mm
Rear Left	225/45R17	94W	Goodride	Radial	V	1524	3 mm
Rear Right	235/45R17	94W	Bridgestone	Radial	V	0209	0 mm

* Tyre Legend: V=Virgin, R=Recap

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WBA1A32050E590387



CONDITION REPORT



Report No:
2016909977
DATE
11/06/2025

Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

No	System	Code	Description	Status
1	DME	1D3810	CLUTCH SWITCH POSITION IN POSSIBLE	

Inspection Conditions

No Test Drive

Battery Flat

Engine number – not possible to verify engine number (not visible without dismantling)

Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS. 84 DTC'S AT TIME OF TESTING SEE DTC REPORT. REAR TIRE SIZES DO NOT MATCH. Engine Compartment: oil level could not be checked correctly dipstick damaged.

Body • Exterior: Minor dents and scratches and stone chips to some body panels. Signs of repair work done to somebody panels. Poor alignment to somebody panels. Repair work done to vehicle below standard. Vehicle body in poor condition. Driver side door does not open from outside.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Werner Laubscher

This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WBA1A32050E590387



CONDITION REPORT



Report No:
2016909977
DATE
11/06/2025

VEHICLE INFORMATION			
Make/Model	Year	Engine	Color
BMW 3 Series	2016	2.0L	Black
Registration	2016/04	2016/04	2016/04
Inspection	11/06/2025	11/06/2025	11/06/2025
BRAKE TEST RESULTS			
Wheel	Speed (km/h)	Brake Pressure (bar)	Brake Force (N)
Front Left	100	1.2	1500
Front Right	100	1.1	1400
Rear Left	100	0.8	1000
Rear Right	100	0.7	900

Brake test.

BMW VEHICLE DIAGNOSTIC REPORT			
Vehicle ID	Engine ID	Transmission ID	ABS ID
123456789	987654321	456789012	345678901
DIAGNOSTIC RESULTS			
Engine	Transmission	ABS	ESP
Pass	Pass	Pass	Pass
ADDITIONAL NOTES			
All systems checked and found to be in good working order.			

Diagnostic.

VEHICLE INFORMATION			
Make/Model	Year	Engine	Color
BMW 3 Series	2016	2.0L	Black
Registration	2016/04	2016/04	2016/04
Inspection	11/06/2025	11/06/2025	11/06/2025
DIAGNOSTIC RESULTS			
Engine	Transmission	ABS	ESP
Pass	Pass	Pass	Pass
ADDITIONAL NOTES			
All systems checked and found to be in good working order.			

Diagnostic.

BMW VEHICLE DIAGNOSTIC REPORT			
Vehicle ID	Engine ID	Transmission ID	ABS ID
123456789	987654321	456789012	345678901
DIAGNOSTIC RESULTS			
Engine	Transmission	ABS	ESP
Pass	Pass	Pass	Pass
ADDITIONAL NOTES			
All systems checked and found to be in good working order.			

Diagnostic.

VEHICLE INFORMATION			
Make/Model	Year	Engine	Color
BMW 3 Series	2016	2.0L	Black
Registration	2016/04	2016/04	2016/04
Inspection	11/06/2025	11/06/2025	11/06/2025
DIAGNOSTIC RESULTS			
Engine	Transmission	ABS	ESP
Pass	Pass	Pass	Pass
ADDITIONAL NOTES			
All systems checked and found to be in good working order.			

Diagnostic.

BMW VEHICLE DIAGNOSTIC REPORT			
Vehicle ID	Engine ID	Transmission ID	ABS ID
123456789	987654321	456789012	345678901
DIAGNOSTIC RESULTS			
Engine	Transmission	ABS	ESP
Pass	Pass	Pass	Pass
ADDITIONAL NOTES			
All systems checked and found to be in good working order.			

Diagnostic.

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WBA1A32050E590387



CONDITION REPORT



Report No:
2016909977
DATE
11/06/2025



FRONT RIGHT CORNER



REAR LEFT CORNER



INTERIOR (FRONT DRIVER DOOR)



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER



Manual.

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WBA1A32050E590387



CONDITION REPORT



Report No:
2016909977
DATE
11/06/2025



90 DEGREE FRONT




90 DEGREE RIGHT



90 DEGREE REAR



90 DEGREE LEFT

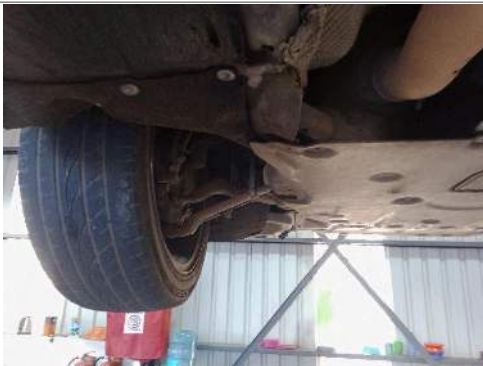

LF TYRE TREAD



LR TYRE TREAD

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WBA1A32050E590387



CONDITION REPORT




Report No:
2016909977
DATE
11/06/2025



RR TYRE TREAD



RF TYRE TREAD

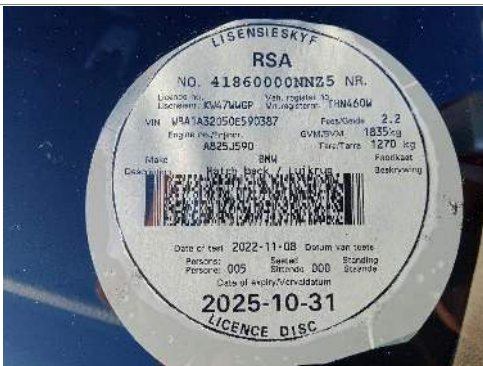

LICENSE DISC



VIN PLATE OR STICKER



ENGINE 1



Undercarriage front.

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WBA1A32050E590387



CONDITION REPORT



Report No:
2016909977
DATE
11/06/2025



Undercarriage rear.



Oil cap and dipstick.



Water level



Air cleaner



Front Bumper



Front Bumper

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WBA1A32050E590387



CONDITION REPORT




Report No:
2016909977
DATE
11/06/2025



Bonnet




Front Fender Left

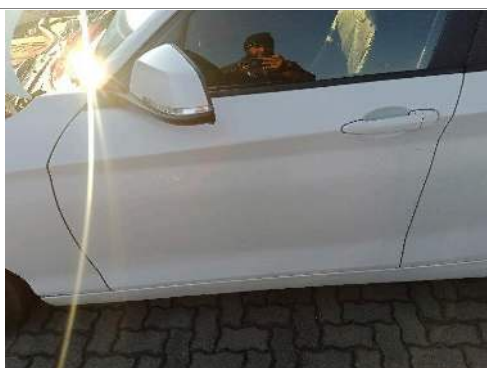

Door Front Left



Door Rear Left

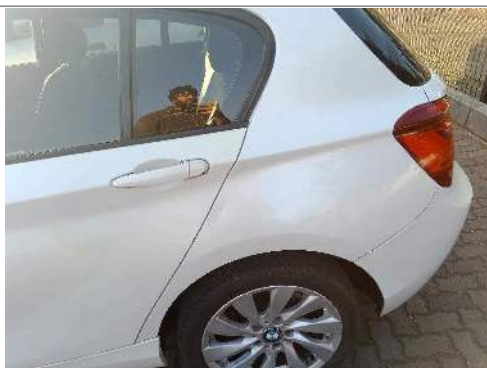

Rear Fender Left



Boot Lid / Hatch door

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WBA1A32050E590387



CONDITION REPORT



Report No:
2016909977
DATE
11/06/2025



Rear bumper



Rear bumper



Door Front Right



Door Rear Right



Front Fender Right



Rear Fender Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WBA1A32050E590387



CONDITION REPORT



Report No:
2016909977
DATE
11/06/2025



Center Console / Cubbyhole + Lid



Tyre Rear Right



Tyre Front Left



Tyre Front Right



Shock Absorber Front Right



Shock Absorber Front Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WBA1A32050E590387



CONDITION REPORT



Report No:
2016909977
DATE
11/06/2025



Engine



Gearbox Mountings



Gearbox



Seat Front Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WBA1A32050E590387